

E-Multi®



User Manual

version 6-2



Contents

Section 1 - Introduction1-1

| | |
|--|-----|
| 1.1 Intended Use | 1-1 |
| 1.2 Documentation | 1-1 |
| 1.3 Release Details | 1-1 |
| 1.4 Warranty | 1-1 |
| 1.5 Returned Goods Policy..... | 1-1 |
| 1.6 Movement or Resale of Mold-Masters Products or Systems | 1-2 |
| 1.7 Copyright | 1-2 |
| 1.8 Units of Measure and Conversion Factors | 1-2 |

Section 2 - Global Support2-1

| | |
|--|-----|
| 2.1 Corporate Offices..... | 2-1 |
| 2.2 International Representatives..... | 2-2 |

Section 3 - Safety.....3-1

| | |
|---|------|
| 3.1 Introduction | 3-1 |
| 3.2 Safety Hazards | 3-2 |
| 3.3 Operational Hazards..... | 3-5 |
| 3.4 General Safety Symbols..... | 3-7 |
| 3.5 Wiring Check | 3-8 |
| 3.6 Lockout Safety | 3-9 |
| 3.6.1 Electrical Lockout..... | 3-10 |
| 3.6.2 Energy Forms and Lockout Guidelines..... | 3-11 |
| 3.7 Disposal..... | 3-12 |
| 3.8 E-Multi Injection Unit Safety Hazards | 3-13 |
| 3.9 E-Multi Servo Carriage Safety Hazard | 3-15 |
| 3.10 E-Multi Radial Unit Hazards | 3-16 |
| 3.11 Safety Symbols on the E-Multi Injection Unit..... | 3-18 |
| 3.12 Safety Guards..... | 3-19 |
| 3.13 E-Multi Weight Specifications | 3-20 |
| 3.14 Lift the E-Multi Injection Unit..... | 3-21 |
| 3.14.1 Prior to Lifting the E-Multi Injection Unit..... | 3-21 |
| 3.15 EM1 / EM2 / EM3 Lift Connections..... | 3-22 |
| 3.15.1 EM1 / EM2 / EM3 Vertical Lift Connections | 3-22 |
| 3.15.2 EM1 / EM2 / EM3 Horizontal Lift Connections..... | 3-23 |
| 3.16 EM4 Vertical Lift Procedures | 3-24 |
| 3.16.1 Horizontal Placement from the Shipping Crate..... | 3-24 |
| 3.16.2 Horizontal Placement from a Horizontal Stand..... | 3-25 |
| 3.16.3 Attach the Lifting Bar..... | 3-25 |
| 3.16.4 Vertical Orientation with Two Lifting Machines | 3-27 |
| 3.16.5 Vertical Orientation with One Lifting Machine | 3-29 |
| 3.16.6 E-Multi Injection Unit Installation onto the Molding Machine | 3-30 |
| 3.17 EM4 Horizontal Lift Connections | 3-31 |

| | |
|--|------------|
| Section 4 - Overview | 4-1 |
| 4.1 E-Multi Injection Unit Models | 4-1 |
| 4.2 E-Multi Injection Unit Components | 4-2 |
| Section 5 - Preparation | 5-1 |
| 5.1 Shipping Contents | 5-1 |
| 5.2 Unpacking..... | 5-2 |
| 5.3 Inspection | 5-2 |
| Section 6 - Installation | 6-1 |
| 6.1 Attach E-Multi Injection Unit to the Mold / Machine | 6-2 |
| 6.2 Controller Installation..... | 6-3 |
| 6.3 Operational Environment..... | 6-4 |
| Section 7 - System Setup..... | 7-1 |
| 7.1 Connection of the Controller to the E-Multi Injection Unit..... | 7-1 |
| 7.1.1 Route and Connect Servo Cables | 7-1 |
| 7.1.2 Route and Connect Heater, I/O, Injection Molding Machine Cables..... | 7-2 |
| 7.2 Connection to a Robot..... | 7-4 |
| 7.3 Connection of the Controller to the Molding Machine..... | 7-4 |
| 7.4 Connection of a Handheld HMI (Optional)..... | 7-4 |
| 7.5 Air Connections | 7-5 |
| 7.6 Water Connections | 7-6 |
| 7.6.1 Cooling Water Schematic | 7-7 |
| 7.6.2 Corrosion Caused by Condensation..... | 7-7 |
| 7.6.3 Cooling Water Quality | 7-7 |
| 7.6.4 Coolant and Additives | 7-8 |
| 7.7 Connection to a Diagnostic Computer (Optional)..... | 7-9 |
| Section 8 - Operation | 8-1 |
| 8.1 Introduction | 8-1 |
| 8.2 Controller Startup and Shutdown | 8-1 |
| 8.3 Switch On | 8-2 |
| 8.4 Switch Off (Shutdown)..... | 8-2 |
| 8.4.1 Shutdown the Heating | 8-2 |
| 8.4.2 Shutdown the Controller | 8-2 |
| Section 9 - Lubrication..... | 9-1 |
| 9.1 Preventive Maintenance Schedule | 9-1 |
| 9.2 Preload Oil Pressures..... | 9-4 |
| 9.2.1 Check the Preload Oil Pressure | 9-5 |
| 9.2.2 Assemble the Injection Pressure Oil Fill Kit | 9-5 |
| 9.2.3 Charge the High Pressure Oil Circuit with the Oil Kit..... | 9-6 |
| 9.3 Oil Bath..... | 9-7 |
| 9.3.1 Oil Bath Location | 9-7 |
| 9.3.2 Fill the Oil Bath | 9-8 |
| 9.4 Injection Ball Screws and Linear Guides | 9-9 |
| 9.4.1 Locations of the Lubrication Points..... | 9-9 |
| 9.4.2 Lubricate the Injection Ball Screws and Linear Guides | 9-23 |

| | |
|--|------|
| 9.4.3 Lubricate the Radial-Carriage Ball Screws and Linear Guides..... | 9-23 |
|--|------|

Section 10 - Maintenance..... 10-1

| | |
|--|-------|
| 10.1 Preventive Maintenance Schedule | 10-1 |
| 10.2 Screw Torques | 10-1 |
| 10.3 Other Torques | 10-2 |
| 10.4 Belt Tensions | 10-2 |
| 10.5 Purge Plastic from System | 10-3 |
| 10.6 Purge Cooling Water from System | 10-3 |
| 10.7 Move the E-Multi Injection Unit for Maintenance | 10-4 |
| 10.8 Clean Servo Motor Cooling Lines..... | 10-4 |
| 10.8.1 Indications of Cooling Line Contamination | 10-4 |
| 10.8.2 Cleaning Recommendations..... | 10-5 |
| 10.9 Adapter Plate Removal and Installation..... | 10-5 |
| 10.10 Injection Nozzle Replacement..... | 10-8 |
| 10.11 Nozzle Protrusion Adjustment - Toggle Link Models | 10-8 |
| 10.11.1 Introduction | 10-8 |
| 10.11.2 Adjust the Nozzle Protrusion Manually | 10-9 |
| 10.12 Nozzle Protrusion Adjustment - Automatic Adjustment..... | 10-12 |
| 10.12.1 Calibrate the Carriage Home Position | 10-12 |
| 10.12.2 Calibrate Manually | 10-12 |
| 10.12.3 Automatic Calibration..... | 10-13 |
| 10.13 Injection Axis Referencing | 10-14 |
| 10.14 Bolt Type Shutoff Nozzle Maintenance..... | 10-15 |
| 10.15 Barrel Head Removal and Replacement..... | 10-17 |
| 10.16 Heater Replacement..... | 10-18 |
| 10.17 Feed Assembly Removal and Replacement..... | 10-22 |
| 10.17.1 Remove Feed Assembly..... | 10-22 |
| 10.17.2 Install the Feed Block | 10-24 |
| 10.18 Feed Screw Cleaning and Replacement..... | 10-25 |
| 10.18.1 Prepare for Feed Screw Removal | 10-25 |
| 10.18.2 Remove the Feed Screw | 10-26 |
| 10.18.3 Cleaning..... | 10-27 |
| 10.18.4 Install the Feed Screw | 10-28 |
| 10.19 Barrel Removal and Installation..... | 10-31 |
| 10.19.1 Remove the Barrel Assembly | 10-31 |
| 10.19.2 Transfer Heaters and Thermocouples to a New Barrel | 10-33 |
| 10.19.3 Install the Barrel Assembly | 10-34 |
| 10.20 Belt Tension Adjustment | 10-36 |
| 10.21 Belt Removal and Installation | 10-37 |
| 10.22 Servicing and Repairing your Controller..... | 10-39 |

Section 11 - Component Tests and System Alarms11-1

| | |
|---|------|
| 11.1 Thermocouple Electrical Test..... | 11-1 |
| 11.2 Heater Continuity Test..... | 11-1 |
| 11.3 Transducer Output Alarm | 11-1 |
| 11.4 Vibrator Valve Test | 11-2 |
| 11.5 Control System Alarms | 11-2 |
| 11.6 Servo Motor Temperature Alarms | 11-3 |

Section 12 - Radial Option 12-1

| | |
|--|-------|
| 12.1 Introduction | 12-1 |
| 12.2 Specifications | 12-1 |
| 12.3 Components | 12-2 |
| 12.4 Unpacking..... | 12-3 |
| 12.5 Inspection | 12-4 |
| 12.6 Installation | 12-5 |
| 12.6.1 ER1 and ER2 Models | 12-5 |
| 12.6.2 ER3 and ER4 Models | 12-9 |
| 12.6.3 Install onto an Injection Molding Machine..... | 12-18 |
| 12.7 Manual Position Adjustment | 12-19 |
| 12.8 Home Position Calibration | 12-22 |
| 12.9 Auto Purge | 12-22 |
| 12.10 Maintenance | 12-23 |
| 12.11 Service of the Carriage Assembly and Servo Motor | 12-23 |
| 12.12 Spare Parts..... | 12-23 |

Section 13 - Servo Carriage Option 13-1

| | |
|--|------|
| 13.1 Introduction | 13-1 |
| 13.2 E-Multi Servo Carriage Specifications | 13-1 |
| 13.3 Material Handling..... | 13-2 |
| 13.3.1 Preparation | 13-2 |
| 13.3.2 Unpacking..... | 13-2 |
| 13.3.3 Inspection | 13-2 |
| 13.3.4 Installation..... | 13-2 |
| 13.4 Calibrate Home Position..... | 13-2 |
| 13.5 Auto Purge | 13-3 |
| 13.6 Maintenance | 13-3 |
| 13.7 Spare Parts..... | 13-3 |

Section 14 - Servo Cooling Option 14-1

| | |
|---|------|
| 14.1 Operation and Specifications..... | 14-1 |
| 14.1.1 Closed Loop Specification | 14-1 |
| 14.1.2 External Loop Specification | 14-1 |
| 14.1.3 Materials in Contact with Coolant | 14-1 |
| 14.2 Maintenance | 14-2 |
| 14.2.1 Drain the Coolant..... | 14-2 |
| 14.2.2 Clean / Replace the Heat Exchanger | 14-3 |
| 14.2.3 Troubleshooting | 14-3 |

Section 15 - Stands 15-1

| | |
|--|------|
| 15.1 Introduction | 15-1 |
| 15.2 Stand Options..... | 15-1 |
| 15.3 Compact Stand..... | 15-2 |
| 15.3.1 Main Components..... | 15-2 |
| 15.3.2 Horizontal Position Adjustment..... | 15-3 |
| 15.3.3 Assembly | 15-3 |
| 15.4 Heavy Duty Stand..... | 15-4 |
| 15.4.1 Main Components..... | 15-4 |
| 15.4.2 Horizontal Position Adjustment..... | 15-5 |

| | |
|--|-------------|
| 15.4.3 Front or Back Leg Position | 15-5 |
| 15.4.4 Counter Weight Kit (Optional) | 15-6 |
| 15.4.5 Assembly | 15-7 |
| 15.5 Leveling Castors | 15-8 |
| 15.6 Mold Installation | 15-8 |
| 15.7 Mold Removal | 15-11 |
| 15.8 Disassembly | 15-11 |
| Section 16 - Euromap 67 | 16-1 |
| 16.1 Scope and Application | 16-1 |
| 16.2 Description | 16-1 |
| 16.3 Plug and Socket Outlet | 16-1 |
| Section 17 - Water Quality | 17-1 |
| Appendix A | A-1 |
| Index | I |

Section 1 - Introduction

The purpose of this manual is to assist users in the integration, operation and maintenance of an E-Multi Auxiliary Injection Unit. This manual is designed to cover most system configurations. This manual should be used in conjunction with E-Multi Controller User Manual. If you need additional information specific to your system, or information in another language, please contact your representative or a Mold-Masters office.

1.1 Intended Use

Mold-Masters' E-Multi systems have been built to process thermoplastic material at the required temperature for injection molding and must not be used for any other purpose. The E-Multi injection unit is to be integrated with a host injection molding machine and not used as a standalone device. Any other uses would fall outside the engineered intent of this machine, which may be a safety hazard and will void any and all warranties.

1.2 Documentation

This manual is part of the documentation package for your order and should be referenced along with the following documents included in the package:

- The Bill of Materials (BOM). Together with the General Assembly drawing, the Bill of Materials should be referenced when ordering spare parts.
- General Assembly drawing
- Electrical drawings
- CE declaration of conformity and declaration of incorporation (EU only)

1.3 Release Details

| Table 1-1 Release Details | | |
|---------------------------|---------------|---------|
| Document Number | Release Date | Version |
| AIU-UM-EN-00-05-7 | December 2020 | 05-7 |
| AIU--UM--EN--00--05-8 | June 2021 | 05-8 |
| EM--UM--ENG--00--06 | November 2022 | 06 |
| EM--UM--M--ENG--06-1 | November 2023 | 06-1 |
| UM--EM--ENG--06-2 | August 2025 | 06-2 |

1.4 Warranty

For current warranty information please refer to the documents available from our website www.moldmasters.com/support/warranty or contact your Mold-Masters representative.

1.5 Returned Goods Policy

Please do not return any parts to Mold-Masters without pre-authorization and a return authorization number supplied by Mold-Masters.

Our policy is one of continuous improvement and we reserve the right to alter product specifications at any time without giving notice.

1.6 Movement or Resale of Mold-Masters Products or Systems

This documentation is intended for use in the country of destination for which the product or system was purchased.

Mold-Masters takes no responsibility for documentation of products or systems if they are relocated or resold outside the intended country of destination, as stated on the accompanying invoice and/or waybill.

1.7 Copyright

© 2025 Mold-Masters (2007) Limited. All Rights Reserved. Mold-Masters® and the Mold-Masters logo are trademarks of Mold-Masters.

1.8 Units of Measure and Conversion Factors



NOTE

The dimensions given in this manual are from original manufacturing drawings.

All values in this manual are in S.I. units or subdivisions of these units. Imperial units are given in parenthesis immediately after the S.I. units.

| Table 1-2 Units of Measure and Conversion Factors | | |
|---|------------------------|------------------|
| Abbreviation | Unit | Conversion Value |
| bar | Bar | 14.5 psi |
| in. | Inch | 25.4 mm |
| kg | Kilogram | 2.205 lb |
| kPa | Kilopascal | 0.145 psi |
| gal | Gallon | 3.785 l |
| lb | Pound | 0.4536 kg |
| lbf | Pound force | 4.448 N |
| lbf.in. | Pound force inch | 0.113 Nm |
| l | Litre | 0.264 gallon |
| min | Minute | |
| mm | Millimeter | 0.03937 in. |
| mΩ | Milli Ohm | |
| N | Newton | 0.2248 lbf |
| Nm | Newton Meter | 8.851 lbf.in. |
| psi | Pound per square inch | 0.069 bar |
| psi | Pound per square inch | 6.895 kPa |
| rpm | Revolutions per minute | |
| s | Second | |
| ° | Degree | |
| °C | Degree Celsius | 0.556 (°F -32) |
| °F | Degree Fahrenheit | 1.8 °C +32 |

Section 2 - Global Support

2.1 Corporate Offices

GLOBAL HEADQUARTERS

CANADA

Mold-Masters (2007) Limited
233 Armstrong Avenue
Georgetown, Ontario
Canada L7G 4X5
tel: +1 905 877 0185
fax: +1 905 877 6979
canada@moldmasters.com

SOUTH AMERICAN HEADQUARTERS

BRAZIL

Mold-Masters do Brasil Ltda.
R. James Clerk Maxwell,
280 – Techno Park, Campinas
São Paulo, Brazil, 13069-380
tel: +55 19 3518 4040
brazil@moldmasters.com

UNITED KINGDOM & IRELAND

Mold-Masters (UK) Ltd Netherwood
Road
Rotherwas Ind. Est.
Hereford, HR2 6JU
United Kingdom
tel: +44 1432 265768
fax: +44 1432 263782
uk@moldmasters.com

AUSTRIA / EAST & SOUTHEAST EUROPE

Mold-Masters HandelsGES.m.b.H.
Pyhrnstrasse 16
A-4553 Schlierbach
Austria
tel: +43 7582 51877
fax: +43 7582 51877 18
austria@moldmasters.com

ITALY

Mold-Masters Italia
Via Germania, 23
35010 Vigonza (PD)
Italy
tel: +39 049/5019955
fax: +39 049/5019951
italy@moldmasters.com

EUROPEAN HEADQUARTERS

GERMANY /

SWITZERLAND

Mold-Masters Europa GmbH
Neumattweg 1
76532 Baden-Baden, Germany
tel: +49 7221 50990
fax: +49 7221 53093
germany@moldmasters.com

INDIAN HEADQUARTERS

INDIA

Milacron India PVT Ltd. (Mold-
Masters Div.)
3B, Gandhiji Salai,
Nallampalayam, Rathinapuri
Post, Coimbatore T.N. 641027
tel: +91 422 423 4888
fax: +91 422 423 4800
india@moldmasters.com

USA

Mold-Masters Injectioneering
LLC, 29111 Stephenson
Highway, Madison Heights, MI
48071, USA
tel: +1 800 450 2270 (USA
only) tel: +1 (248) 544-5710
fax: +1 (248) 544-5712
usa@moldmasters.com

CZECH REPUBLIC

Mold-Masters Europa GmbH
Hamerska 698
75654 Zubri
Czech Republic
tel: +420 571 619 017
fax: +420 571 619 018
czech@moldmasters.com

KOREA

Mold-Masters Korea Ltd. E
dong, 2nd floor, 2625-6,
Jeongwang-dong, Siheung
City, Gyeonggi-do, 15117,
South Korea
tel: +82-31-431-4756
korea@moldmasters.com

ASIAN HEADQUARTERS

CHINA/HONG KONG/TAIWAN

Mold-Masters (KunShan) Co, Ltd
Zhao Tian Rd
Lu Jia Town, KunShan City
Jiang Su Province
People's Republic of China
tel: +86 512 86162882
fax: +86 512-86162883
china@moldmasters.com

JAPAN

Mold-Masters K.K.
1-4-17 Kurikidai, Asaoku Kawasaki,
Kanagawa
Japan, 215-0032
tel: +81 44 986 2101
fax: +81 44 986 3145
japan@moldmasters.com

FRANCE

Mold-Masters France
ZI la Marinière,
2 Rue Bernard Palissy
91070 Bondoufle, France
tel: +33 (0) 1 78 05 40 20
fax: +33 (0) 1 78 05 40 30
france@moldmasters.com

MEXICO

Milacron Mexico Plastics Services
S.A. de C.V.
Circuito El Marques norte #55
Parque Industrial El Marques
El Marques, Queretaro C.P. 76246
Mexico
tel: +52 442 713 5661 (sales)
tel: +52 442 713 5664 (service)
mexico@moldmasters.com

Corporate Offices—continued

SINGAPORE*

Mold-Masters Singapore PTE. Ltd.
No 48 Toh Guan Road East
#06-140 Enterprise Hub
Singapore 608586
Republic of Singapore
tel: +65 6261 7793
fax: +65 6261 8378
singapore@moldmasters.com
*Coverage includes Southeast
Asia, Australia, and New Zealand

SPAIN

Mold-Masters Europa GmbH
C/ Tecnología, 17
Edificio Canadá PL. 0 Office A2
08840 – Viladecans
Barcelona
tel: +34 93 575 41 29
e: spain@moldmasters.com

TURKEY

Mold-Masters Europa GmbH
Merkezi Almanya Türkiye
İstanbul Şubesi
Alanaldı Caddesi Bahçelerarası
Sokak No: 31/1
34736 İçerenköy-Ataşehir
İstanbul, Turkey
tel: +90 216 577 32 44
fax: +90 216 577 32 45
turkey@moldmasters.com

2.2 International Representatives

Argentina

Sollwert S.R.L.
La Pampa 2849 2º B C1428EAY
Buenos Aires Argentina
tel: +54 11 4786 5978
fax: +54 11 4786 5978 Ext. 35
sollwert@fibertel.com.ar

Belarus

HP Promcomplect Sharangovicha
13
220018 Minsk
tel: +375 29 683-48-99
fax: +375 17 397-05-65
e: info@mold.by

Bulgaria

Mold-Trade OOD
62, Aleksandrovska
St. Ruse City
Bulgaria
tel: +359 82 821 054
fax: +359 82 821 054
contact@mold-trade.com

Denmark*

Englmayer A/S
Dam Holme 14-16
DK – 3660 Stenløse Denmark
tel: +45 46 733847
fax: +45 46 733859
support@englmayer.dk
*Coverage includes Norway and
Sweden

Finland**

Scalar Ltd.
Tehtaankatu 13
11710 Riihimäki
Finland
tel: +358 40 628 0359
info@scalar.fi
**Coverage includes Estonia

Israel

ASAF Industries Ltd. 29 Habanai Street PO Box
5598 Holon 58154 Israel
tel: +972 3 5581290
fax: +972 3 5581293
sales@asaf.com

Portugal

Gecim LDA
Rua Fonte Dos Ingleses, No 2
Engenho 2430-130 Marinha
Grande Portugal
tel: +351 244 575600
fax: +351 244 575601
gecim@gecim.pt

Slovenia

RDP ICTA tehnologije d.o.o.
Žolgarjeva ulica 2
2310 Slovenska Bistrica Slovenija
+386 59 969 117
info@picta.si

Romania

Tehnic Mold Trade SRL
Str. W. A Mozart nr. 17 Sect. 2 020251
Bucharesti, Romania
tel: +4 021 230 60 51
fax : +4 021 231 05 86
contact@matritehightech.ro

South Africa

Plastic & Chemical Trading
(P&CT) 23 Orange Road
Johannesburg 2192
tel: +27 (0)11 483 3015
sales@plastrading.com

Ukraine

Company Park LLC Gaydamatska
str., 3, office 116 Kemenskoe City
Dnipropetrovsk Region 51935,
Ukraine
tel: +38 (038) 277-82-82
moldmasters@parkgroup.com.ua

Section 3 - Safety

3.1 Introduction

Please be aware that the safety information provided by Mold-Masters does not absolve the integrator and employer from understanding and following international and local standards for safety of machinery. It is the responsibility of the end integrator to integrate the final system, provide necessary e-stop connections, safety interlocks and guarding, to select the appropriate electrical cable for the region of use and to ensure compliance with all relevant standards.

It is the responsibility of the employer to:

- Properly train and instruct its personnel in the safe operation of equipment, including the use of all the safety devices.
- Provide its personnel with all necessary protective clothing, including such items as a face shield and heat resistant gloves.
- Ensure the original and continuing competence of personnel caring for, setting up, inspecting and maintaining injection molding equipment.
- Establish and follow a program of periodic and regular inspections of injection molding equipment to ensure it is in safe operating condition and proper adjustment.
- Ensure that no modifications, repairs, or rebuild of portions are made to the equipment that reduces the level of safety existing at time of manufacture or remanufacture.

3.2 Safety Hazards

The following safety hazards are most commonly associated with plastic injection molding equipment (see European Standard EN201 or American Standard ANSI/SPI B151.1).



WARNING

Also refer to all machine manuals and local regulations and codes for safety information.

Refer to the illustration of hazard areas below when reading the Safety Hazards Table 3-1 on page 3-3.

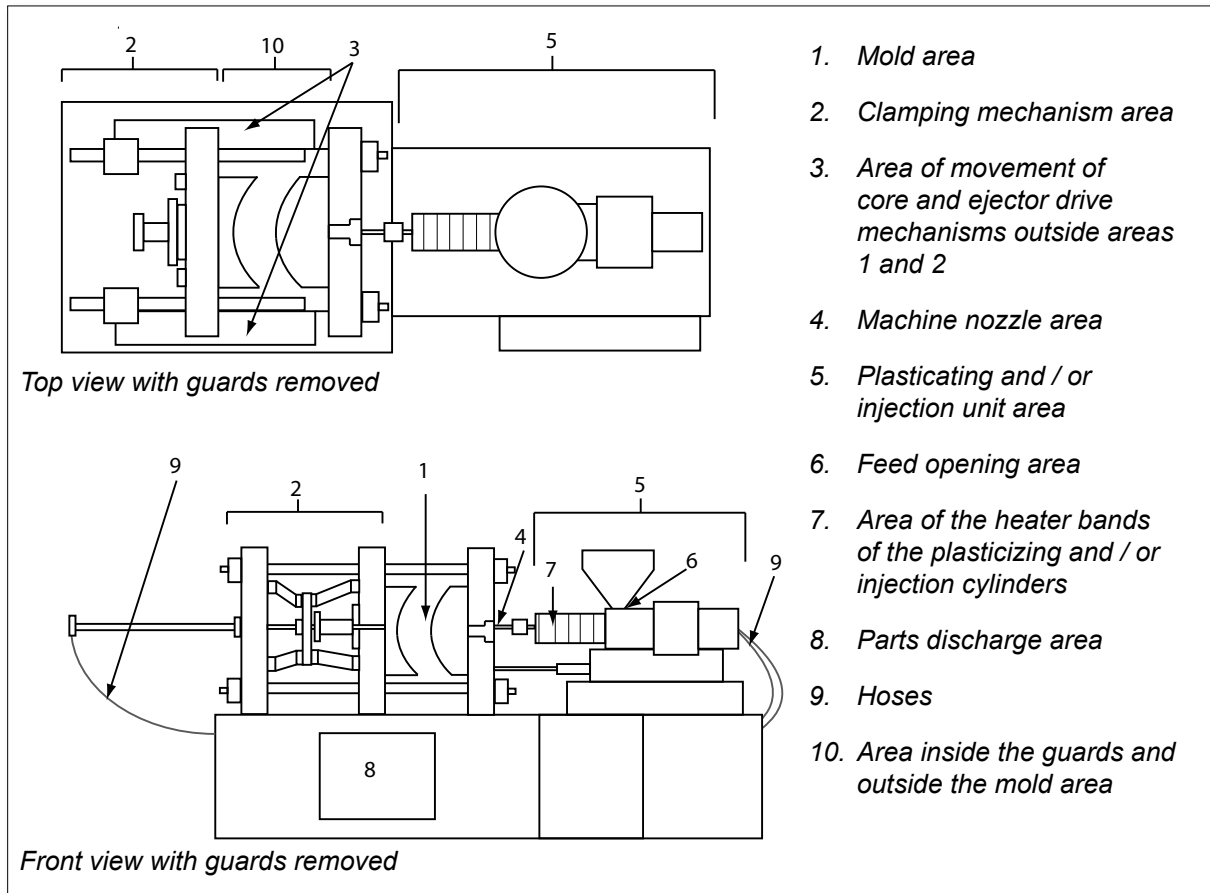


Figure 3-1 Injection molding machine hazard areas.

| Table 3-1 Safety Hazards | |
|---|---|
| Hazard Area | Potential Hazards |
| Mold Area Area between the platens. See Figure 3-1 area 1 | Mechanical Hazards Crushing and / or shearing and / or impact hazards caused by: Movement of the platen. Movements of the injection barrel(s) into the mold area. Movements of cores and ejectors and their drive mechanisms. Tie bar motion. Thermal Hazards Burns and / or scalds due to operating temperature of: The mold heating elements. Plasticized material released from / through the mold. |
| Clamping Mechanism Area See Figure 3-1 area 2 | Mechanical Hazards Crushing and / or shearing and / or impact hazards caused by: Movement of the platen. Movement of the drive mechanism of the platen. Movement of the core and ejector drive mechanism. |
| Movement of Drive Mechanisms Outside the Mold Area and Outside the Clamping Mechanism Area. See Figure 3-1 area 3 | Mechanical Hazards Mechanical hazards of crushing, shearing and / or impact caused by the movements of: Core and ejector drive mechanisms. |
| Nozzle Area The nozzle area is the area between the barrel and the sprue bushing. See Figure 3-1 area 4 | Mechanical Hazards Crushing, shearing hazards, and / or impact hazards caused by: Forward movement of the plasticizing and / or injection unit including nozzle. Movements of parts of the power operated nozzle shutoff and their drives. Over pressurization in the nozzle. Thermal Hazards Burns and / or scalds due to operating temperature of: The nozzle. Plasticized material discharging from the nozzle. |
| Plasticizing and / or Injection Unit Area Area from the adapter / barrel head / end cap to the extruder motor above the sled including the carriage cylinders. See Figure 3-1 area 5 | Mechanical Hazards Crushing, shearing and / or drawn-into hazards caused by: Unintentional gravity movements e.g. for machines with plasticizing and / or injection unit positioned above the mold area. The movements of the screw and / or the injection plunger in the cylinder accessible through the feed opening. Movement of the carriage unit. Thermal Hazards Burns and or scalds due to operating temperature of: The plasticizing and / or injection unit. The heating elements e.g. heater bands. The plasticized material and / or vapors discharging from the vent opening, feed throat or hopper. Mechanical and / or Thermal Hazard Hazards due to reduction in mechanical strength of the plasticizing and / or injection cylinder due to overheating. |
| Feed Opening See Figure 3-1 area 6 | Pinching and crushing between injection screw movement and housing. |

| Table 3-1 Safety Hazards | |
|---|---|
| Hazard Area | Potential Hazards |
| Area of the Heater Bands of the Plasticizing and / or Injection Cylinders See Figure 3-1 area 7 | Burns and / or scalds due to operating temperature of: The plasticizing and/or injection unit. The heating elements e.g. heater bands. The plasticized material and / or vapors discharging from the vent opening, feed throat or hopper. |
| Parts Discharge Area See Figure 3-1 area 8 | Mechanical Hazards Accessible Through the Discharge Area Crushing, shearing and / or impact hazards caused by: Closing movement of the platen Movements of cores and ejectors and their drive mechanisms. Thermal Hazards Accessible Through the Discharge Area Burns and or scalds due to operating temperature of: The mold. Heating elements of the mold. Plasticized material released from / through the mold. |
| Hoses See Figure 3-1 area 9 | Whipping action caused by hose assembly failure. Possible release of fluid under pressure that can cause injury. Thermal hazards associated with hot fluid. |
| Area Inside the Guards and Outside the Mold Area See Figure 3-1 area 10 | Crushing and / or shearing and / or impact hazards caused by: Movement of the platen. Movement of the drive mechanism of the platen. Movement of the core and ejector drive mechanism. Clamp opening movement. |
| Electrical Hazards | Electrical or electromagnetic disturbance generated by the motor control unit. Electrical or electromagnetic disturbance that can cause failures in the machine control systems and adjacent machine controls. Electrical or electromagnetic disturbance generated by the motor control unit. |
| Hydraulic Accumulators | High pressure discharge. |
| Power Operated Gate | Crush or impact hazards caused by the movement of the power operated gates. |
| Vapors and Gases | Certain processing conditions and / or resins can cause hazardous fumes or vapors. |



3.3 Operational Hazards













WARNINGS



- Refer to all machine manuals and local regulations and codes for safety information.
- The equipment supplied is subjected to high injection pressures and high temperatures. Ensure that extreme caution is observed in the operation and maintenance of the injection molding machines.
- Only fully trained personnel should operate or maintain equipment.
- Do not operate the equipment with unconfined long hair, loose clothing or jewelry, including name badges, neckties, etc. These may get caught in the equipment and can cause death or serious injury.
- Never disable or bypass a safety device.
- Ensure that the protective guards are placed around the nozzle to prevent the material from splashing or drooling.
- A burn hazard exists from material during routine purging. Wear heat-resistant personal protective equipment (PPE) to prevent burns from contact with hot surfaces or splatter of hot material and gases.
- Material purged from machine may be extremely hot. Ensure protective guards are in place around the nozzle to prevent material from splashing. Use proper personal protective equipment.
- All operators should wear personal protective equipment, such as face shields and use heat resistant gloves when working around the feed inlet, purging the machine or cleaning the gates of the mold.
- Remove purged material from the machine immediately.
- Decomposing or burning material could result in noxious gases being emitted from the purged material, feed inlet or mold.
- Ensure proper ventilation and exhaust systems are in place to help prevent inhalation of harmful gases and vapors.
- Consult manufacturer's Material Safety Data Sheets (MSDS).
- Hoses fitted to the mold will contain high or low temperature fluids or air under high pressure. The operator must shut down and lockout these systems as well as relieving any pressure before performing any work with these hoses. Regularly inspect and replace all flexible hoses and restraints.
- Water and / or hydraulics on the mold may be in close proximity to electrical connections and equipment. Water leakage may cause an electrical short circuit. Hydraulic fluid leakage may cause a fire hazard. Always keep water and / or hydraulic hoses and fittings in good condition to avoid leaks.
- Never perform any work on the mold machine unless the hydraulic pump has been stopped.
- Check frequently for possible oil leaks / water leaks. Stop the machine and make repairs.

**WARNING**

- Make sure that the cables are connected to the correct motors. Cables and motors are clearly labeled. Reversing the cables can result in unexpected and uncontrolled motion causing a safety risk or damage to the machine.
- A crushing hazard exists between the nozzle and mold melt inlet during carriage forward motion.
- A possible shearing hazard exists between the edge of the injection guard and the injection housing during injection.
- The open feed port could present a hazard to a finger or a hand inserted during operation of the machine.
- The electric servo motors could overheat presenting a hot surface which could cause burns to someone touching it.
- The barrel, barrel head, nozzle, heater bands and mold components are hot surfaces which could result in burns.
- Keep flammable liquids or dust away from the hot surfaces as they could ignite.
- Follow good housekeeping procedures and keep floors clean to prevent slips, trips and falls due to spilled material on the work floor.
- Apply engineering controls or hearing conservation programs as necessary to control noise.
- When doing any work on the machine that requires moving and lifting the machine, ensure that lifting equipment (eyebolts, fork lift truck, cranes, etc.) will have sufficient capacity to handle mold, auxiliary injection unit or Hot Runner weight.
- Connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death.
- Mold cable from the controller to the mold must be removed before servicing the mold.

3.4 General Safety Symbols

| Table 3-2 Typical Safety Symbols | |
|---|---|
| Symbol | General Description |
|  | General – Warning Indicates an immediate or potentially hazardous situation, which if not avoided, could result in a serious injury or death, and / or damage to equipment. |
|  | Warning – Barrel Cover Grounding Strap Lockout/Tagout procedures must be followed before removing the barrel cover. Barrel cover can become energized upon removal of grounding straps and contact can result in death or serious injury. Grounding straps must be reconnected before reconnecting power to machine. |
|  | Warning – Crushing and / or Impact Points Contact with moving parts can cause serious crushing injury. Always keep guards in place. |
|  | Warning – Crush Hazard Closing Mold |
|  | Warning – Hazardous Voltage Contact with hazardous voltages will cause death or serious injury. Turn off power and review electrical schematics before servicing equipment. May contain more than one live circuit. Test all circuits before handling to make sure circuits have been de-energized. |
|  | Warning – High Pressure Overheated fluids may cause severe burns. Discharge pressure before disconnecting water lines. |
|  | Warning – High Pressure Accumulator Sudden release of high pressure gas or oil can cause death or serious injury. Discharge all gas and hydraulic pressure before disconnecting or disassembling accumulator. |
|  | Warning – Hot Surfaces Contact with exposed hot surfaces will cause serious burn injury. Wear protective gloves when working near these areas. |
|  | Mandatory – Lockout / Tagout Ensure that all energies are properly locked out, and remain locked out until the service work is completed. Servicing equipment without disabling all internal and external power sources can cause death or serious injury. De-energize all internal and external power sources (electrical, hydraulic, pneumatic, kinetic, potential, and thermal). |
|  | Warning – Material Splashing Hazard Molten material or high pressure gas can cause death or severe burns. Wear personal protective equipment while servicing the feed throat, nozzle, mold areas, and when purging the injection unit. |
|  | Warning – Read Manual Before Operation Personnel should read and understand all instructions in the manuals before working on equipment. Only properly trained personnel should operate the equipment. |
|  | Warning – Slip, Trip or Fall Hazard Do not climb on equipment surfaces. Serious slip, trip or fall injuries can result from personnel climbing on equipment surfaces. |

| Table 3-2 Typical Safety Symbols | |
|---|---|
| Symbol | General Description |
|  | Caution Failure to follow instructions may damage equipment. |
|  | Important Indicates additional information or used as a reminder. |

3.5 Wiring Check



CAUTION

System Mains Supply Wiring:

- Before connecting the system to a power supply, it is important to check that the wiring between the system and the power supply has been done correctly.
- Particular attention must be given to the current rating of the power supply. For example, if a controller is rated at 63A, then the power supply must also be rated at 63A.
- Check that the phases of power supply are wired correctly.

Controller to Mold Wiring:

- For separate power and thermocouple connections, ensure that the power cables are never connected to the thermocouple connectors and vice-versa.
- For mixed power and thermocouple connections, ensure that the power and thermocouple connections have not been wired incorrectly.

Communications Interface and Control Sequence:

- It is the customer's responsibility to verify functionality of any custom machine interface at safe speeds, prior to operating equipment in the production environment at full speed in automatic mode.
- It is the customer's responsibility to verify all required motion sequences are correct, prior to operating equipment in the production environment at full speed in automatic mode.
- Switching the machinery into Auto mode without having verified the control interlocks and motion sequence are correct, may cause damage to machinery and / or equipment.

Failure to do wiring or connections properly will result in equipment failure.



3.6 Lockout Safety

WARNING

DO NOT enter the cabinet without first ISOLATING the supplies.

Voltage and amperage cables are connected to the controller and the mold. Electric power must be shut off and lockout / tagout procedures followed prior to installing or removing any cables.

Use lockout / tagout to prevent operation during maintenance.

All maintenance should be performed by properly trained personnel based on local laws and regulation. Electrical products may not be grounded when removed from the assembled or normal operating condition.

Ensure proper grounding of all electrical components before performing any maintenance to avoid potential risk of electrical shock.

Often power sources are inadvertently turned on or valves are opened mistakenly before maintenance work is completed, resulting in serious injuries and fatalities. Therefore, it is important to ensure that all energies are properly locked out and that they remain locked out until the work is completed.

If a lockout is not performed, uncontrolled energies could cause:

- Electrocution from contact with live circuits
- Cuts, bruises, crushing, amputations or death, resulting from entanglement with belts, chains, conveyors, rollers, shafts, impellers
- Burns from contact with hot parts, materials or equipment such as furnaces
- Fires and explosions
- Chemical exposures from gases or liquids released from pipelines

3.6.1 Electrical Lockout

Employers must provide an effective lockout / tagout program.



WARNING - READ MANUAL

Refer to all machine manuals and local regulations and codes.



NOTE

In some instances, there may be more than one power source feeding equipment and steps must be taken to ensure that all sources are effectively locked out.

1. Shut down machine using normal operational shutdown procedure and controls. This should be done by, or in consultation with the machine operator.
2. After ensuring that the machinery has been completely shut down, and all controls in the "off" position, open the main disconnect switch located in the field.
3. Using your own personal padlock, or one assigned by your supervisor, lock the disconnect switch in the off position. Do not lock only the box. Remove the key and retain. Complete a lockout tag and affix to the disconnect switch. Each person working on the equipment must follow this step. The lock of the person doing the work or in charge must be installed first, remain throughout and be removed last. Test the main disconnect switch and make sure it cannot be moved to the "on" position.
4. Try to start the machine using the normal operation controls and point of operation switches to make sure that the power has been disconnected.
5. Other sources of energy that could create a hazard while working on the equipment must also be de-energized and appropriately "locked-out". This can include gravity, compressed air, hydraulics, steam and other pressurized or hazardous liquids and gases (see table below).
6. When the work is completed, prior to removing the last lock, make sure the operational controls are in the "off" position so that the main disconnect switching is done under "no load". Ensure all blocks, tools and other foreign materials are removed from machine. Also ensure that all personnel that may be affected are informed that the lock(s) will be removed.
7. Remove lock and tag, and close the main disconnect switch if permission has been given.
8. When the work has not been completed on the first shift, the next operator should install a personal lock and tag before the first operator removes the original lock and tag. If the next operator is delayed, a lock and tag could be installed by the next supervisor. Lockout procedures should indicate how the transfer is to be conducted.
9. It is important that, for their personal protection, each worker and/or fore person working in or on a machine places his/her own safety lock on the disconnect switch. Use tags to spotlight work in progress and give details of work being done. Only when the work is completed and the work permit signed off, may each worker remove his/her lock. The last lock to be removed should be that of the person supervising the lockout and this responsibility should not be delegated.

© Industrial Accident Prevention Association, 2008.

3.6.2 Energy Forms and Lockout Guidelines

| Table 3-3 Energy Forms, Energy Sources and General Lockout Guidelines | | |
|---|---|--|
| Energy Form | Energy Source | Lockout Guidelines |
| Electrical Energy | <ul style="list-style-type: none"> Power transmission lines Machine power cords Motors Solenoids Capacitors (stored electrical energy) | <ul style="list-style-type: none"> Turn off power at machine first (i.e., at point of operation switch), and then at the main disconnect switch for the machine. Lock and tag the main disconnect switch. Fully discharge all capacitive systems (e.g., cycle machine to drain power from capacitors) according to the manufacturer's instructions. |
| Hydraulic Energy | <ul style="list-style-type: none"> Hydraulic systems (e.g., hydraulic presses, rams, cylinders, hammers) | <ul style="list-style-type: none"> Shut off, lock (with chains, built-in lockout devices, or lockout attachments) and tag valves. Bleed off and blank lines as necessary. |
| Pneumatic Energy | <ul style="list-style-type: none"> Pneumatic systems (e.g., lines, pressure reservoirs, accumulators, air surge tanks, rams, cylinders) | <ul style="list-style-type: none"> Shut off, lock (with chains, built-in lockout devices, or lockout attachments) and tag valves. Bleed off excess air. If pressure cannot be relieved, block any possible movement of machinery. |
| Kinetic Energy (Energy of a moving object or materials. Moving object may be powered or coasting) | <ul style="list-style-type: none"> Blades Flywheels Materials in supply lines | <ul style="list-style-type: none"> Stop and block machine parts (e.g. stop flywheels and ensure that they do not recycle). Review entire cycle of mechanical motion, ensure that all motions are stopped. Block material from moving into area of work. Blank as necessary. |
| Potential Energy (Stored energy that an object has the potential to release due to its position) | <ul style="list-style-type: none"> Springs (e.g., in air brake cylinders) Actuators Counterweights Raised loads Top or movable part of a press or lifting device | <ul style="list-style-type: none"> If possible, lower all suspended parts and loads to the lowest (rest) position. Block parts that might be moved by gravity. Release or block spring energy. |
| Thermal Energy | <ul style="list-style-type: none"> Supply lines Storage tanks and vessels | <ul style="list-style-type: none"> Shut off, lock (with chains, built-in lockout devices, or lockout attachments) and tag valves. Bleed off excess liquids or gases. Blank lines as necessary. |

3.7 Disposal



WARNING

Milacron Mold-Masters declines any responsibility for personal injury or personal damage arising from reuse of the individual components, if these parts are used other than for the original and proper intended purpose.

Recycling of the materials occupies a forefront position during the disposal process.

1. Hot runner and system components must be disconnected from the power supply fully and properly before disposal, including electricity, hydraulics, pneumatics and cooling.
2. Ensure that the system to be disposed of is free from fluids. In the case of hydraulic needle valve systems, drain the oil from the lines and cylinders and dispose it in an environmentally responsible manner.
3. The electrical components are to be dismantled, separating them accordingly as environmentally friendly waste or disposed as hazardous waste if necessary.
4. Remove the wiring. The electronic components are to be disposed in accordance with the national electric scrap ordinance.
5. The metal parts are to be returned for metal recycling (waste metal and scrap trade). The instructions of the corresponding waste disposal company are to be observed in this case.

Recycling of the materials occupies a forefront position during the disposal process.

3.8 E-Multi Injection Unit Safety Hazards

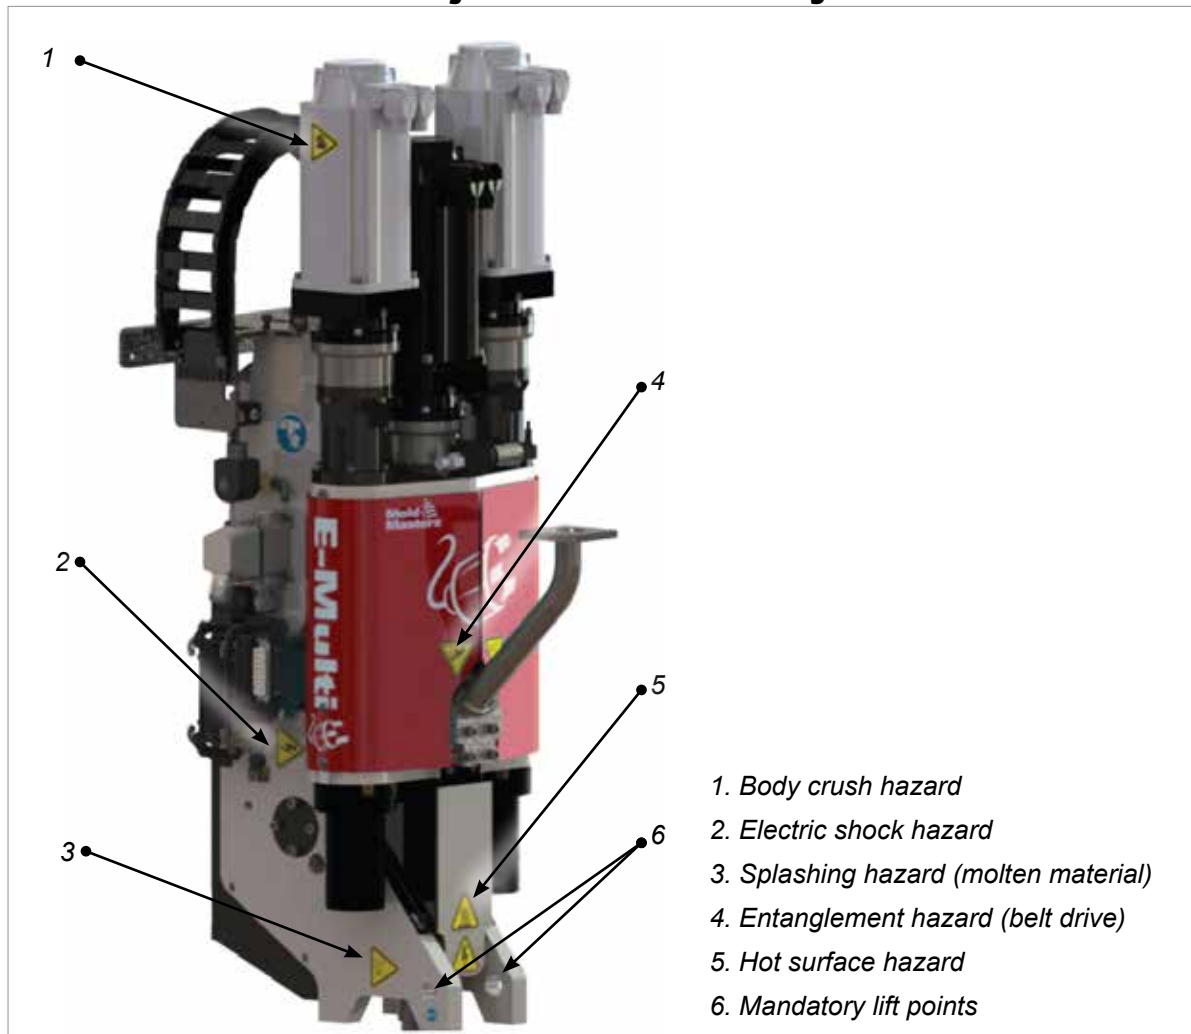


Figure 3-2 E-Multi safety hazards

E-Multi Injection Unit Safety Hazards - continued

| Table 3-4 E-Multi Injection Unit Safety Hazard Details | |
|--|--|
| Hazard Type | Potential Hazards |
| Mechanical Hazards | |
| Body Crushing Hazard | End of motor moves back during hold or recovery. A hazard may exist between the end of the injection unit motor assembly and a nearby solid obstacle. Ensure proper guarding as part of integration. |
| | During installation of the E-Multi injection unit onto a mold, a crushing hazard exists between the adapter plate and the mounting surface of the mold. |
| | A crushing hazard exists between nozzle and mold melt inlet during carriage forward motion. |
| Shearing Hazard | A possible shearing hazard exists between the edge of the injection guard and the injection housing during injection. |
| Cutting Hazard | For horizontally-mounted machines with a high center line height, a person's head could hit the end of the injection unit causing a cut. Ensure proper guarding. |
| Entanglement Hazard (Belt Drive) | A person could become entangled in the drive belt or screw of the injection unit. Always keep guards in place. |
| Entanglement Hazard | The open feed port could present an entanglement hazard. Always keep guards in place. |
| Molten Material Splashing Hazard | High pressure molten plastic may spray from the nozzle. Always use personal protective equipment (PPE). |
| | High temperature molten plastic may spray from a blocked feed port. Always use personal protective equipment (PPE). |
| Loss of Stability | Injection unit could fall over if improperly installed on stand. |
| | Injection unit could fall over if transported on stand castors. |
| | Injection unit could fall from top of mold if not properly secured. |
| | Injection unit could fall over if stored vertically on the floor or a table without adequate support. |
| Trip Hazard | Controller cables are a tripping hazard on the floor between the controller and the press or E-Multi injection unit. |
| Stored Energy | There could be stored energy in compressed plastic which is not released when the machine is powered off. |
| | When installed vertically and powered off, there is stored energy in the injection assembly which could move downwards. |
| Electrical Hazard | |
| Contact of Persons with High Voltage | Heaters, servo motors and electrical components in the controller could come in contact with a person. Do not remove covers when energized. |
| Thermal Hazards | |

E-Multi Injection Unit Safety Hazards - continued

| Table 3-4 E-Multi Injection Unit Safety Hazard Details | |
|--|--|
| Hazard Type | Potential Hazards |
| Possible Contact of Persons with High Temperature Material. | The injection barrel could result in burns. |
| | Melted plastic during routine purging could cause burns. |
| | Hot plastic or gasses could be released from the feed port when clearing a blockage. |
| | The electric servo motors could overheat presenting a hot surface which could cause burns to someone touching it. |
| Hazards Generated by Materials or Substances | |
| Hazards from Contact With or Inhalation of Harmful Gases | Hot plastic could result in harmful gases being emitted from the purged material or feed inlet. |
| Fire or Explosion Hazard | Hot surfaces of the barrel heaters could ignite flammable liquids or dust. |
| Ergonomic Hazards | |
| Lift Hazard | Attempting to lift or support the unit during installation could result in injury. |
| Combination Hazards | |
| Failure / Disorder of Control System | Incorrect connections can result in out-of-control or unexpected movement causing damage to the machine and a possible hazard. |
| Errors of Fitting | Incorrect design of the adapter plate or attachment or torquing of fasteners may result in a failure of the connection and subsequent loss of stability or falling of the machine. |

3.9 E-Multi Servo Carriage Safety Hazard

| Table 3-5 E-Multi Servo Carriage Safety Hazard Details | |
|--|--|
| Hazard Type | Potential Hazards |
| Cutting or Severing Hazard | A severing hazard may exist between the barrel guard and support beam when the carriage moves forward and the hard stop extension in the trunnion slot is not installed. |

3.10 E-Multi Radial Unit Hazards

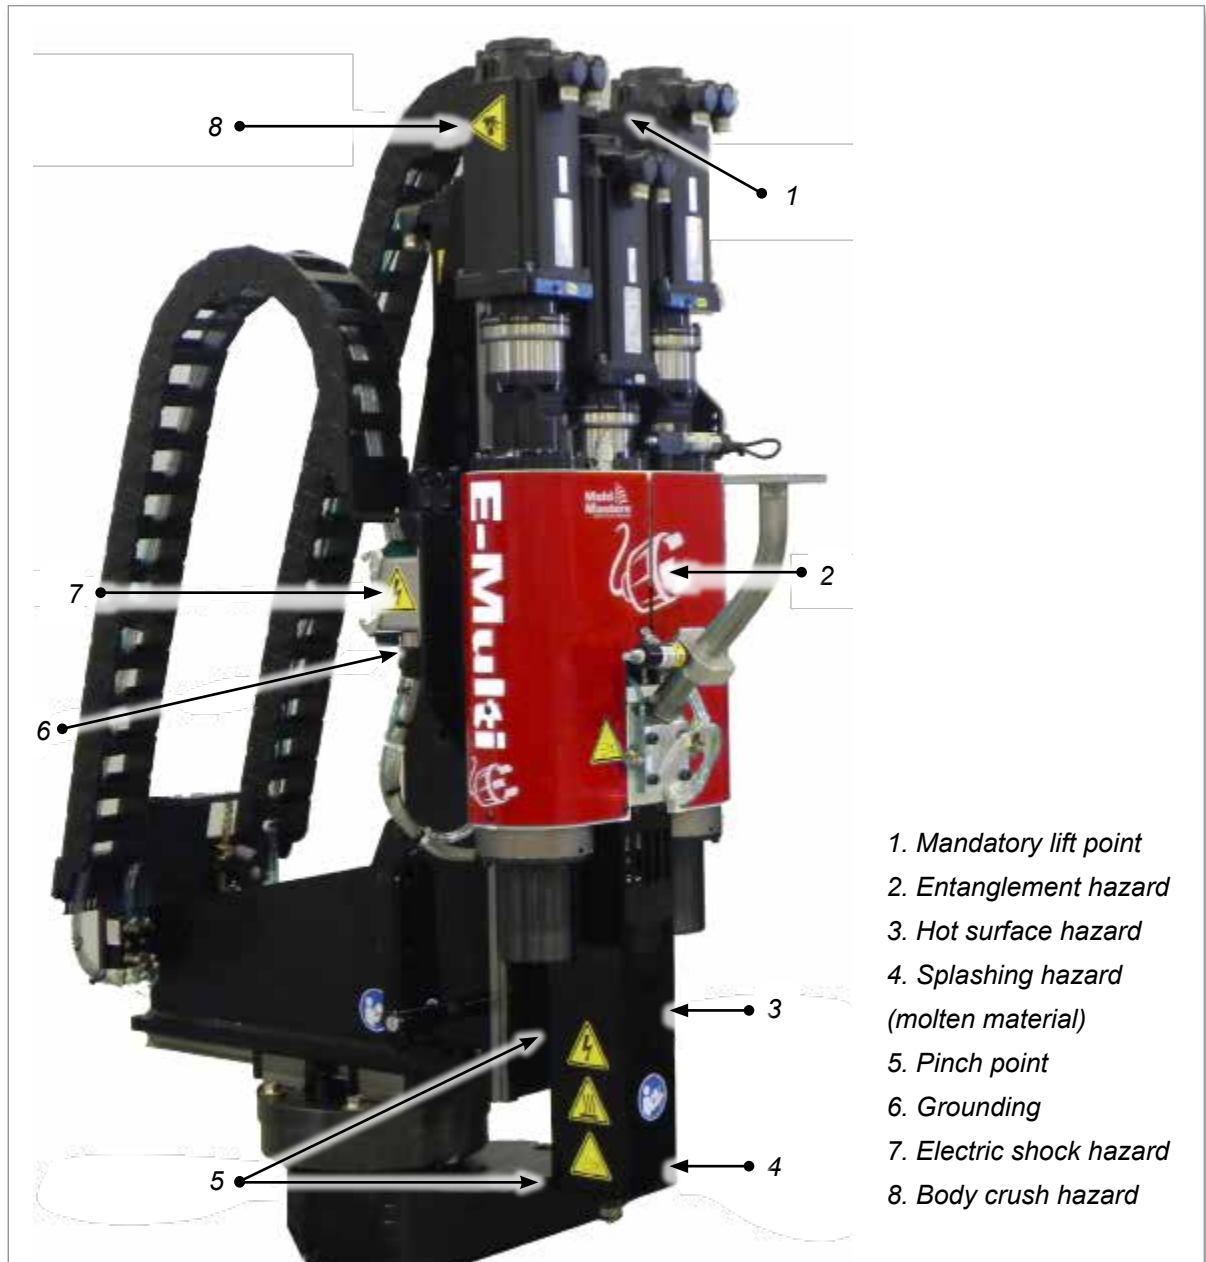












Figure 3-3 E-Multi Radial safety hazard locations

| Table 3-6 E-Multi Radial Safety Hazards Details | |
|---|--|
| Hazard Type | Potential Hazards |
| Body Crushing Hazard | End of motor moves back during hold or recovery or during carriage return. A hazard may exist between the end of the injection unit motor assembly and a nearby solid obstacle. Ensure proper guarding as part of integration. |
| | During installation of the E-Multi Radial onto a molding machine, a crushing hazard exists between the E-Multi and the injection molding machine surface and guarding, as well as the mold. |
| | During installation, when the vertical beam is being raised, a crushing hazard exists between the vertical beam and the horizontal beam. |
| | A crushing hazard exists between barrel / barrel cover / nozzle and the adapter plate, as well as the mold and injection molding machine during carriage motion. |
| | A crushing hazard exists between the end of the E-Multi Radial and the injection molding machine, machine guards and the auxiliary equipment (e.g. hopper, loader, drier, etc.) |
| Pinch Hazard | A pinch hazard exists between the E-Multi Radial carriage assembly and the slot in the vertical beam, during carriage movement. Keep fingers and hands away from this area. |
| Shearing Hazard | A shearing hazard exists between the barrel / barrel cover / nozzle and the adapter plate, as well as the injection molding machine during Radial set-up and positioning, and during carriage motion. |
| | A shearing hazard exists between barrel / barrel cover / nozzle, and the adapter plate, as well as the mold and the injection molding machine during carriage motion. |
| Cutting Hazard | A cutting hazard may exist between the barrel / barrel cover / nozzle and a person's head when the unit is rotated to the side. For example, this can occur when unit is installed on small injection molding machines with narrow width and low height. |
| Stored Energy Hazard | There is stored energy in the carriage assembly due to the mass of the unit. If any of the carriage assembly components are removed including; the servo motor, any of the servo motor components, the gear box, or any of the mounting screws associated with this assembly, the E-Multi unit could move down (forward) unexpectedly, and may create a crushing and / or shearing hazard. |

3.11 Safety Symbols on the E-Multi Injection Unit

| Table 3-7 Safety Symbols Used on the E-Multi | |
|---|---|
| Symbol | General Description |
|  | General – Warning Indicates an immediate or potentially hazardous situation, which if not avoided, could result in a serious injury or death, and/or damage to equipment |
|  | Warning – Body Crush Hazard End of motor moves back during hold or recovery. Hazard may exist between the end of the injection unit motor assembly and a nearby solid obstacle. |
|  | Warning – Tip Over Hazard Injection unit could tip over when installed on stand or if stored vertically on the floor or a table without adequate support. |
|  | Warning – Electric Shock Hazard Contact with hazardous voltages will cause death or serious injury. Turn off power and review electrical schematics before servicing equipment. May contain more than one live circuit. Test all circuits before handling to make sure circuits have been de-energized. |
|  | Warning – Hot Surface Hazard Contact with exposed hot surfaces will cause serious burn injury. Wear adequate personal protective equipment (PPE) when working near these areas. |
|  | Warning – Entanglement Hazard (Belt Drive) A person could become entangled in the drive belt of the injection unit. Always keep guards in place. |
|  | Warning – Pinch Point Hazard A pinch point exists in this area which could result in a pinching, crushing or shearing injury to a person. |
|  | Warning – Splashing Hazard Molten material or high pressure gas can cause death or severe burns. Wear personal protective equipment (PPE) while servicing the feed throat, nozzle, mold areas, and when purging the injection unit. |
|  | Mandatory – Read Service Manual Before Operation Personnel should read and understand all instructions in the manuals before working on equipment. Only properly trained personnel should operate the equipment. |
|  | Mandatory Lift Points Mandatory lift points must be used. If wrong lift points are used the unit could become unstable when being moved. |

3.12 Safety Guards

**WARNING**

Guards should not be removed unless maintenance is required, and should be replaced after maintenance is complete. Do not run the machine with guards removed.

**CAUTION**

When installing the machine guards (front and rear covers) and the barrel covers, check that they do not pinch water lines, air lines or thermocouple wires when the unit moves.

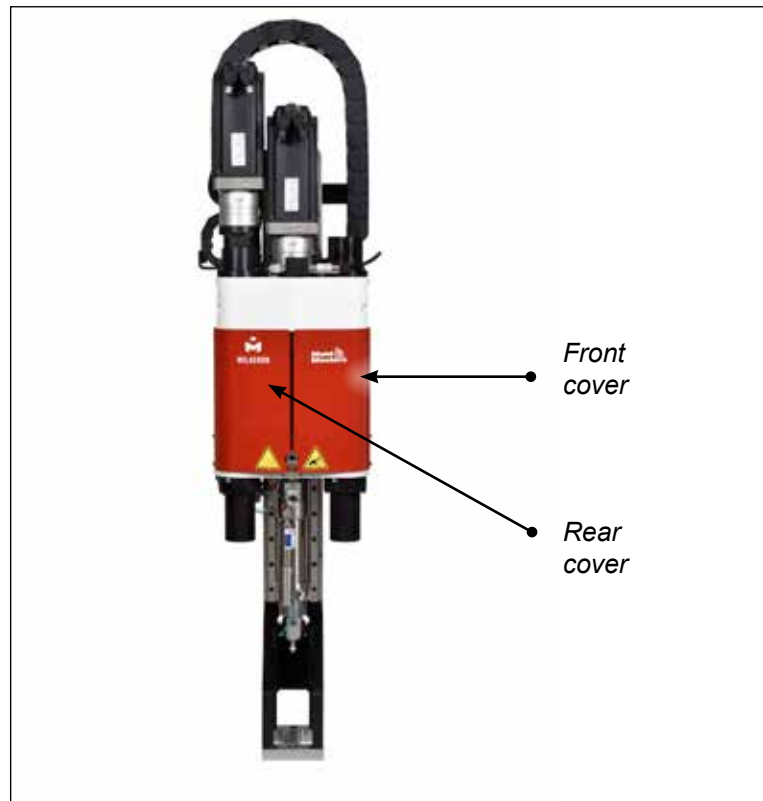




Figure 3-4 Guards layout

3.13 E-Multi Weight Specifications

Dimensions and weights shown are for packed wooden crates containing standard-optional units. Additional options may add weight or require additional crates. Specifications subject to changes without notice.

| Table 3-8 Safety Symbols on the E-Multi Transport Stand | |
|---|--|
| Safety Symbol | General Description |
|  | Warning - Use Castor Locks Failure to use castor locks may cause the stand to become unbalanced and / or move suddenly. |
|  | Caution - Maximum Load Capacity Weights exceeding the maximum load capacity of the stand may cause damage to the stand and / or the E-Multi. |

| Table 3-9 E-Multi Injection Unit Shipping Dimensions and Weight | | | | | |
|---|---------|--------------------|-------------------|--------------------|-------------------|
| Model | | Length mm (in.) | Width mm (in.) | Height mm (in.) | Weight kg (lb) |
| EM1/EM2 | | 1520 (60) | 740 (29) | 840 (33) | 300 (660) |
| EM3 | | 2080 (82) | 840 (33) | 910 (36) | 500 (1100) |
| EM4 | | 3302 (130) | 914 (36) | 991 (39) | 1300 (2860) |
| ER1-15 | | 1632 (64) | 932 (37) | 1056 (42) | 400 (880) |
| ER1-30 | | | | | 400 (880) |
| ER2-50 | | | | | 400 (880) |
| ER2-80 | | | | | 500 (1100) |
| ER3-100 | Crate 1 | 3302 (130) | 914 (36) | 991 (39) | 900 (1980) |
| | Crate 2 | 1543 (61) | 975 (38) | 670 (26) | 700 (1540) |
| ER3-200 | Crate 1 | 3302 (130) | 914 (36) | 991 (39) | 900 (1980) |
| | Crate 2 | 1543 (61) | 975 (38) | 670 (26) | 700 (1540) |
| ER4-350 | Crate 1 | 3302 (130) | 914 (36) | 991 (39) | 1200 (2640) |
| | Crate 2 | 1543 (61) | 975 (38) | 670 (26) | 700 (1540) |
| ER4-550 | Crate 1 | 3302 (130) | 914 (36) | 991 (39) | 1300 (2860) |
| | Crate 2 | 1543 (61) | 975 (38) | 670 (26) | 700 (1540) |
| EM1/EM2/EM3 Controllers | | 1702 (67) | 788 (31) | 1626 (64) | 390 (860) |
| EM4 Controller | | 1880 (74) | 788 (31) | 1626 (64) | 600 (1330) |

3.14 Lift the E-Multi Injection Unit



WARNING

When doing any work on the machine that requires lifting the machine, connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death.

Never use the motor as a lifting point.

Never use an E-Multi attached to the mold as a lifting point.



Figure 3-5 Do not use the motor as a lifting point

| Table 3-10 E-Multi Injection Unit Lifting Kits | |
|--|---|
| EM1 / EM2 | 2 x 16 mm (5/8 in.) bow shackles 2 x 1220 mm (48 in.) slings |
| EM3 | 2 x 25 mm (1 in.) bow shackles 2 x 1830 mm (72 in.) slings |

3.14.1 Prior to Lifting the E-Multi Injection Unit

1. Choose lift equipment that is rated for the prescribed load. See equipment tag.
2. Define the **load path**: the path and orientation the item will move in while it is being lifted, and the location and orientation where it will be set down.
3. Use recommended attachment points only. See Section 3.15.
4. Identify and avoid potential **pinch points**: where an individual or a component of the lifting equipment or load may be caught between two surfaces.
5. Secure and balance the load in the chain or lifting device before it is lifted more than a few inches.
6. Minimize swinging by bringing the hook over the load appropriately.
7. Move powered hoists slowly into engagements with loads.

3.15 EM1 / EM2 / EM3 Lift Connections



NOTE

Review the information in "3.13 E-Multi Weight Specifications" on page 3-20 before performing any lifting procedure.

3.15.1 EM1 / EM2 / EM3 Vertical Lift Connections

| Table 3-11 EM1 / EM2 / EM3 Vertical Lift Connections | |
|---|---|
| EM1 / EM2 | EM3 |
| Connect sling to motor end of the support beam using one 16 mm (5/8 in.) shackle in lifting hole. | Connect sling to motor end of the support beam using a 25 mm (1 in.) shackle in lifting hole. |



Figure 3-6 EM1 / EM2 vertical lifting connections (EM3 similar)

3.15.2 EM1 / EM2 / EM3 Horizontal Lift Connections

| Table 3-12 EM1 / EM2 / EM3 Horizontal Lift Connections | |
|--|---|
| EM1 / EM2 | EM3 |
| *Note: For best results use an adjustable two leg chain bridle. | |
| <p>Connect one sling (A) to motor end of the support beam by feeding it through the lifting hole, with sling on either side of the motor.</p> <p>Connect other sling (B) to barrel end of the support beam using two 16 mm (5/8 in.) shackles in the lifting holes.</p> <p>NOTE: EM1 / EM2 units require blocks or shipping brackets when set down horizontally to prevent damage to the linear actuator.</p> | <p>Connect one sling (A) to motor end of the support beam by feeding it through the lifting hole, with sling on either side of the motor.</p> <p>Connect other sling (B) to barrel end of the support beam using two 25 mm (1 in.) shackles in lifting holes.</p> |



Figure 3-7 EM3 horizontal lift connections. EM1 / EM2 similar



3.16 EM4 Vertical Lift Procedures

NOTE

Review the information in "3.13 E-Multi Weight Specifications" on page 3-20 before performing any lifting procedure.

The general procedure for lifting the EM4 unit vertically onto the injection molding machine is:

1. Place the EM4 horizontally on the floor from either
 - a) the shipping crate (see 3.16.1) or
 - b) a horizontal stand (see 3.16.2)
2. Attach the lifting bar (see 3.16.3)
3. Raise the EM4 to a vertical orientation with either
 - a) two lifting machines (preferred method) (see 3.16.4)
 - b) one lifting machine (see 3.16.5)
4. Install the EM4 onto the injection molding machine (see 3.16.6)

3.16.1 Horizontal Placement from the Shipping Crate

1. Unpack the E-Multi injection unit. See "Preparation" on page 5-1.
2. Connect the slings to the motor end of the support beam using the two attached shackles. Ensure the slings are on either side of the motor.
3. Connect slings to the barrel end of the support beam using two 25 mm (1 in.) shackles in the lifting holes.
4. Ensure that the slings are securely attached to the lifting machine. Ensure the slings are not twisted or kinked.
5. Lift the unit out of the crate slowly.
6. Remove the front shipping bracket.
7. Place the E-Multi injection unit in a horizontal position on the floor. The unit should rest on the attached stabilizing legs.

**NOTE**

Ensure the floor area surrounding the E-Multi unit is large enough to walk around and move the lifting machines.

8. Install the adapter plate onto the E-Multi injection unit. See "Adapter Plate Removal and Installation" on page 10-5.
9. Verify that the nozzle does not protrude past the adapter plate. If the manifold inlet protrudes past the mold ensure the nozzle will not touch when installed.
10. Remove the slings from the E-Multi injection unit and the lifting machine.

3.16.2 Horizontal Placement from a Horizontal Stand

1. Purge plastic from the system. See "Purge Plastic from System" on page 10-3.
2. Retract the carriage so that the nozzle does not protrude past the adapter plate. If the manifold inlet protrudes past the mold ensure the nozzle will not touch when installed.
3. Allow the E-Multi injection unit to cool to room temperature.
4. Connect slings to the motor end of the support beam using the two attached shackles. Ensure the slings are on either side of the motor.
5. Connect slings to the barrel end of the support beam using two 25 mm (1 in.) shackles in the lifting holes.
6. Ensure that the slings are securely attached to the lifting machine. Ensure the slings are not twisted or kinked.
7. Support the weight of the E-Multi injection unit with the lifting machine.
8. Purge cooling water from the system. See "Purge Cooling Water from System" on page 10-3.
9. Disconnect water, pneumatic, I/O, heater and motor connections.
10. Remove the E-Multi injection unit from the stand.
11. Install the stabilizing legs to the bottom of the E-Multi beam.
12. Place the E-Multi injection unit, in a horizontal position on the floor. The unit should rest on the attached stabilizing legs.



NOTE


Ensure the floor area surrounding the E-Multi unit is large enough to walk around and move the lifting machines.

13. Remove the slings from the E-Multi injection unit and the lifting machine.

3.16.3 Attach the Lifting Bar

This procedure is done with the EM4 unit laying horizontal on the floor.

1. Remove the two shackles from the motor end of the support beam.
2. Screw the shackles to the inside of the lifting bar and secure with a nut. Torque the nut to 101 Nm (75 ft-lbs).

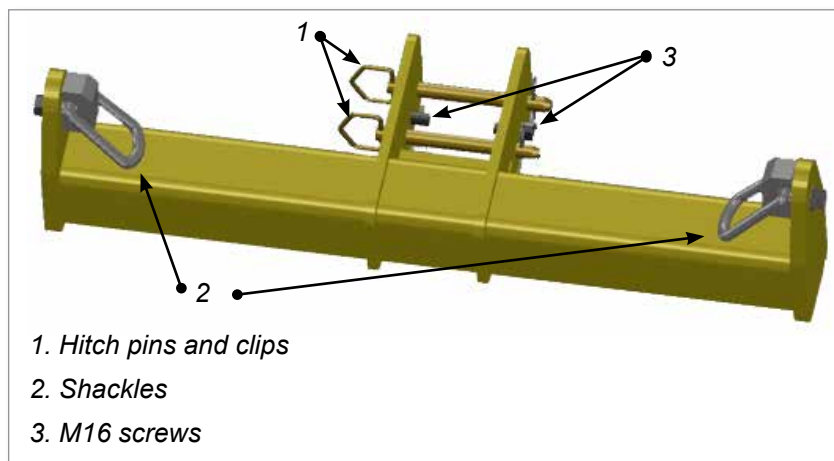


Attach the Lifting Bar - continued

3. Place the lifting bar under the motor and secure in place with the two hitch pins provided.



4. Secure the hitch pins with the provided hitch pin clips.

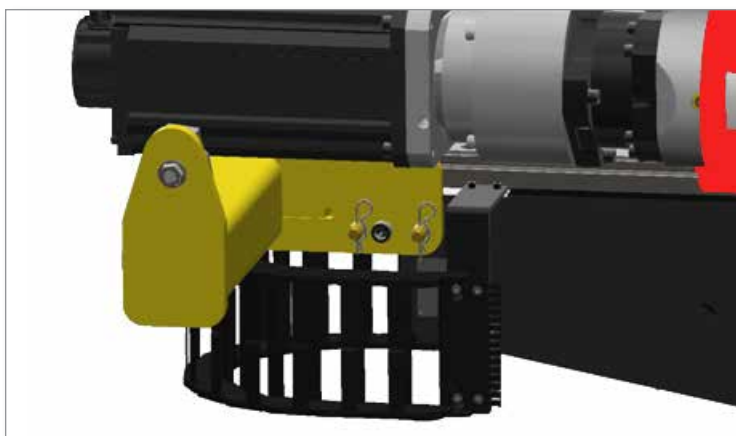

5. Attach and tighten the two M16 screws to the holes in the lifting bar. Torque to 101 Nm (75 ft-lbs).
6. Check that the hitch pins are secure.
7. Attach the slings to the shackles on the lifting bar. The slings should be the same length.





3.16.4 Vertical Orientation with Two Lifting Machines

WARNING

Do not leave the E-Multi injection unit standing vertically without support. This is dangerous and can result in serious injury if the unit falls over.

This is the preferred method to raise the EM4 to a vertical position.

1. Attach the slings from the lifting bar to the lifting machine.
2. Connect slings to the barrel end of the support beam using two 25 mm (1 in.) shackles in the lifting holes.
3. Attach the barrel end slings to the other lifting machine.
4. At the same rate, slowly lift the E-Multi injection unit with both lifting machines. Keep the lifting machines centered over their respective lifting point.
5. Lift approximately 30 cm (1 ft) off of the floor.



6. Lift the motor end of the unit. Keep the lifting machines centered over their respective lifting point.



Vertical Orientation With Two Lifting Machines - continued

7. Continue slowly until the unit is vertical and there is slack in the lower slings.



8. Rest the E-Multi injection unit on the adapter plate. Place the E-Multi injection unit on a surface that will not mar the adapter plate (wood, cardboard, etc.).
9. Carefully remove the lower slings and shackles. Do not remove the E-Multi injection unit from the upper lifting machine.

3.16.5 Vertical Orientation with One Lifting Machine

**WARNING**

Do not leave the E-Multi injection unit standing vertically without support. This is dangerous and can result in serious injury if the unit falls over.

**CAUTION**

Slowly lift to avoid any slipping of the E-Multi injection unit. Keep the hook over the E-Multi to avoid tipping.

It is preferred to use two lifting machines to raise the E-Multi injection unit to a vertical position. Use this procedure if only one lifting machine is available.

1. Remove any slings from the lower / adapter plate position.
2. Attach the slings from the lifting bar to the lifting machine. Ensure the slings are not twisted or kinked.
3. Raise the E-Multi injection unit very slowly, keeping the lifting machine centered over the unit.



4. Move the lifting machine up and forward (towards the barrel end of the E-Multi injection unit), keeping the lifting machine centered over the unit.

5. Continue to slowly raise the E-Multi injection unit until it is in a vertical orientation, keeping the lifting machine centered over the unit.



3.16.6 E-Multi Injection Unit Installation onto the Molding Machine



WARNING - CRUSH HAZARD

A crushing hazard exists between the adapter plate and the mounting surface of the mold.

This procedure begins with the E-Multi injection unit in a vertical position, attached to a lifting machine.

1. Remove the support legs of the E-Multi injection unit.
2. Clean the molding machine and mold where the E-Multi injection unit will be mounted. Any plastic residue on the manifold inlet must be removed to ensure proper nozzle contact.
3. Raise the E-Multi injection unit off the floor using the lifting machine.
4. Clean the adapter plate mating surfaces.
5. Lift the E-Multi injection unit into place above the manifold inlet.
6. Install screws and torque in a crosswise pattern. See "Screw Torques" on page 10-1.
7. Ensure the E-Multi injection unit is securely installed on the molding machine.
8. Remove the lifting equipment from the E-Multi injection unit.

3.17 EM4 Horizontal Lift Connections

| Table 3-13 EM4 Horizontal Lift Connections |
|--|
| EM4 |
| Connect one sling (A) to motor end of the support beam by feeding it through the lifting hole, with sling on either side of the motor. |
| Connect other sling (B) to barrel end of the support beam using two 25 mm (1 in.) shackles in lifting holes. |



Figure 3-8 EM4 horizontal lift connections

Section 4 - Overview

4.1 E-Multi Injection Unit Models



Figure 4-1 E-Multi injection unit models

4.2 E-Multi Injection Unit Components

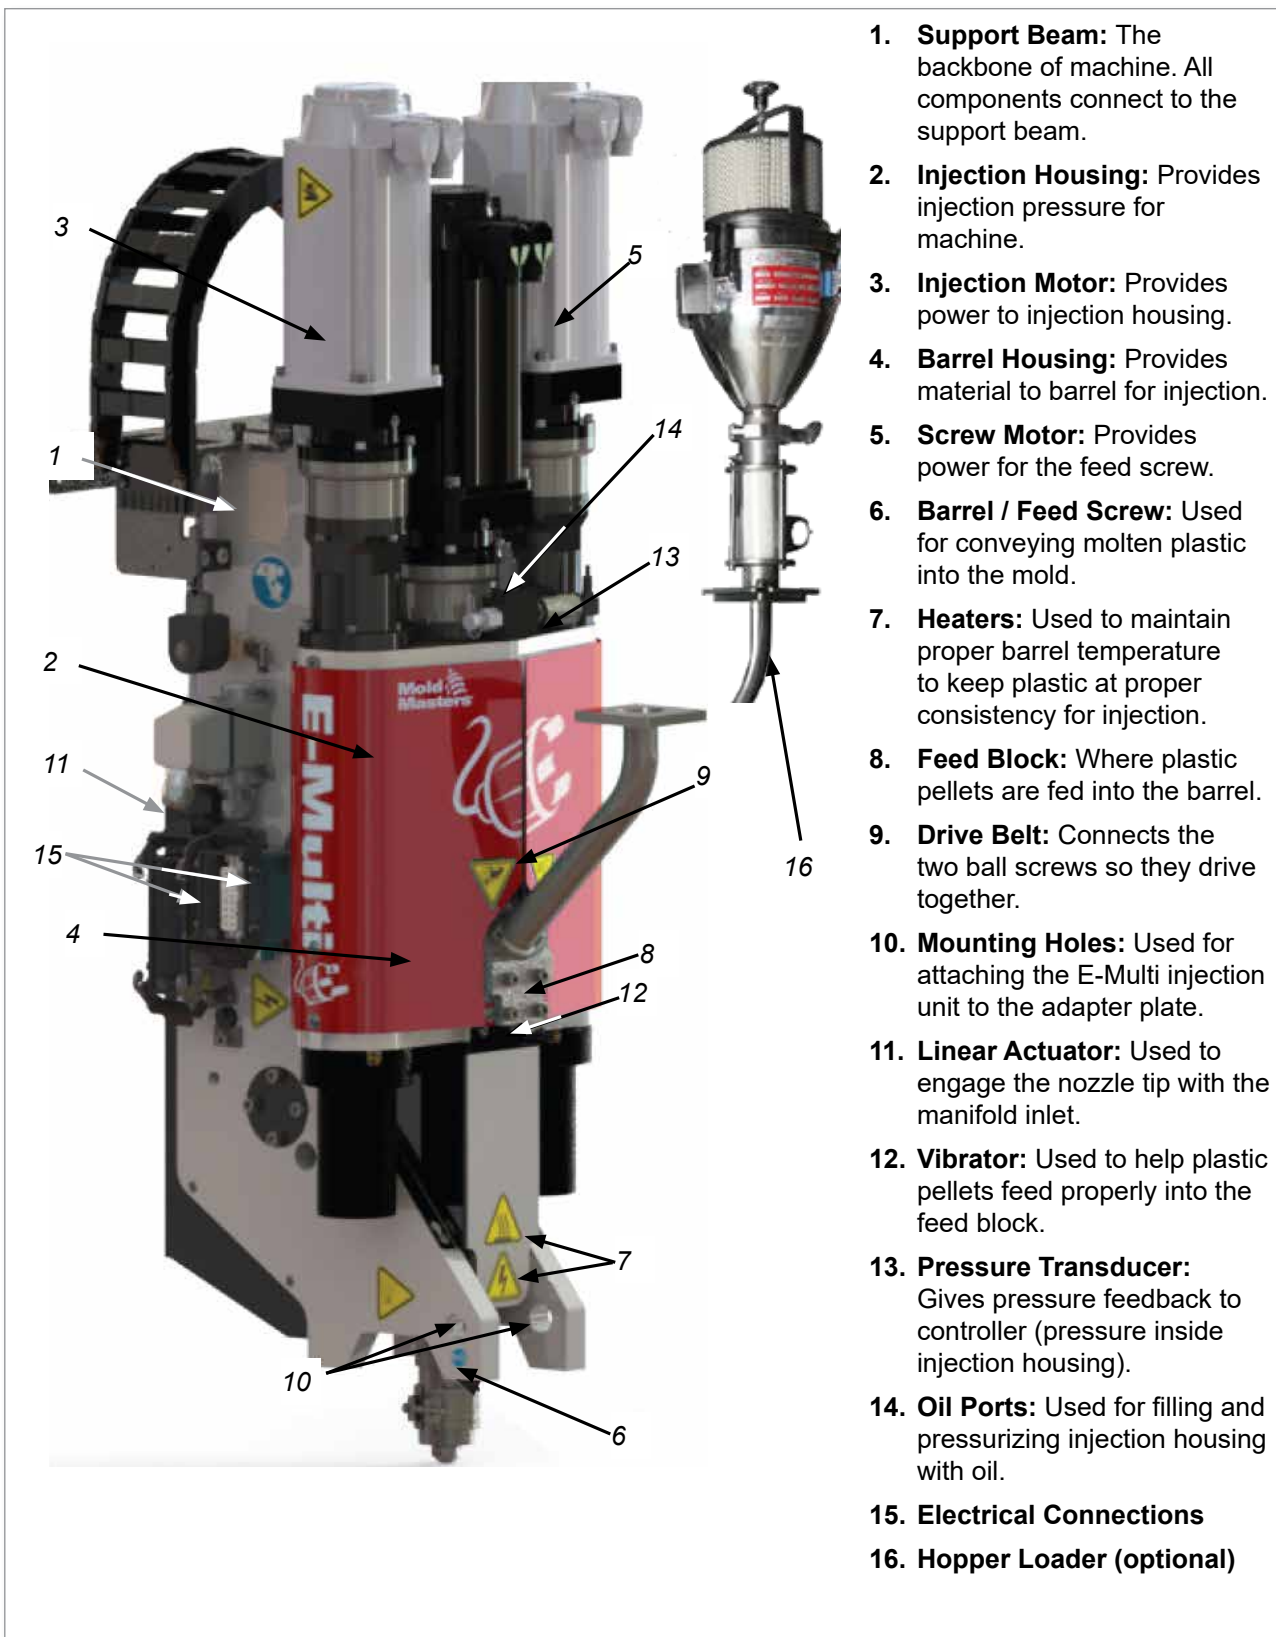


Figure 4-2 E-Multi injection unit components

4.3 Injection Pawl (Back Feed Protection) (optional)

The injection stop pawl is a device that prevents uncontrolled backwards motion of the screw.

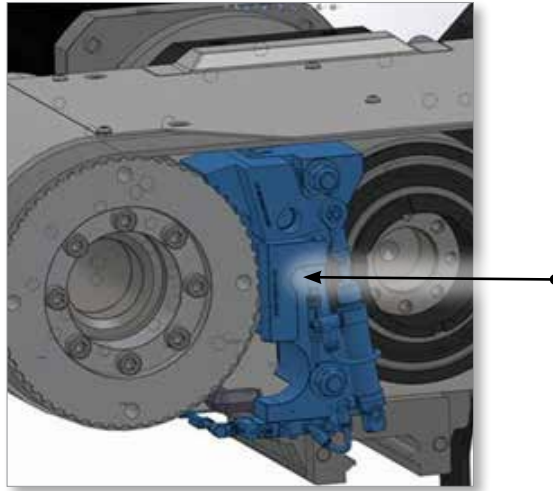


Figure 4-3 Injection pawl

The injection pawl is automatically engaged when the servo drives are disabled or when there is an emergency stop. When the pawl is engaged, it prevents the injection housing from moving backwards. When power is applied to the valve of the injection pawl, the cylinder retracts, disengaging the pawl. When the pawl is disengaged, the pawl position sensor illuminates and a signal is sent to the controller.

Section 5 - Preparation

**WARNING**

Ensure you have fully read "Section 3 - Safety" before unpacking, cleaning or assembling the E-Multi injection unit.

When doing any work that requires lifting the machine, connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death. See "E-Multi Weight Specifications" on page 3-20 for weight, dimensions and safe lifting instructions.

5.1 Shipping Contents

E-Multi Crate:

- E-Multi injection unit
- Oil fill kit (optional)
- Lifting hardware
- Horizontal and vertical feed blocks, feed tube and feed adapter and hardware
- Hook spanner
- Adapter plate and hardware (optional)

Controller Crate:

- E-Multi controller
- Heat, I/O and E67 cables
- SPI adapters (optional)
- Diagnostic kit (optional)
- KeTop remote pendant (optional)
- Documentation package

Stand Crate:

- E-Multi stand and hardware



Figure 5-1 Oil fill kit (optional)

5.2 Unpacking


1. The crate should be moved using a forklift or pallet truck. If using a crane, the crate must be slung from underneath. Do not lift from the top of the crate.
2. Remove accessory boxes, manual and anything other than the E-Multi injection unit.
3. Remove plastic wrap as necessary.



4. Remove the four 3/8" lag screws from the ends of the shipping brackets using a 14 mm (9/16 in.) hex socket.
5. The E-Multi injection unit ships with lifting hardware installed. Use a two leg chain bridle to remove the E-Multi injection unit from the crate. See "E-Multi Weight Specifications" on page 3-20.

5.3 Inspection

1. Check that the E-Multi injection unit has not been damaged in transit.
2. Check all wires and cables. Ensure they are not kinked or damaged and are still connected properly.

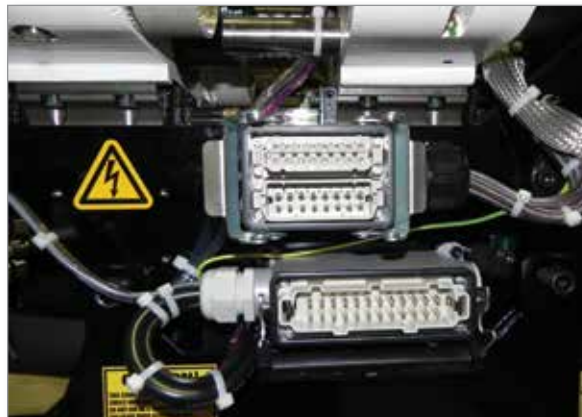

3. Check for oil leaks on the machine. If oil is visible, find the source of the leak and correct. Check oil level. See "Oil Bath" on page 9-7.

Section 6 - Installation



WARNING

Ensure you have fully read "Section 3 - Safety" before unpacking, cleaning or assembling the E-Multi injection unit.

It is the responsibility of the integrator to understand and follow international and local standards for safety of machinery when integrating the E-Multi injection unit into the molding system. This includes providing necessary e-stop connections, safety interlocks and guarding to protect operators.



WARNING - TIP OVER HAZARD

The E-Multi injection unit presents a tip / crush hazard when being moved around on the stand for installation and is stored vertically on the floor or a table. The unit presents a tip / crush hazard when being moved from a vertical to horizontal position during installation.



WARNING - LOCKOUT

Ensure that all energies are properly locked out in the controller and mold machine before installation of the E-Multi injection unit into the system.



WARNING - LIFT POINTS

When doing any work on the machine that requires moving and lifting the machine, connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death. See "E-Multi Weight Specifications" on page 3-20.



CAUTION

E-Multi injection unit is designed to be used only with molds capable of accepting auxiliary injection units.

Ensure the E-Multi injection unit placement will not interfere with injection molding machine movement. Check that all coolant, hydraulic and air lines as well as electrical cables will not interfere with the moving parts of the mold, machine or robot. The lines must be of sufficient length so that they will not strain or pinch when the mold halves separate.

6.1 Attach E-Multi Injection Unit to the Mold / Machine



WARNING - BODY CRUSH HAZARD

The end of the injection motor moves back 210 mm (8 in.) max stroke during hold or recovery. A hazard may exist between the end of the injection unit motor assembly and a nearby solid obstacle. Suitable safety guarding must be installed by the integrator to prevent a crush hazard.

During installation of the E-Multi injection unit onto a mold, a crushing hazard exists between the adapter plate and the mounting surface of the mold.



WARNING - CUT HAZARD

For horizontally-mounted machines with a high centerline height, a person's head could hit the end of the injection unit presenting a cut hazard. Suitable guarding / warning should be installed by integrator.



WARNING

The screws securing the adapter plate to the E-Multi injection unit and the adapter plate to the Injection molding machine must be tightened to the correct torque. See "Screw Torques" on page 10-1.



IMPORTANT

Please refer to the installation drawing supplied with unit for complete information on services and connections.

1. Clean the molding machine and mold where the E-Multi injection unit will be mounted. Any plastic residue on the manifold inlet must be removed to ensure proper nozzle contact.
2. Install adapter plate onto E-Multi injection unit. See "Adapter Plate Removal and Installation" on page 10-5.
3. Verify that E-Multi carriage is retracted to prevent bending the carriage link.
4. Install the E-Multi injection unit horizontally or vertically as described below
 - a) For vertical installations, lift the E-Multi injection unit into place above the manifold inlet and install screws. Torque in a crosswise pattern.
 - b) For horizontal installations, move the E-Multi injection unit into place beside the manifold inlet. Verify the stand is at the correct height and install screws. Torque in a crosswise pattern. See "Stands" on page 15-1.

6.2 Controller Installation



WARNING

Ensure that you have fully read "Section 3 - Safety" before connecting or operating the controller.

It is the responsibility of the integrator to understand and follow international and local standards for safety of machinery when integrating the controller with the molding system.

The E-Multi controller should be located in such a way that the main disconnect is easily accessible in case of emergency.

E-Multi controllers are shipped with a power cable, which is a correct size to run the system. When you install a connector on the cable, ensure that the connector can safely withstand the full system load.

The E-Multi controller supply should have a fused disconnect or main circuit breaker according to local safety codes. Refer to the serial plate on the controller cabinet for confirmation of the main supply requirements. If the local supply is outside the specified range, please contact Mold-Masters for advice.



WARNING - ELECTRIC SHOCK HAZARD

It is crucial to comply with these warnings to minimize any personal danger.

- Ensure that all energies are properly locked out in the controller and mold machine before installation of the E-Multi injection unit into the system.
- DO NOT enter the cabinet without first ISOLATING the supplies OR having a qualified person selecting the BYPASS SWITCH to ON, to gain live access to the controller. There are unguarded terminals inside the cabinet which may have a dangerous potential across them. Where a three-phase supply is used, this potential may be up to 600VAC.
- With the BYPASS SWITCH set to OFF opening the high power section of the controller will cause the circuit breaker to TRIP, disconnecting all power to the cabinet.
- Voltage and amperage cables are connected to the controller and the mold. There is also a cable connection between the servo motor and the controller. Electric power must be shut off and lockout / tagout procedures followed prior to installing or removing any cables.
- Integration should be done by properly trained personnel based on local codes and regulations. Electrical products may not be grounded when removed from the assembled or normal operating condition.
- Do not mix electrical power cables with thermocouple extension cables. They are not designed to carry the power load or list accurate temperature readings in each other's application.



WARNING - TRIP HAZARD

The integrator should ensure that the controller cables do not present a trip hazard on the floor between the controller and the mold machine or the E-Multi.

6.3 Operational Environment

The E-Multi controller should be installed in a clean, dry environment where the ambient conditions do not exceed the following limits:

- Temperature 0 to +45°C
- Relative Humidity 90% (non-condensing)

Section 7 - System Setup

**WARNING**

Ensure you have fully read "Section 3 - Safety" before setting up the E-Multi injection unit.

7.1 Connection of the Controller to the E-Multi Injection Unit

There are 3 sets of cables that connect the controller to the E-Multi injection unit:

1. servo power cables
2. servo feedback cables
3. heater - I/O - injection molding machine cables

The correct sequence must be followed when installing the cables. The servo power and feedback cables need to be routed through the cable track before being connected to the motors. The heater and the I/O cables can be connected directly and are not routed through the cable track. All cables should be routed so they do not interfere with the mold or molding machine operation.

7.1.1 Route and Connect Servo Cables

**WARNING**

Make sure that the cables are connected to the correct motors. Cables and motors are clearly labeled. Reversing the cables can result in unexpected and uncontrolled motion causing a safety risk or damage to the machine.

1. Uncoil the servo cables and make sure they are not damaged or twisted.
2. Route the servo power cables on the higher side of the track, closest to the motor. Route the servo feedback cables, lower in the track, as far as possible from the motor.



Figure 7-1 EM3 Servo cable routing

3. Connect the servo cables to the motors.

Route and Connect Servo Cables - continued

4. Once cables have been routed, use cable ties to hold cables in place. See below for correct connector alignment.



Figure 7-2 Cables held with wire ties

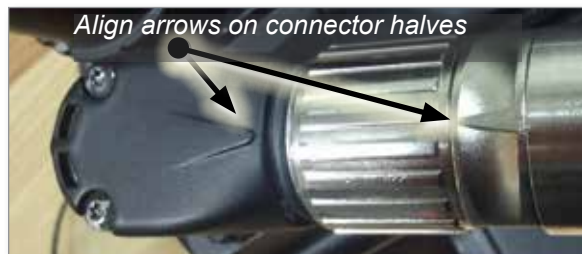


Figure 7-3 Correct connector alignment

7.1.2 Route and Connect Heater, I/O, Injection Molding Machine Cables

1. Uncoil the heater and I/O cables and make sure they are not damaged or twisted.
2. Connect the "MOLD END" of the heater cable to the connector on the E-Multi injection unit.
3. Connect the "MOLD END" of the I/O cable to the connector on the E-Multi injection unit.
4. Route the cables towards the motor end of the E-Multi injection unit, taking care not to interfere with any moving parts or obstructing the air connection. The cables may be tied to the motor end shipping bracket, if required.
5. Connect the "CONTROLLER END" of the cables to the "BARREL HEAT CONNECTOR" and "AUX INJ. UNIT" connectors on the controller. See Figure 7-4 on page 7-3.

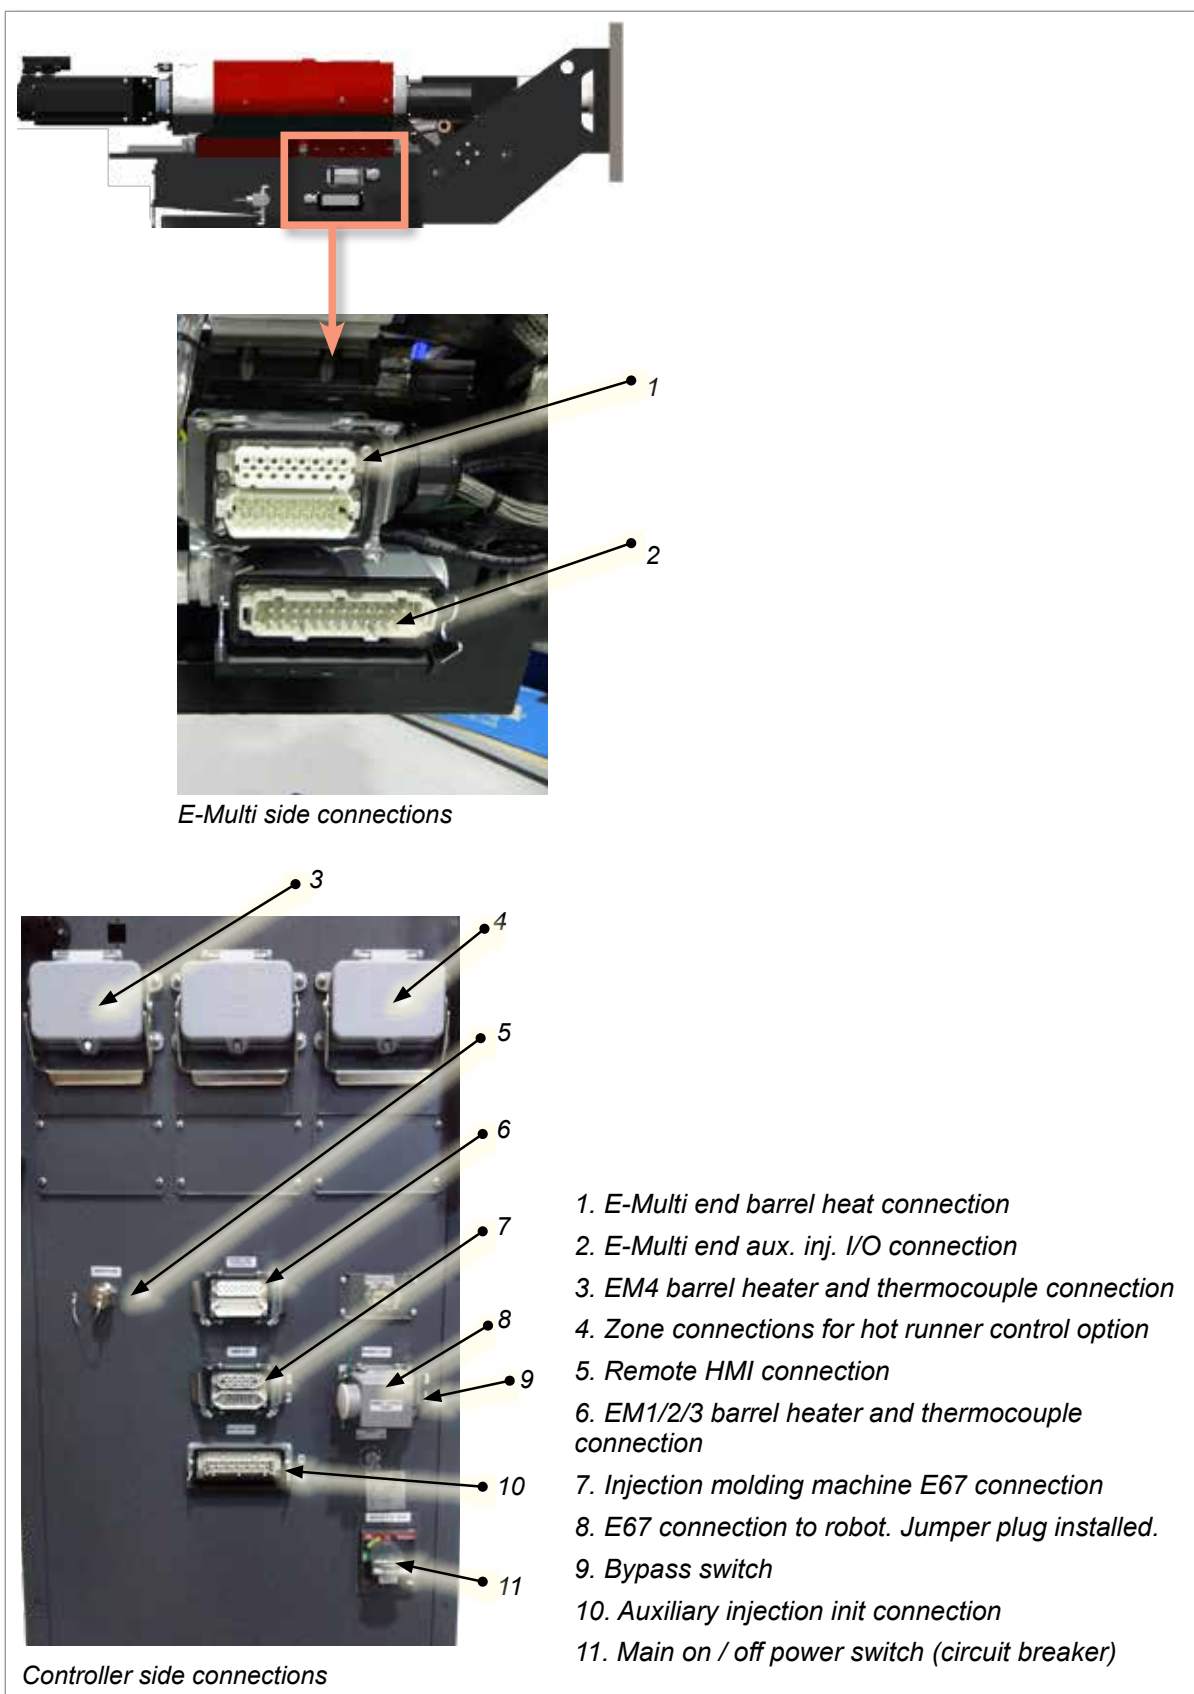


Figure 7-4 E-Multi connection locations

7.2 Connection to a Robot

E-Multi units are compatible with both E67 and SPI robots. In all cases, the controller is shipped with a robot jumper plug.

If no robot is used, connect the robot jumper plug to the “ROBOT E67” connector on the controller (see Figure 7-4 on page 7-3).

If an E67 robot is to be used, connect the robot’s E67 cable to the “ROBOT E67” connector on the controller. If an SPI robot is to be used, attach the optional “ROBOT SPI ADAPTER” to the “ROBOT E67” connector on the controller, and connect the robot’s SPI cable into the “ROBOT SPI ADAPTER.”



Figure 7-6 Robot jumper plug

7.3 Connection of the Controller to the Molding Machine

E-Multi injection units are compatible with both E67 and SPI injection machines. All units ship with an injection molding machine E67 cable. The cable always connects to the injection molding machine E67 connection on the controller. If used with an E67 injection molding machine, the cable plugs into the injection molding machine’s E67 connection directly. If an SPI injection molding machine is used, the cable plugs into the optional Injection molding machine SPI adapter, which then plugs into the injection molding machine SPI connection.

7.4 Connection of a Handheld HMI (Optional)

E-Multi units are available with optional handheld Human Machine Interface (HMI) units to allow control of the E-Multi injection unit when access to the controller is inconvenient. The handheld HMI connects to the “HANDHELD HMI” connector on the controller (see Figure 7-4 on page 7-3).



IMPORTANT

If a handheld HMI is not connected then a jumper plug is required.



Figure 7-5 Hand-held HMI and connection

7.5 Air Connections



WARNING


Hoses fitted to the E-Multi injection unit will contain high or low temperature air under high pressure. The operator must shut down and lockout these systems as well as relieving any pressure before performing any work with these hoses.



CAUTION

Using compressed air at pressures higher than 4.13 bar (60 PSI) will drastically shorten the life of the pneumatic vibrator. Damage to the vibrator as a result of using air pressure over 4.13 bar (60 PSI) is not covered under warranty.

1. Install a 1/8NPT fitting (customer supplied) into the vibrator needle valve.
2. Connect a clean, dry, non-lubricated air supply, not exceeding 4.13 bar (60 PSI), to the vibrator needle valve.

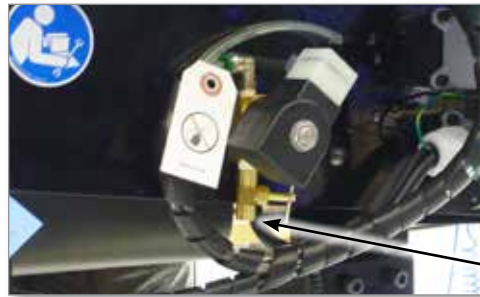

• *Vibrator needle valve*

3. Open the air supply slowly, check for leaks and correct if necessary.

7.6 Water Connections

All units have water-cooled housings to prevent overheating of the injection unit. The EM3 and EM4 have water cooled servo motors. Figure 7-7 below shows the water inlet and outlet manifolds on the support beam.

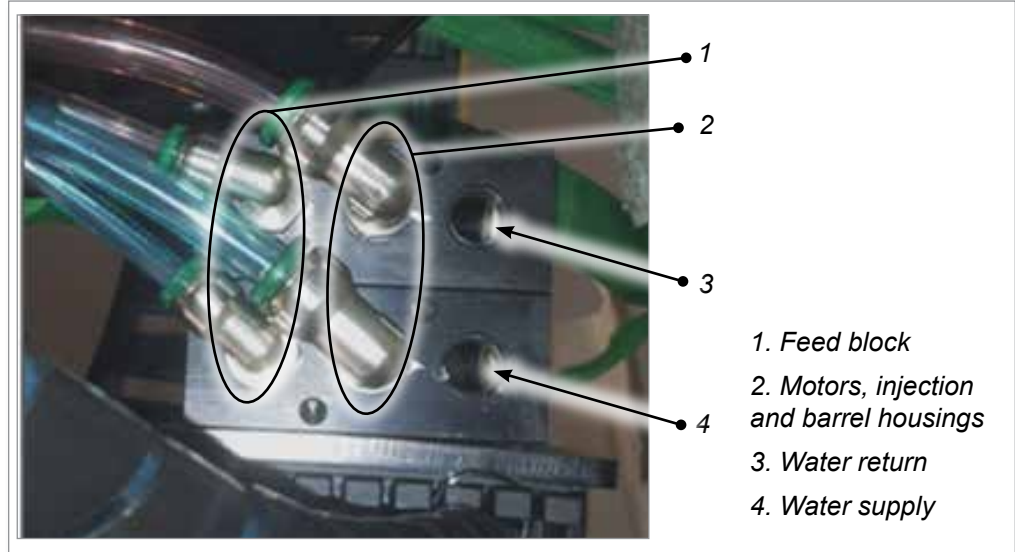


Figure 7-7 EM3 / EM4 water supply and return manifolds



Figure 7-8 EM3 / EM4 Servo motor cooling connections

Both inlet and outlet are 1/4NPT connections. If the 3/8NPT ports are used then the 1/4NPT ports must be plugged.

Contact your local service representative for replacement parts.

| Table 7-1 Cooling System Water Limits | |
|---------------------------------------|--|
| Property | Limits |
| Flow rate | 3 - 6 liters (102 - 202 oz) per minute |
| Maximum pressure | 6 bar (87 PSI) at the motor inlet |
| Temperature | Minimum 5°C (41°F) above dew point or at ambient to prevent condensation. Maximum 50°C (122°F) |

7.6.1 Cooling Water Schematic

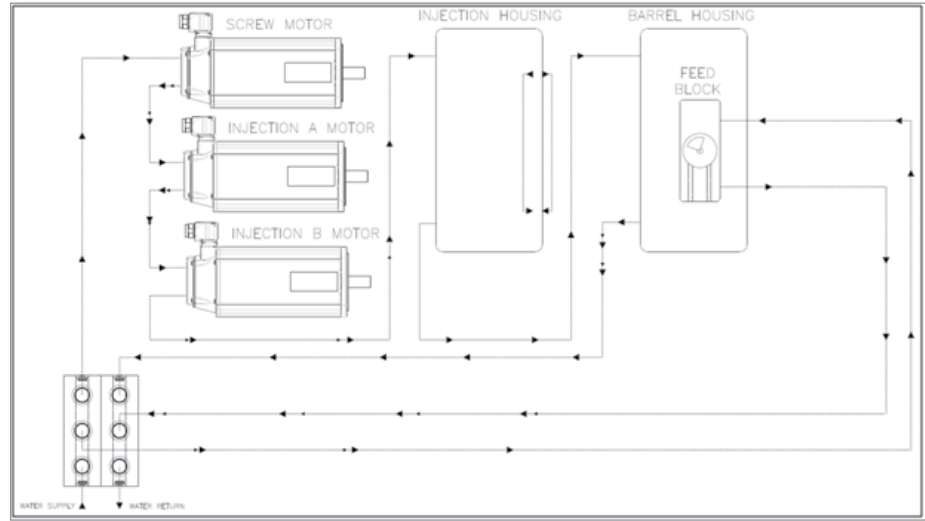


Figure 7-9 Water cooling schematic diagram

7.6.2 Corrosion Caused by Condensation

Control the cooling temperature to prevent condensation on the injection unit. Condensation can cause corrosion of critical mechanical components. This damage will not be covered by the warranty.

Install manual control valves or automatic temperature controls to ensure condensation does not occur.

7.6.3 Cooling Water Quality



CAUTION

Use clean water. Contaminated water will clog the servo motor cooling channels. It may result in decreased cooling performance and necessitate replacement of the servo motors.

Mold-Masters recommends the use of our optional closed loop cooling system. Contact your Mold-Masters representative for more information.

| Table 7-2 Basic Water Quality Specification | |
|---|-------------------|
| Constituents | Recommended Value |
| pH | 7.2 - 8.5 |
| CaCO ₃ (ppm) | < 10 |
| Ryznar Stability Index (RSI) | 5.0 - 6.0 |
| Temperature °C (°F) | 5 - 25 (41-77) |
| Flow rate l/min (oz) | 3 (102) |

A more detailed water quality specification is found in "Section 17 - Water

Quality" on page 17-1. The values in "Table 7-2 Basic Water Quality Specification" on page 7-7 represent conditions that will prevent most problems associated with poor water quality. These recommended values do not guarantee that corrosion will not occur.



Figure 7-1 Water quality specification tag on E-Multi

7.6.4 Coolant and Additives



CAUTION

Damage caused by corrosion or condensation is not covered under warranty.

If the closed loop system volume is small, use a packaged ready made preserved cooling water kit which contains corrosion and microbiological inhibitors. Dow Chemical Company's "DOWFROST" Heat Transfer Fluid is recommended.

7.7 Connection to a Diagnostic Computer (Optional)

1. Connect one end of the crossover cable to Ethernet port on the controller. The Ethernet cable can be connected with the power on.



2. Connect the other end of the crossover cable to the Ethernet port on the diagnostic computer. Note that the diagnostic computer may differ from the one shown.



3. Connect the diagnostic computer power supply and connect to mains power. Use the included adapter for 220 V mains.
4. Power up the diagnostic computer and log in with the following credentials:

User name: emulti

Password: nopassword

5. Connect the diagnostic computer to a WIFI network with internet access. To see a list of available networks, click the wireless network icon next to the clock on the taskbar.

**NOTE**

The diagnostic computer must be connected to the internet using its wireless network adapter. The wired connection must be used to connect to the controller. Mold-Masters does not support alternate network configurations. Connection problems when using alternate configurations are not covered under warranty and may result in increased support times and additional costs.



Figure 7-10 Wireless network icon

6. Open a browser and perform a search to verify internet connectivity.

Section 8 - Operation



WARNING

Ensure that you have fully read "Section 3 - Safety" before setting up the E-Multi injection unit.

8.1 Introduction

Before the E-Multi injection unit can be used, the controller will need to be set up. Please see Section 9 for details on setting parameters such as:

- heating
- control
- injection speeds
- trigger signals, etc.

8.2 Controller Startup and Shutdown



CAUTION

Although the main switch has the capacity to switch the whole system off, it is recommended that this is only done in an emergency.

The controller uses computer technology and should be switched off in stages.

A sequenced method for switching on and off protects the console and keeps the switched load to a minimum to extend the life of the main isolator.

For all E-Multi controllers, the main power switch is a rotary circuit breaker at the rear of the cabinet. This switch is rated to safely disconnect the total load current during switch on and switch off.

You can use a suitably-sized padlock, or similar device to lock the switch in the off position to lockout electrical supply during maintenance.

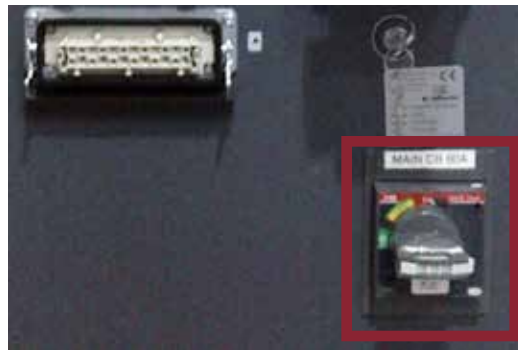


Figure 8-1 E-Multi main power switch

8.3 Switch On

When the main power switch is turned to on, the servo motors will not be enabled.

Once the software has finished loading and the display shows the Overview page, the system is in Manual mode and is ready to have the heaters switched on to bring the barrel heaters to temperature.

Servo motors may be enabled by pressing the **[F1]** button on the button strip located below the display. Once the servo motors are enabled, the LED at the top left of the button will turn on.



Figure 8-2 Button strip below controller display (HMI)

The E-Multi controller can be used in Manual, Setup and Auto/Ready mode.

8.4 Switch Off (Shutdown)

Mold-Masters recommends that you use the console to shutdown the heating load, and only use the main current breaker switch to turn off the dormant controller.

8.4.1 Shutdown the Heating

Press the **[F8]** button located on the button strip located below the display.

The LED at the top left of the **[F8]** button indicates heating status.

- If the LED is lit, heating is active.
- If the LED is not lit, heating is off.

8.4.2 Shutdown the Controller

Once heating has been turned off, the system may be turned off using the main switch on the back of the controller.

Section 9 - Lubrication



WARNING

Make sure that you have fully read "Section 3 - Safety" before doing maintenance procedures on the E-Multi injection unit.



CAUTION

Regular inspection and lubrication will help to maintain the health of the E-Multi and minimize unscheduled downtime. Failure to follow the recommended lubrication procedures will result in premature machine failure, thereby voiding the machine warranty.

9.1 Preventive Maintenance Schedule

| Table 9-1 Preventive Maintenance Schedule | |
|--|---|
| Preventive Maintenance | Frequency |
| Verify injection pressure oil circuit | Check preload pressure on controller at start of every shift. Preload pressure is shown in the top right hand corner of the screen when the machine is in manual or when waiting for a start trigger in auto. |
| Oil bath level | Check every 3 months; add oil if necessary |
| Lubricate linear guides | Check every 3 months; add grease if necessary |
| Lubricate injection ball screws | Inspect every 10 days. Lubricate every 250,000 cycles or every 3 months, whichever comes first |
| Lubricate carriage ball screw nut (E-Multi Radial and Servo Carriage options only) | Lubricate every month for sprue-break applications Lubricate every 3 months for continuous forward applications |

| Table 9-2 Injection Unit Lubrication | | | |
|---|---|--------------------|--|
| Location | Type | Manufacturer | Manufacturer's P/N |
| Injection Ball Screw Nuts | Spindle bearing grease | Klüber Lubrication | ISOFLEX NBU 15* No exceptions allowed |
| Carriage Ball Screw Nut | Spindle bearing grease | Klüber Lubrication | ISOFLEX NBU 15 Preferred |
| Linear Guides Carriage Spring Pack | Spindle bearing grease | Klüber Lubrication | ISOFLEX NBU 15 Preferred |
| | Barium based thickening agent | Klüber Lubrication | Staburags NBU 8EP |
| | Lithium based thickening agent | Klüber Lubrication | Klüberplex BEM41-141 |
| | Aluminum based thickening agent | Lubcon | Thermoplex ALN 1001 |
| Oil Bath Level (for internal Ball Screw Thrust Bearings)) High-Pressure Oil Circuit | 75W-90 EP Synthetic extreme pressure gear oil GL-5 | Mobil | Mobil Delvac 75W-90 |
| | | Pennzoil | Pennzoil Synthetic 75W-90 (GL-5) |
| | | Shell | Spirax S6 AXME 75W-90 |
| | | BP | Energear SHX-M 75W-90 |
| General Assembly | Soap based lithium grease | Klüber Lubrication | ISOFLEX NBU 15 |
| | | Shell | Gadus S2 |
| | | Loctite | 30530 |
| | Barium based thickening agent | Klüber Lubrication | Staburags NBU 8EP |
| | Lithium based thickening agent | Klüber Lubrication | Klüberplex BEM41-141 |
| | Aluminum based thickening agent | Lubcon | Thermoplex ALN 1001 |
| High-Temperature Bolts Thermocouples Barrel-to-Housing Feed Block Retaining Bolts Screw Drive Gearbox Output Shaft Screw Spline or Threads Screw Bushing and / or Collet Ring Check Threads and Seating Face | Anti-seize compound, silver grade | Loctite | 767 |
| Actuator Rod End Actuator Link Ball-screw Back Stops Spring Pack Set Screw Vibrator Mounting Screws Manifold-to-Shipping Bracket Screws | Thread lock compound, removable | Loctite | 242 |
| | | | 243 |

| Table 9-2 Injection Unit Lubrication | | | |
|--------------------------------------|---------------------|--------------|--------------------|
| Location | Type | Manufacturer | Manufacturer's P/N |
| Pipe Plugs | Pipe thread sealant | Loctite | 567 |
| Needle Valve to Solenoid Valve | Teflon tape | Any | - |

*Can be purchased from Mold-Masters

| Table 9-3 Lubrication Volumes of Injection Ball Screws | | | | |
|--|--|---|------------|---------------------|
| E-Multi Model | Number of Ports per Injection Ball Screw Nut | Required Volume of Kluber Isoflex NBU 15 Added Manually Every 250,000 cycles or Every 3 Months, Whichever Comes First | | |
| | - | cc per port | cc per nut | cc Total for 2 Nuts |
| EM1 | 1 | 4.2 | 4.2 | 8.4 |
| EM2 | 3 | 2.5 | 7.5 | 15 |
| EM3 | 1 | 25 | 25 | 50 |
| EM4 | 4 | 10 | 40 | 80 |
| EM5 | 3 | 20 | 60 | 120 |

| Table 9-4 Lubrication Volumes of Carriage Ball Screws | | |
|---|---|---|
| E-Multi Model | Number of Ports per Carriage Ball Screw Nut | Required Volume of Kluber Isoflex NBU 15 Added Manually Every 3 Months* |
| | - | cc per port |
| ER1, EM1-SC | 1 | 4 |
| ER2, EM2-SC | 1 | 4 |
| ER3, EM3-SC | 1 | 27 |
| ER4, EM4-SC, EM4-TPM | 1 | 50 |
| EM5, EM5-TPM | 1 | 70 |

*Lubricate every month for sprue break applications.

9.2 Preload Oil Pressures

The E-Multi controller uses a pressure transducer in the injection pressure oil circuit to monitor injection pressure during the injection cycle. The pressure in the circuit should be within the specifications shown in Table 9-5.

| Table 9-5 Preload Oil Pressures (1.34 Software) | | | | | | | |
|---|----------------|-------------------------------|-----|-----|-----|-------------------------------------|------|
| Model | Screw Diameter | Preload Oil Pressure on Gauge | | | | Preload Pressure Transducer Voltage | |
| | mm | bar | | psi | | V | |
| | | Max | Min | Max | Min | Max | Min |
| EM1 15 & 30 | 12 | 4.6 | 4.0 | 66 | 57 | 2.35 | 2.31 |
| | 14 | | | | | | |
| | 16 | | | | | | |
| | 18 | | | | | | |
| | 22 | | | | | | |
| EM2 50 & 80 | 18 | 2.6 | 2.0 | 38 | 30 | 2.20 | 2.16 |
| | 20 | | | | | | |
| | 22 | | | | | | |
| | 25 | | | | | | |
| EM3 100 & 200 | 22 | 2.0 | 1.4 | 29 | 21 | 2.16 | 2.11 |
| | 25 | | | | | | |
| | 28 | | | | | | |
| | 32 | | | | | | |
| EM3 250 | 32 | 2.0 | 1.4 | 29 | 21 | 2.12 | 2.08 |
| | 38 | | | | | | |
| EM4 350 & 550 | 32 | 2.5 | 1.9 | 36 | 27 | 2.14 | 2.11 |
| | 35 | | | | | | |
| | 40 | | | | | | |
| | 45 | | | | | | |
| | 50 | | | | | | |
| | 55 | | | | | | |
| EM5 1400 | 50 | 1.4 | 0.8 | 20 | 11 | 2.08 | 2.05 |
| | 55 | | | | | | |
| | 65 | | | | | | |
| | 75 | | | | | | |

9.2.1 Check the Preload Oil Pressure



WARNING

Do not open the high pressure port plugs. High pressure port plugs have plastic plug caps installed to prevent accidental opening.

When doing maintenance, avoid adding air into the oil circuit. Adding air will cause errors in the oil pressure measurement and will result in damage to the E-Multi.

1. Always check with E-Multi injection unit preload pressure at operating temperature and idle pressure.
2. On the controller, tap the Operation Mode Select button and choose Set Up mode. Check the [F1] LED. If it is not blinking, press the [F1] button to put the controller into setup mode.
3. Check the screw position. If the position is greater than half the stroke, move the screw to the half stroke position, and then move the screw back approximately 25 mm (1.0 in.) further.
This will decompress the screw and make sure the pressure value is showing idle pressure.
4. Navigate to the screw settings page. Verify that the actual voltage is within the limits.

9.2.2 Assemble the Injection Pressure Oil Fill Kit



NOTE

The oil fill kit may have been supplied with the E-Multi injection unit and is also available from Mold-Masters. The fill kits are supplied without oil. The oil circuit requires 75W-90 synthetic gear oil.

Components of the high-pressure oil-fill kit:

- Oil gun
 - Tee with fittings
 - Pressure gauge
 - Flexible hose, 2 m (6.6 ft) with quick connects
1. Thread the gauge into the tee and tighten.
 2. Fill the gun with 500 ml (16.90 oz) of the 75W-90 synthetic oil.
 3. Connect the tee to the quick disconnect port on the injection housing.
 4. Connect the flexible hose to the oil gun and tee.
 5. Pump the gun to purge air from the hose. Pump until clear, bubble-free oil comes out of the end of the hose.

9.2.3 Charge the High Pressure Oil Circuit with the Oil Kit

**WARNING**

Never run the E-Multi injection unit with the fill kit attached. Serious injury to the operator and / or damage to the machine may result.

1. Connect the oil gun to the oil manifold on the E-Multi injection unit using the flexible hose quick connect.
2. It is necessary to see the controller, specifically the preload pressure reading. If required, a helper can watch the controller and say what the pressure is.
3. Holding the oil gun with the hose pointing down, pump the gun until the pressure is 2x the upper limit.
4. Place a clean, absorbent cloth below the manifold bleed screw.
5. Open the bleed screw slightly. It is possible air will come out and the pressure will drop significantly. If this happens, open the bleed screw about ¼ turn and examine the oil that comes out.

**NOTE**


The oil should be clear, without bubbles and not foamy.

6. Close the bleed screw and pump the pressure up to 2x the upper limit for the oil kit pressure gauge.
7. Continue bleeding and pumping until no air, bubbles or foam come from the bleed screw.
8. Pump the pressure up one more time.
9. Disconnect the oil fill kit.
10. Open the bleed screw slightly and bleed the oil until the preload pressure on the controller reaches the upper limit.
11. If possible, cycle the injection unit in Auto mode for 10-20 cycles and check the preload pressure again.
12. Bleed or fill as required to get the pressure to remain stable and within the preload oil pressure specifications when cycling in Auto mode.

9.3 Oil Bath


9.3.1 Oil Bath Location

9.3.1.1 EM1, ER1, and EM1-SC

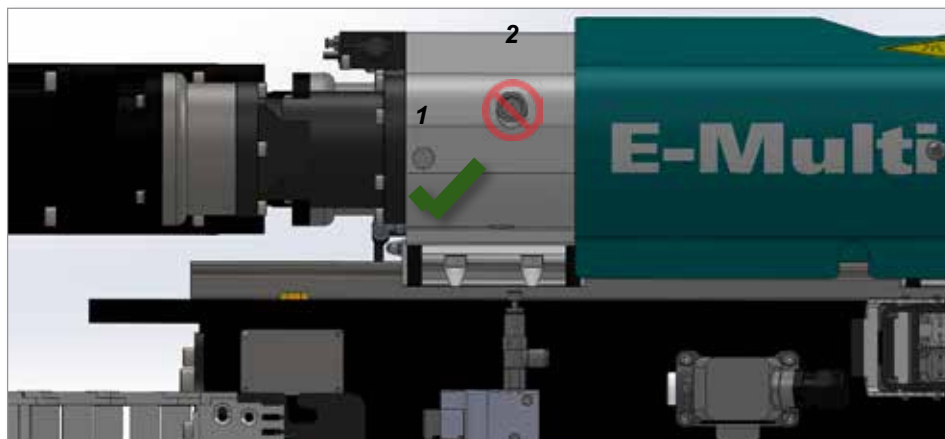

1. Oil fill port
2. High-pressure oil plug

9.3.1.2 EM2, ER2, and EM2-SC

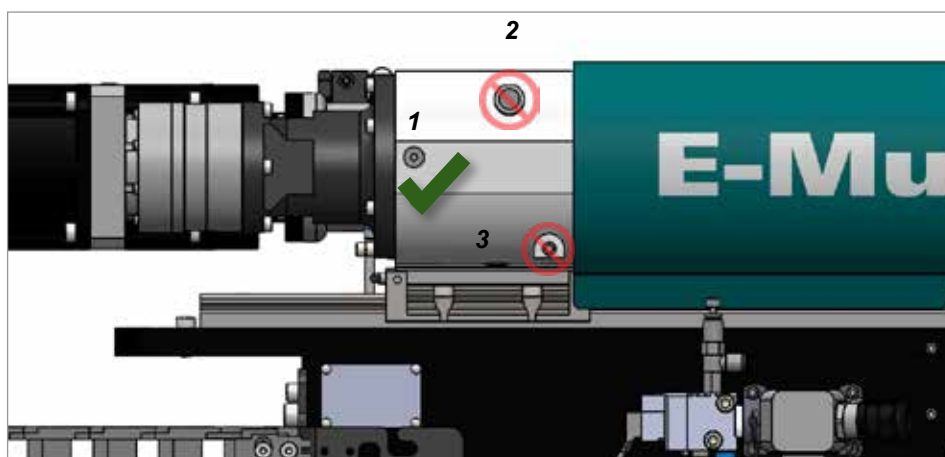

1. Oil fill port
2. High-pressure oil plug
3. Water plug


9.3.1.3 EM3, ER3, and EM3-SC

The locations of the oil fill ports on the EM3, ER3, and EM3-SC are similar to that of the EM1. See section "9.3.1.1 EM1, ER1, and EM1-SC" on page 9-7 for the location of the oil fill port.

9.3.1.4 EM4, ER4, EM4-SC, and EM4-TPM

The locations of the oil fill ports on the EM4, ER4, EM4-SC, and EM4-TPM are similar to that of the EM1. See section "9.3.1.1 EM1, ER1, and EM1-SC" on page 9-7 for the location of the oil fill port.

9.3.1.5 EM5

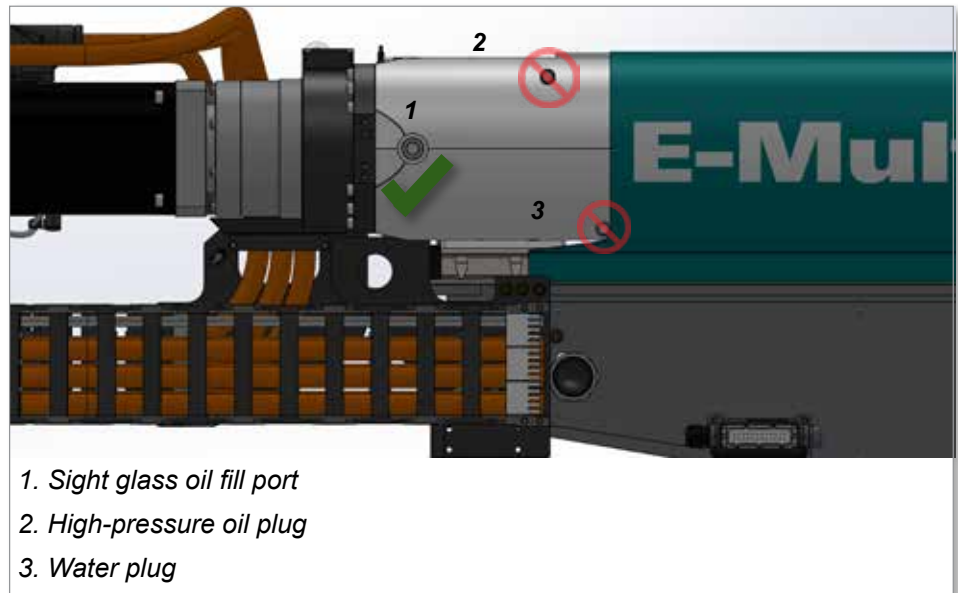

9.3.2 Fill the Oil Bath



WARNING

Be careful not to confuse the low-pressure oil fill port with the high-pressure oil system plug or the water plug.



NOTE

For continued warranty support, use only approved synthetic gear oil as specified in Table 9-2.

1. Move the injection unit fully back.
2. Remove the low-pressure plug from the fill port. See "9.3.1 Oil Bath Location" on page 9-7 for the location of the oil fill port. The oil level should be up to the lower threads of the fill hole.
3. Fill with synthetic gear oil as indicated in "Table 9-2 Injection Unit Lubrication" on page 9-2.

9.4 Injection Ball Screws and Linear Guides

9.4.1 Locations of the Lubrication Points

9.4.1.1 EM1

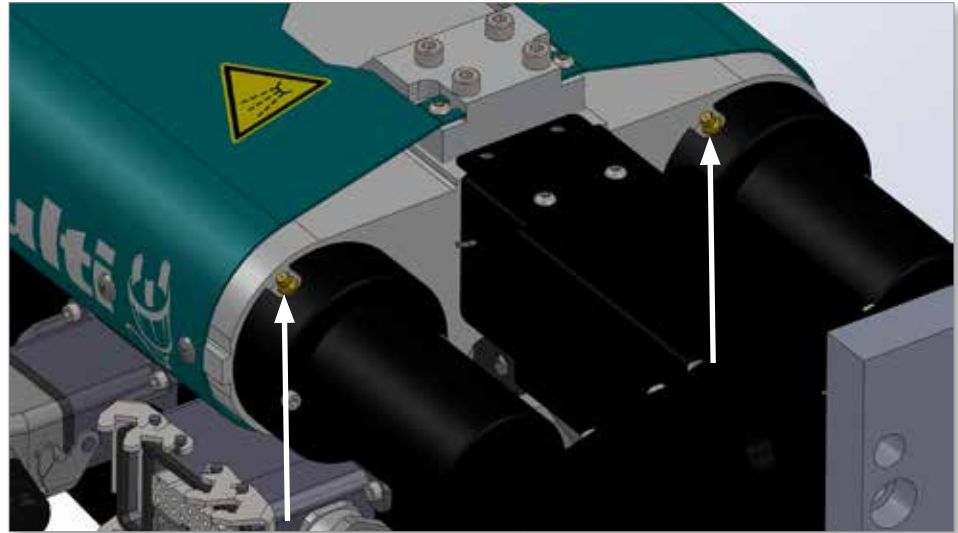


Figure 9-1 Injection ball-screw lubrication points (2)



Figure 9-2 Linear guide lubrication points (2)

See section "9.4.1.1 EM1" on page 9-9 for the locations of the lubrication points of the injection ball screws of the ER1.

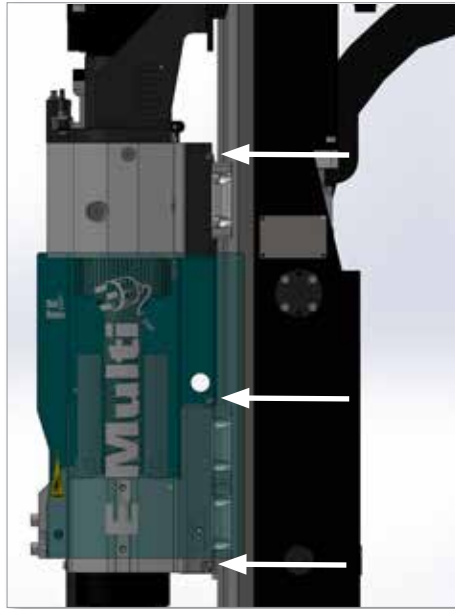


Figure 9-3 Linear guide lubrication points (6 in total)



Figure 9-4 Carriage ball screw lubrication point (1)

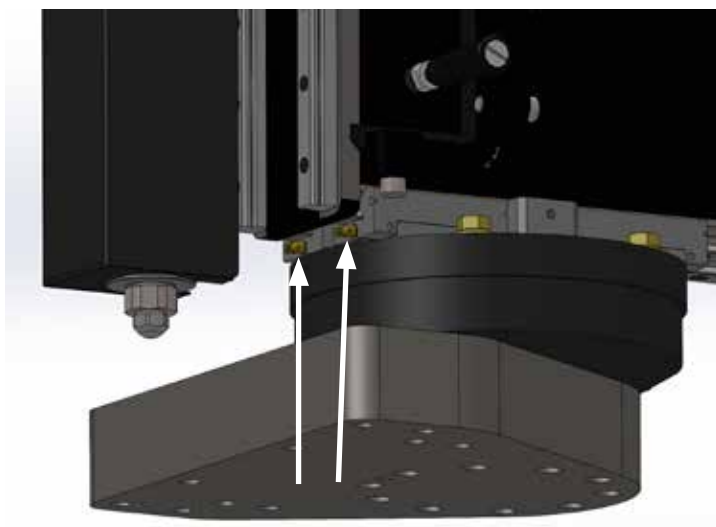


Figure 9-5 Linear guide lubrication points of the carriage lower assembly (2)

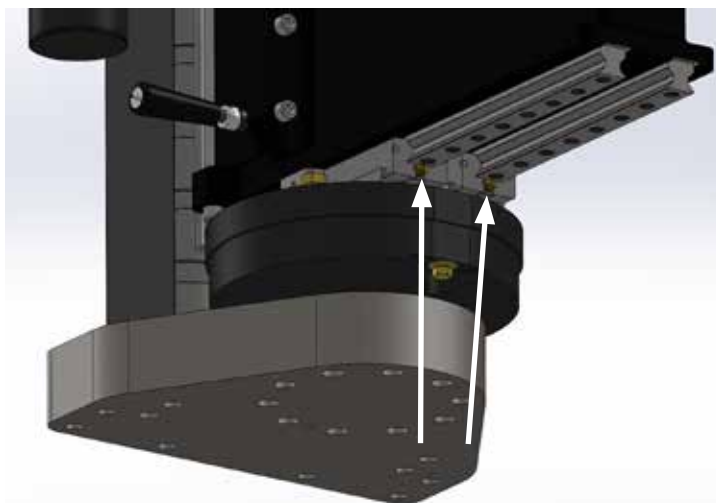


Figure 9-6 Linear guide lubrication points of the carriage lower assembly (2)

9.4.1.2 EM1-SC

See section "9.4.1.1 EM1" on page 9-9 for the the locations of the lubrication points of the injection ball screws.

See Figure 9-4 on page 9-10 for the location of the carriage ball screw lubrication point.

See Figure 9-3 on page 9-10 for the locations of the lubrication points of the linear guides.

See Figure 9-5 on page 9-11 for the locations of the linear-guide lubrication points of the carriage lower assembly.

See Figure 9-6 on page 9-11 for the locations of the linear-guide lubrication points of the carriage lower assembly.EM2



Figure 9-7 Side view showing location of ball-screw lubrication points

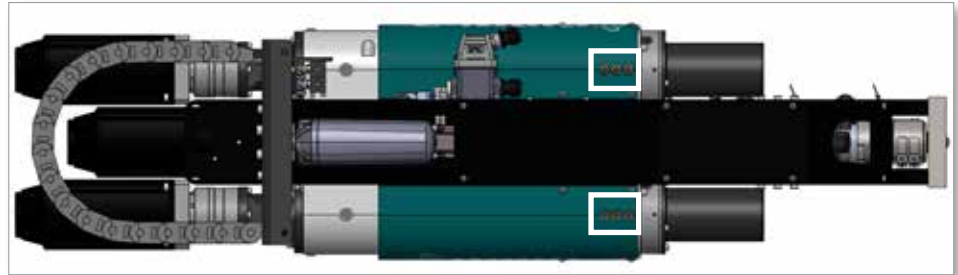


Figure 9-8 Bottom view showing locations of ball-screw lubrication points (6)

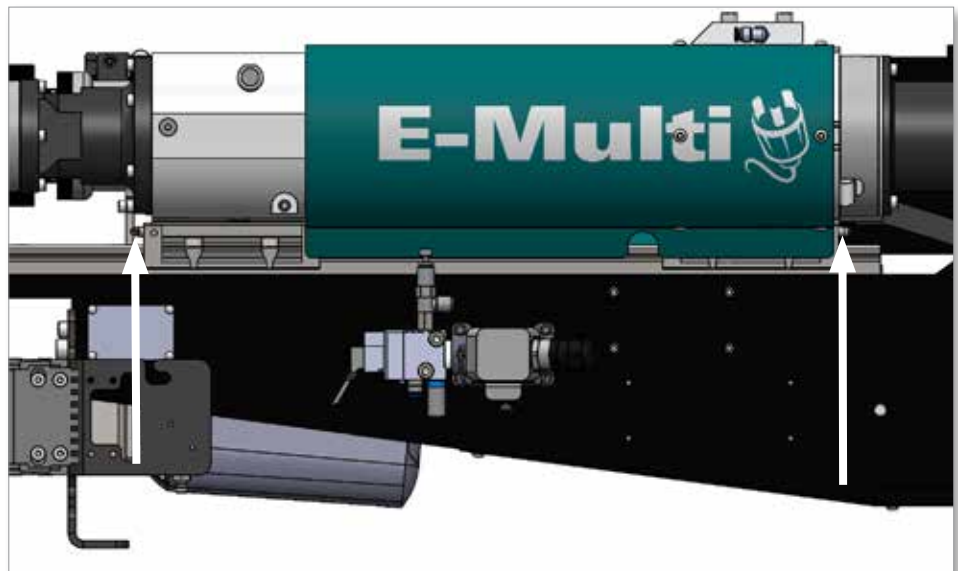


Figure 9-9 Side view showing the linear-guide lubrication points (2)

9.4.1.3 ER2

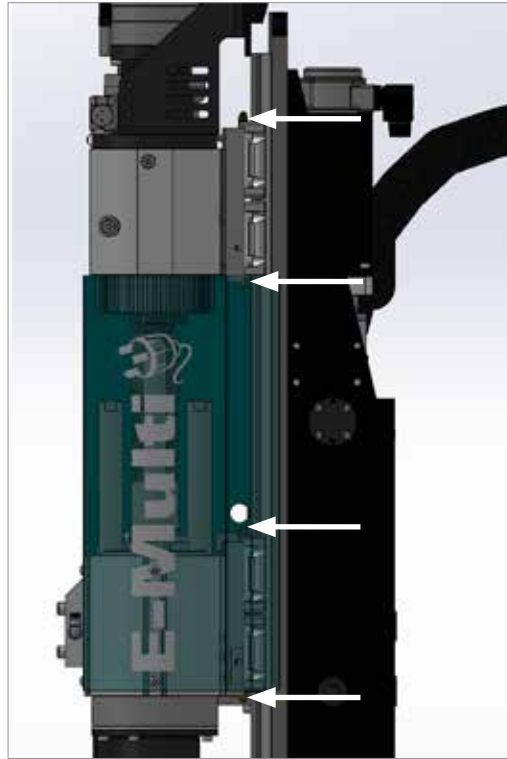


Figure 9-10 Side view showing locations of linear-guide lubrication points (8 in total)

See Figure 9-4 on page 9-10 for the location of the lubrication point of the carriage ball screw.

See Figure 9-5 on page 9-11 and Figure 9-6 on page 9-11 for the locations of the linear-guide lubrication points of the carriage lower assembly.

9.4.1.4 EM2-SC

See Figure 9-3 on page 9-10 for the locations of the lubrication points of the linear guides of the EM2-SC.

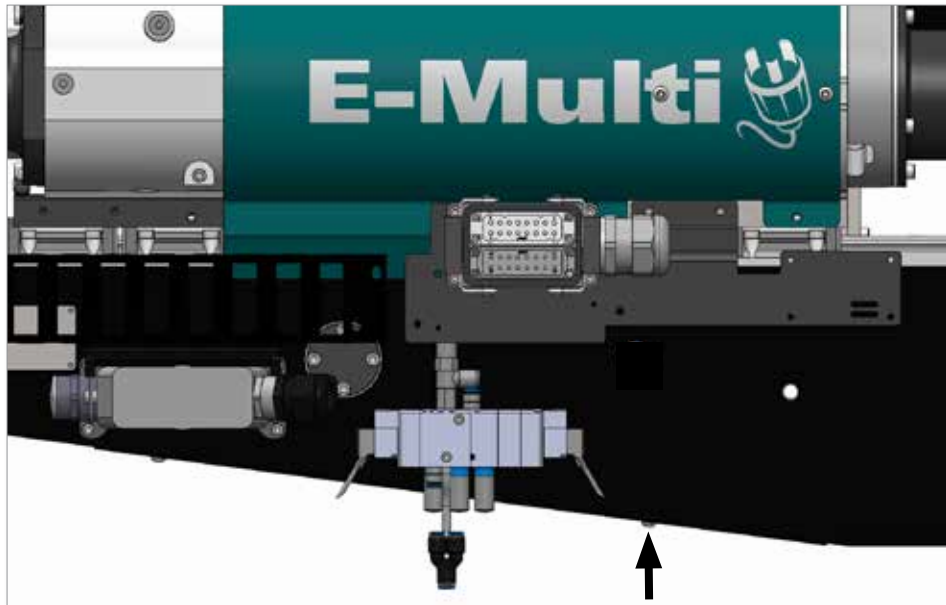


Figure 9-11 Side view showing the location of the lubrication point of the carriage ball screw nut (pre-mid-2023 systems)



Figure 9-12 Bottom view showing the location of the lubrication point of the carriage ball screw nut (pre-mid-2023 systems)

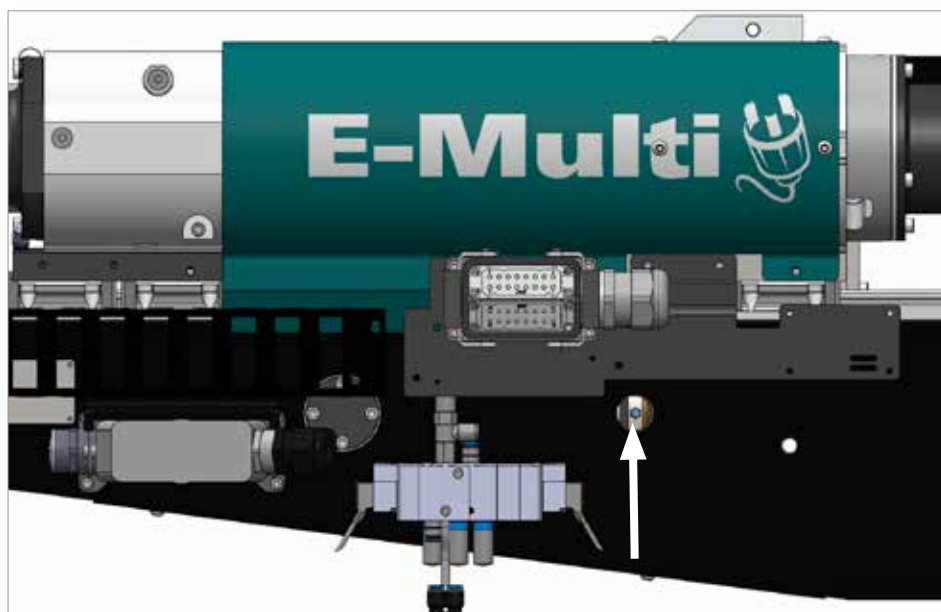


Figure 9-13 Side view showing the location of the lubrication point of the carriage ball screw nut (mid-2023 or later systems)

9.4.1.5 EM3



Figure 9-14 Side view showing location of ball-screw lubrication points

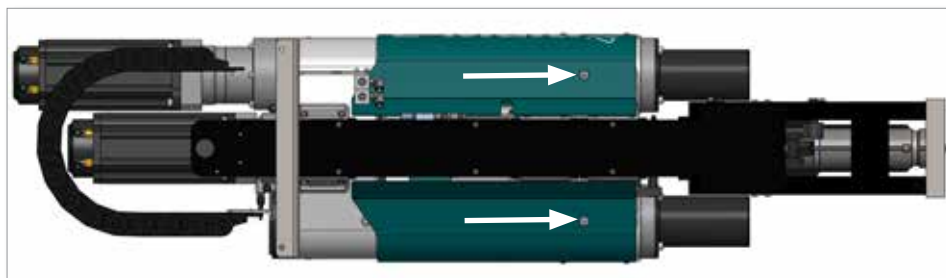


Figure 9-15 Bottom view showing locations of ball-screw lubrication points (2)

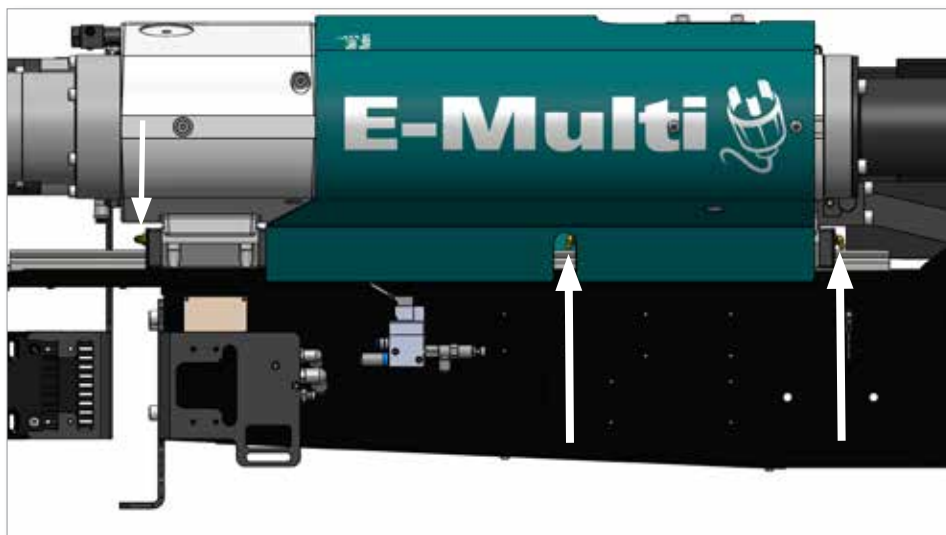


Figure 9-16 Side view showing linear-guide lubrication points (3)

9.4.1.6 ER3

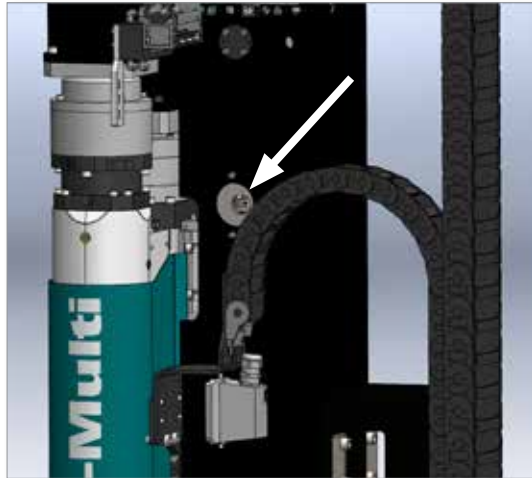


Figure 9-17 Side view (true vertical) showing lubrication point of carriage ball screw nut (carriage down 130 mm from fully-up position)

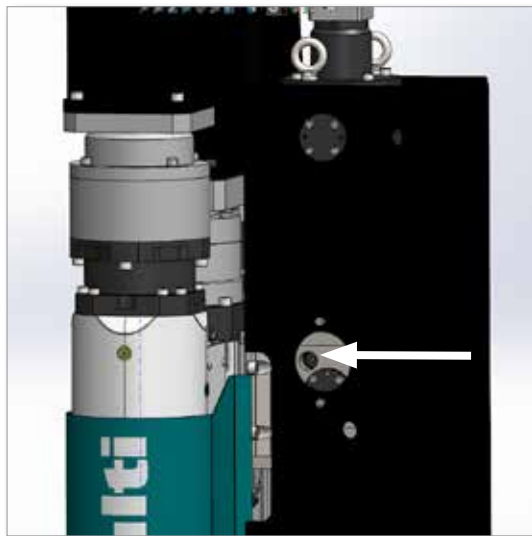


Figure 9-18 Side view (true vertical) showing lubrication point of spring pack (carriage down 50 mm from fully-up position)

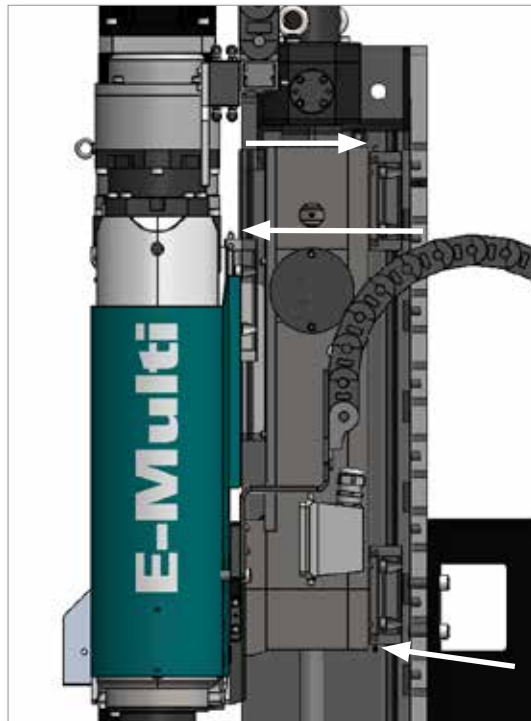


Figure 9-19 Side view (true vertical) of ER3 showing the lubrication points of the linear guides (3)

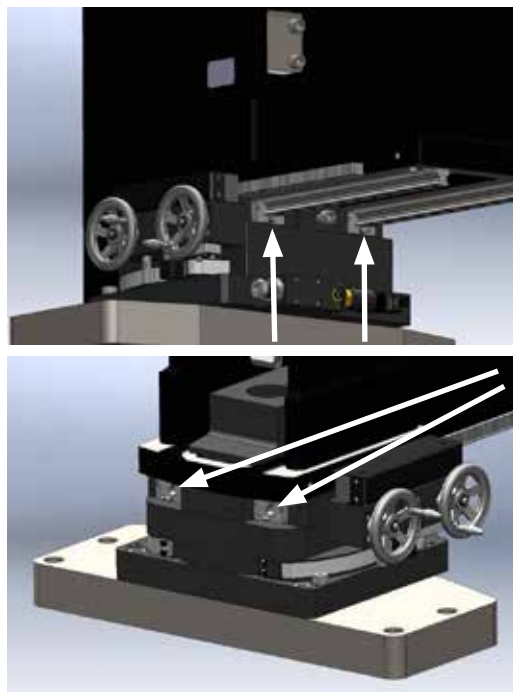


Figure 9-20 Close-up showing the lubrication points (4) of the lower assembly linear guides

9.4.1.7 EM4

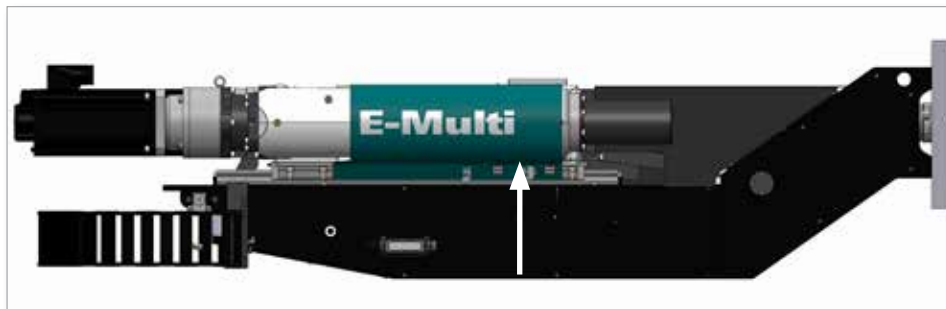


Figure 9-21 Side view showing location of ball-screw lubrication points

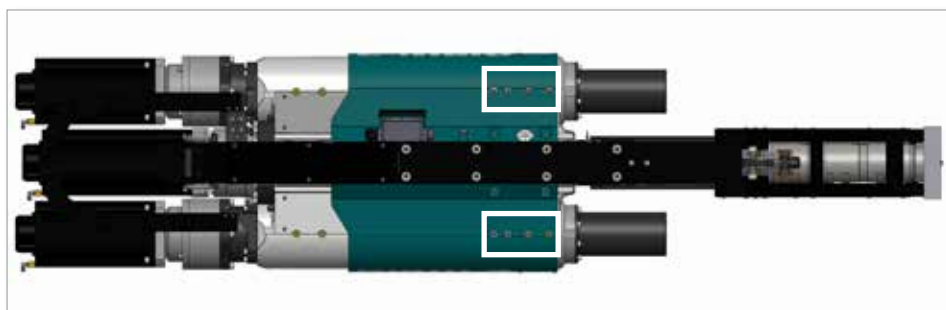


Figure 9-22 Bottom view showing locations of ball-screw lubrication points (8)



Figure 9-23 Side view showing locations of linear-guide lubrication points (3)

9.4.1.8 ER4

See Figure 9-21 on page 9-19 and Figure 9-22 on page 9-19 for the locations of the ball-screw lubrication points.

See Figure 9-18 on page 9-17 for the location of the lubrication point of the carriage ball screw.

See Figure 9-19 on page 9-18 for the locations of the lubrication points of the linear guides.

See Figure 9-20 on page 9-18 for the locations of the lubrication points of the linear guides of the lower assembly of the carriage.

9.4.1.9 EM5

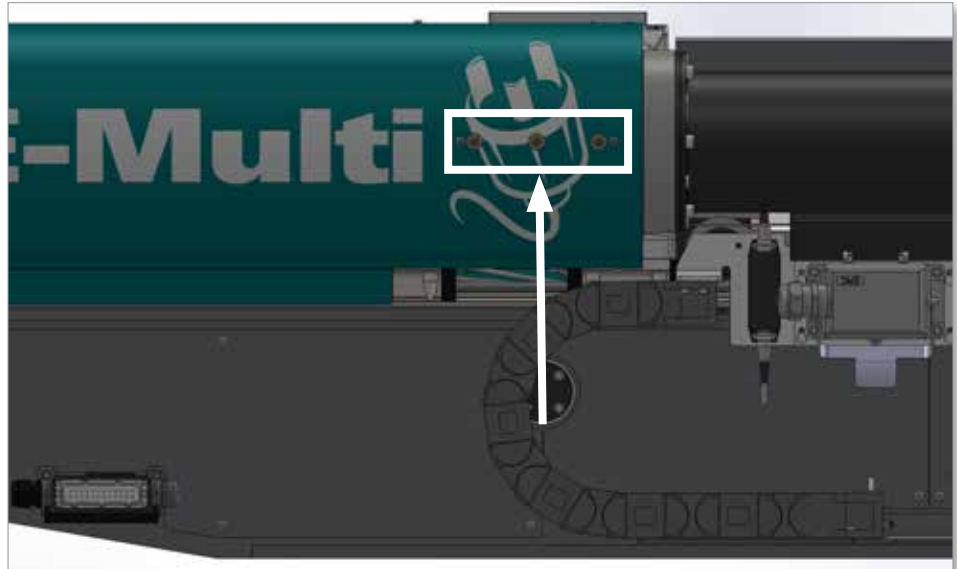


Figure 9-24 Side view showing locations of ball-screw lubrication points (6 in total; 3 on the other side)

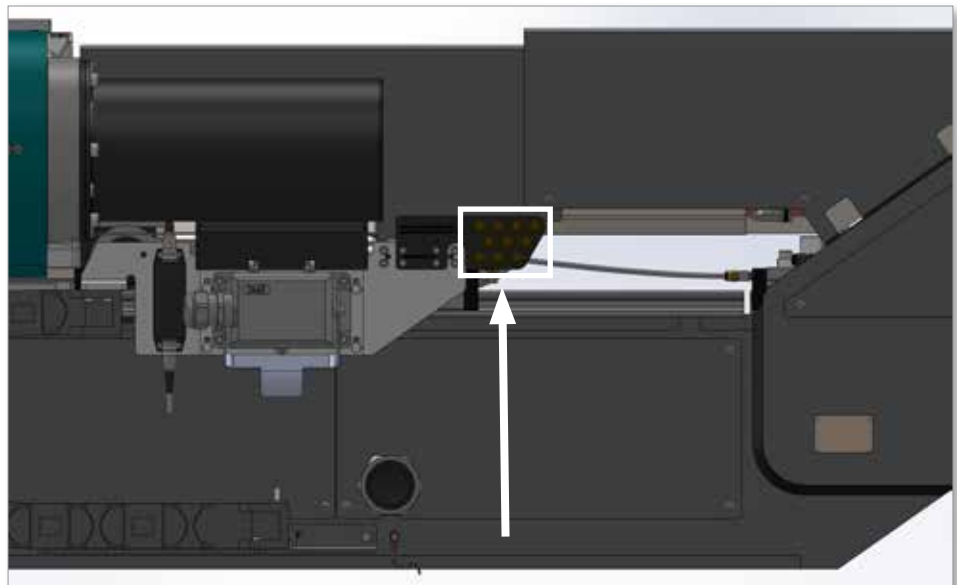


Figure 9-25 Side view of carriage showing localized lubrication points for the servo carriage and linear guides

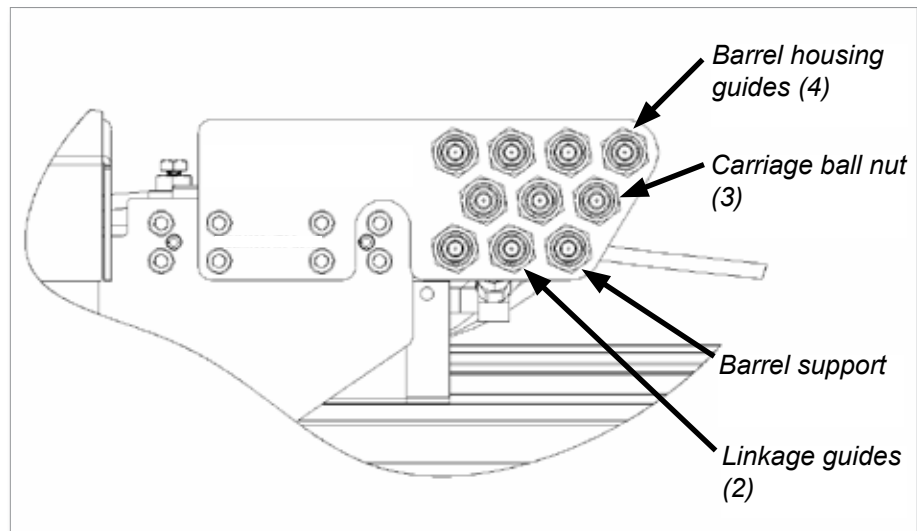


Figure 9-26 Descriptions of the localized lubrication points

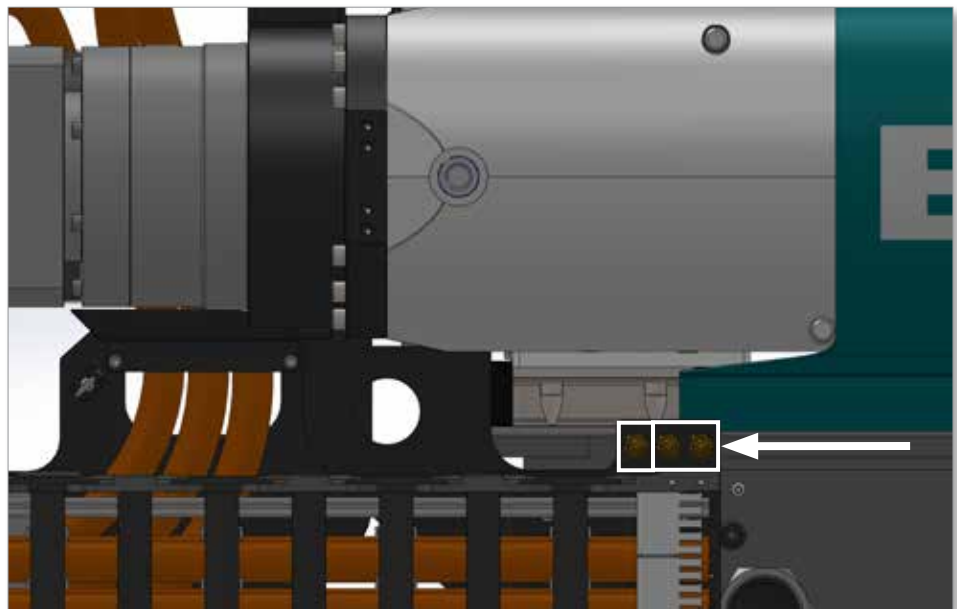


Figure 9-27 Side view of EM5 showing localized lubrication points for servo carriage fixed housing (left) and linear guides (middle and right)

9.4.2 Lubricate the Injection Ball Screws and Linear Guides

See section "9.4.1 Locations of Lubrication Points" on page 9-8 for the locations of the lubrication points of your unit.

See "Table 9-3 Lubrication Volumes of Injection Ball Screws" on page 9-8 for the proper amount of lubrication for your unit.

1. Make sure that the grease fitting is clean.
2. Attach the grease gun to the grease fitting and pump to apply adequate grease for lubrication.

9.4.2.1 Servo Carriage Option

The ball screw nut of the E-Multi servo carriage assembly requires periodic lubrication.

See "Table 9-4 Lubrication Volumes of Carriage Ball Screws" on page 9-3 for the proper amount of lubrication for your unit.

1. Move the carriage back to the rear hardstop.
2. Remove the support beam cover. Unscrew the four button head screws using a 5 mm hex key.
3. Press the E-Stop button on the controller.
4. Make sure that the grease fitting is clean.
5. Use a grease gun to add the specified volume of grease.
6. Reinstall the support beam cover.

9.4.3 Lubricate the Radial-Carriage Ball Screws and Linear Guides



WARNING

Do not put fingers into the lubrication access hole. There is a shearing hazard if the carriage moves and serious injury can occur.

The E-Multi Radial carriage assembly requires periodic lubrication of the ball screw nut. See "Table 9-4 Lubrication Volumes of Carriage Ball Screws" on page 9-3 for lubrication specifications.

The E-Multi Radial has linear guides attaching the upper assembly to the lower assembly and also has additional linear guides supporting the E-Multi barrel housing and injections housings. Lubricate these linear guides according to the maintenance schedule found in "Table 9-1 Preventive Maintenance Schedule" on page 9-1.

9.4.3.1 ER1 and ER2

See section "Figure 9-2 Linear guide lubrication points (2)" on page 9-9 and section "9.4.1.3 ER2" on page 9-13 for the lubrication points of the ER1 and ER2 models.

See "Table 9-4 Lubrication Volumes of Carriage Ball Screws" on page 9-3 for the proper volume of lubrication.

1. Move the carriage to line up the grease fitting with the plug hole to allow access to the grease fitting. This position is approximately 75 mm (3 in.) from the uppermost carriage position.

2. Remove the plug.



3. Move the carriage until the fitting is aligned with the hole.
4. Press the E-Stop button on the controller.
5. Make sure that the grease fitting is clean.
6. Use a grease gun to add the specified volume of grease.
7. Reinstall the plug.

9.4.3.2 ER3 and ER4



WARNING

Do not put fingers into the lubrication access hole. There is a shearing hazard if the carriage moves and serious injury can occur.

See section "9.4.1.6 ER3" on page 9-17 and section "9.4.1.8 ER4" on page 9-20 for the lubrication points of the ER3 and ER4 models.

See "Table 9-4 Lubrication Volumes of Carriage Ball Screws" on page 9-3 for the proper volume of lubrication.

1. Move the carriage to the fully up position.
2. Remove the access cover.
3. Bring the carriage down approximately 50 mm (2 in.) to access the grease fitting for the spring pack assembly.
4. Press the E-Stop button on the controller.
5. Use a grease gun to add the specified volume of grease.
6. Bring the carriage down approximately 130 mm (5 in.) from fully up to access the grease fitting for the ball screw nut.
7. Press the E-Stop button on the controller.
8. Use a grease gun to add the specified volume of grease.
9. Lubricate the four linear guides on the lower assembly.
10. Lubricate the three linear guides on the upper assembly sled.

Section 10 - Maintenance



WARNING

Make sure that you have read "Section 3 - Safety" before doing maintenance procedures on the E-Multi injection unit.

10.1 Preventive Maintenance Schedule

| Table 10-1 Preventive Maintenance Schedule | |
|--|--|
| Preventive Maintenance | Frequency |
| Clean unit, remove spilled plastic pellets and any accumulated drool from nozzle | Start of every shift |
| Check for condensation on external surfaces | Start and end of every shift |
| Controller fan filters | Check monthly, replace if necessary |
| Belt Tension | Check every 6 - 12 months, adjust if necessary |

For information about lubrication preventive maintenance see section "9.1 Preventive Maintenance Schedule" on page 9-1.

10.2 Screw Torques



WARNING

All screws must conform to DIN 912 (socket head cap screws) and ISO 12.9 (grade 12.9) unless noted otherwise. Using low quality screws can result in screw failure and potentially serious injury and will void the warranty.

| Table 10-2 Screw Torque Specifications | | |
|--|-----|-----------------|
| Nominal Thread Size | Nm | ft-lbs (in-lbs) |
| M4 | 4.6 | 3.4 (40.8) |
| M5 | 9.5 | 7 (84) |
| M6 | 16 | 11.5 (138) |
| M8 | 39 | 29 (348) |
| M10 | 58 | 42.5 (510) |
| M12 | 101 | 75 (900) |
| M14 | 161 | 119 (1428) |
| M16 | 248 | 182 (2184) |
| M20 | 488 | 360 (4320) |
| M24 | 825 | 608 (7296) |



NOTE

Screws should be retightened after an initial run of one shift (approximately eight hours). Screws should be retightened again after 1 week of service.

10.3 Other Torques

| Table 10-3 Nozzle Tip and Locking Plate Torques | | | |
|---|---------|-----|-------|
| Description | Model | Nm | lb-ft |
| Nozzle Tip | All | 135 | 99.5 |
| Eccentric Shaft Locking Plate | EM1/EM2 | 9.5 | 7 |
| | EM3 | 29 | 21 |
| | EM4 | 50 | 37 |

| Table 10-4 Feed Block Torques | | | |
|-------------------------------|--------------------|----|-------|
| Description | Model / Screw Size | Nm | lb-ft |
| Feed Block | EM1 / M8 | 23 | 17 |
| | EM2 / M8 | 28 | 20.5 |
| | EM3 / M10 | 50 | 37 |
| | EM4 / M12 | 65 | 48 |

10.4 Belt Tensions

| Table 10-5 Belt Tension Specifications | | |
|--|-----------|-----------|
| Description | Model | Hz |
| Belt Tension | EM1 / EM2 | 216 - 241 |
| | EM3 | 150 - 168 |
| | EM4 | 150 - 168 |



NOTE

Belt tension should be measured with a sonic or laser frequency meter. If a frequency based belt tension meter is not available, an instrument tuner smartphone app may be used.

10.5 Purge Plastic from System



WARNING

Material purged from machine will be extremely hot. Ensure protective guards are in place around the nozzle to prevent molten plastic from splashing. Use proper personal protective equipment.



CAUTION

Leaving a rotating screw unattended may result in serious damage to the screw, barrel and ring check.

1. Retract the carriage from the mold.
2. Switch the barrel heats on and allow them to reach operating temperature.
3. Turn the servo motors on and allow the auto soak routine to complete.
4. Put the controller in Setup mode by pressing the [F1] button. The controller is in Setup mode when the [F1] LED is flashing.
5. Press and release the [F5] button to start screw rotation. The screw will continue to rotate until it is turned off manually.
6. Once no more material flows from the nozzle, press and release the [F5] button again.
7. Move the screw forward by pressing and holding the [F7] button until the screw position is almost at 0.
8. Press and release the [F5] button to start screw rotation. Once no more material runs out of the nozzle, press and release [F5] again.
9. Disable servo motors.
10. Turn off barrel heaters.

10.6 Purge Cooling Water from System



WARNING

Water contacting the hot barrel quickly becomes extremely hot and is a burn hazard. Purge hot plastic from the system and cool the barrel before disconnecting water cooling fittings.

Use compressed air safely.



CAUTION

Do not get water on unpainted surfaces such as ball screws, barrel, feed screw, belt tensioner, etc. as they will rust, causing damage to the machine.

Never run the system without water cooling. Serious damage to the machine will result.

1. Turn off water connections and disconnect supply line at the manifold. Disconnect return line and place in a bucket or other suitable container.
2. Using low pressure (<50 psi) compressed air, blow into the supply line until no more water comes out of the return line.
3. Check transparent cooling lines on machine to ensure no water remains.

10.7 Move the E-Multi Injection Unit for Maintenance

1. Purge plastic from the system.
2. Retract the carriage so that the nozzle tip is on the E-Multi side of the adapter plate.
3. Secure the machine. See "E-Multi Weight Specifications" on page 3-20.
4. Unbolt and separate the E-Multi injection unit from the molding machine.
5. Purge cooling water from the system.
6. Disconnect water, pneumatic, I/O, heater and motor connections from the E-Multi injection unit.
7. Place the E-Multi injection unit, in horizontal position, onto a work bench or machine maintenance stand capable of supporting the full machine load.

10.8 Clean Servo Motor Cooling Lines



CAUTION

Open loop cooling can result in hard water deposits that may clog the narrow cooling channels inside the motors. See "10.8.1 Indications of Cooling Line Contamination" for more information.

Lines that are partially blocked can be cleaned. See "10.8.2 Cleaning Recommendations". If the channels are completely blocked then the motor must be rebuilt or replaced. Contact your service representative.

Mold-Masters recommends using closed loop cooling to keep the cooling channels free of contamination.

10.8.1 Indications of Cooling Line Contamination

The condition of the cooling lines can be seen by inspection. The figure below shows three examples of clear blue 3/8 in. tubing. Calcium deposits make the tubing appear green (or pink in the case of clear red tubing) and opaque.

Consistently high servo motor temperature, at or above the warning or alarm levels default 75°C and 80°C (167°F and 176°F) respectively, may also indicate that cooling lines are contaminated.

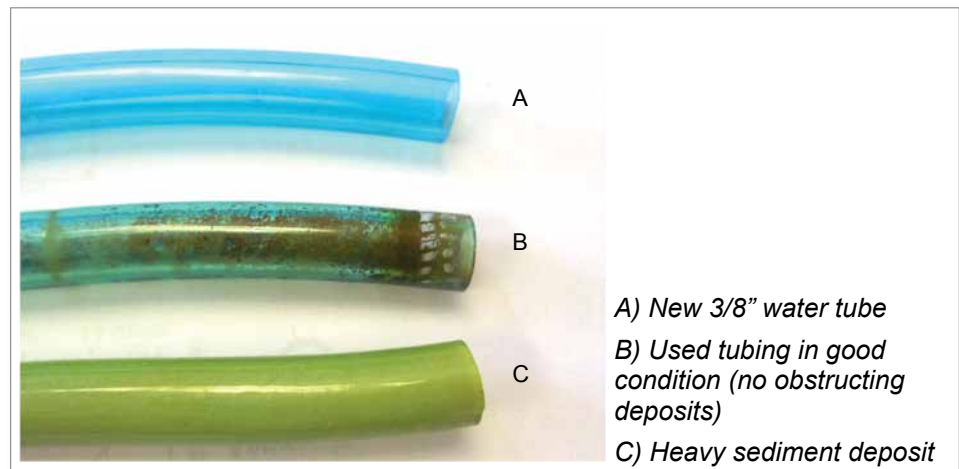


Figure 10-1 Comparison of clean and contaminated cooling lines



10.8.2 Cleaning Recommendations

CAUTION

The motor inlet pressure must not exceed 6 bar.

Do not use cleaning solutions that are aggressive on aluminum, steel, brass, Viton or polyurethane.

- Use a pump capable of 4.5 bar (65 PSI) minimum pressure in a 45 m (147 ft) water head
- Set the flow rate to 3 l/min (0.75 gal/min) minimum
- Use at least 4.5 l (1.19 gal) of 5% acetic acid (white vinegar)
- Circulate the acetic acid through the motors connected in series for at least 24 hours
- Finish with a de-ionized water rinse through the entire system
- Install a closed loop cooling system

10.9 Adapter Plate Removal and Installation



NOTE

Adapter plates are specific for each E-Multi injection unit and mold pair. Adapter plates may not be as shown.


1. Purge the system of plastic and cooling water.
2. Place the E-Multi injection unit, in horizontal position, onto a work bench or machine maintenance stand capable of supporting the full machine load.




NOTE

For servo carriage systems, move the carriage so the nozzle tip is flush with the face of the adapter plate if possible.


3. Remove adapter plate screws and lift adapter plate away. On models with adapter blocks, take care not to drop the blocks. Long screws with the heads removed may be used to support the adapter blocks and adapter plate when removing screws.

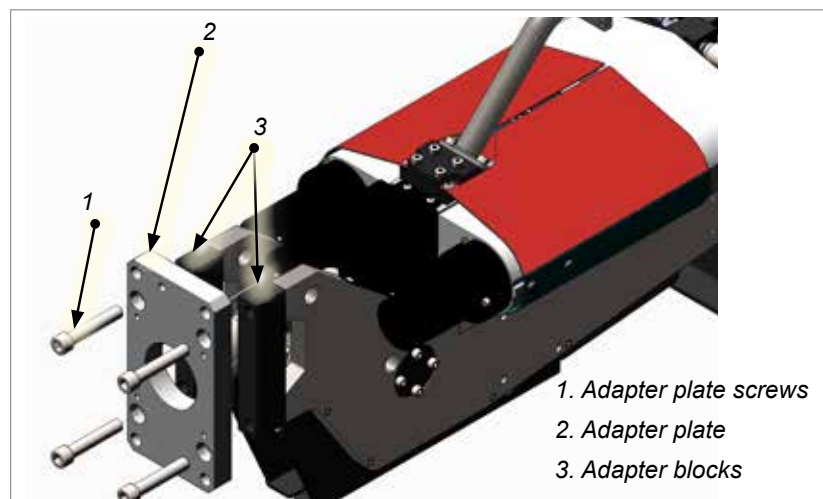


4. Remove replacement adapter plate shipping bracket, if necessary.
5. With solvent, clean the mating surfaces of the replacement adapter plate, adapter blocks (if used) and support beam. Wipe with a clean, lint free cloth.

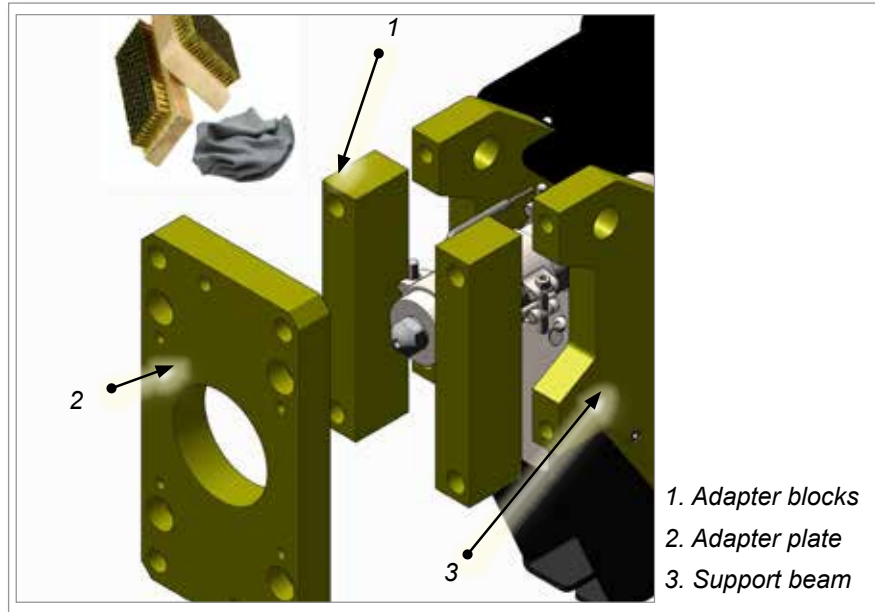


6. Apply a light coat of oil to the contact surfaces.
7. Install the adapter plate and leave the screws loose. If required, install adapter blocks with the adapter plate.
8. Remove the linear actuator manual access port cover to expose the jam screw and adjusting screw.
9. Loosen the jam screw on the carriage link. The adjuster screw can then be turned to move the nozzle so it is flush with the face of the adapter plate.

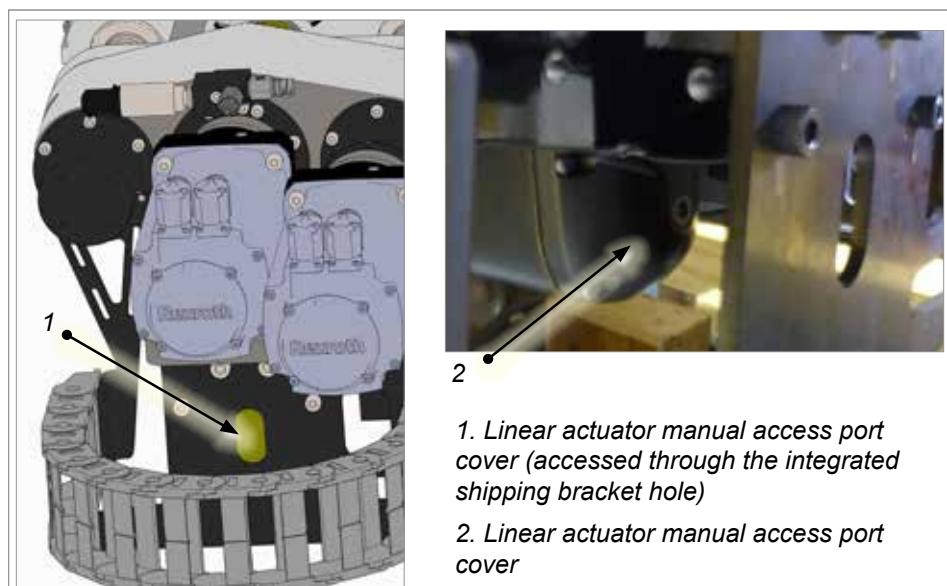

10. Tighten bolts lightly so adapter plate can be moved by tapping with a rubber mallet.
11. Measure the distance from the nozzle to the adapter plate bore at 12, 3, 6 and 9 o'clock and align the plate by tapping so the distance is equal at all positions. Then torque adapter plate screws. See "10.2 Screw Torques" on page 10-1.

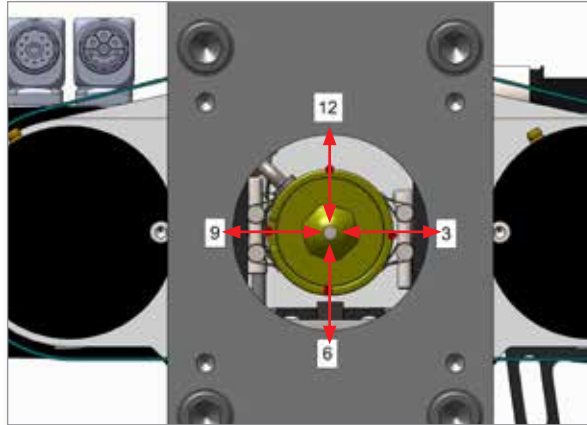

12. Set correct nozzle protrusion for the mold being used. See "Nozzle Protrusion Adjustment - Toggle Link Models" on page 10-8. When protrusion is correct, tighten the clamping screw to the proper torque. See "Table 10-2 Screw Torque Specifications" on page 10-1.

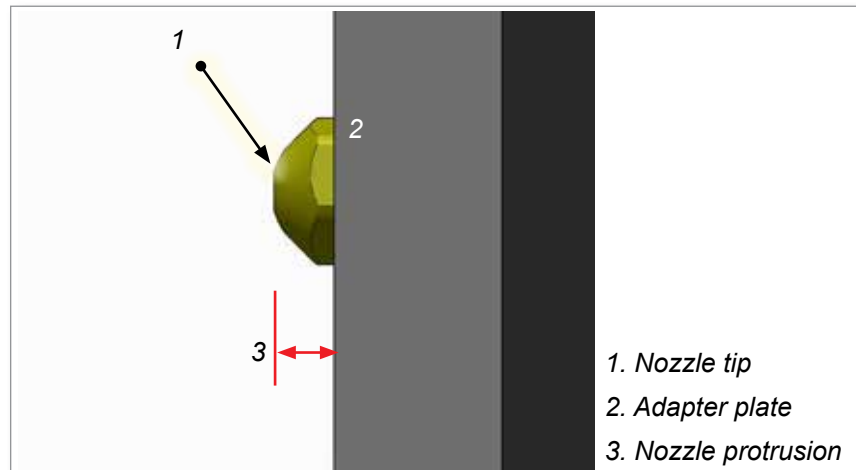

13. Manually retract the nozzle past the adapter plate using the carriage motor manual adjusting screw to allow installation onto the mold.
 14. Replace the linear actuator manual access port cover and hand tighten.
- The E-Multi injection unit is ready to install onto the molding machine.


10.10 Injection Nozzle Replacement



WARNING

The injection nozzle area should be kept clean of debris, dust and plastic.

1. Clean the nozzle and barrel area. Remove any plastic residue, using soft brass tools only.
2. Remove the nozzle tip and clean plastic from the nozzle opening and inner cone.
3. Apply anti-seize compound to the nozzle tip threads and reinstall the nozzle tip. See "Other Torques" on page 10-2.

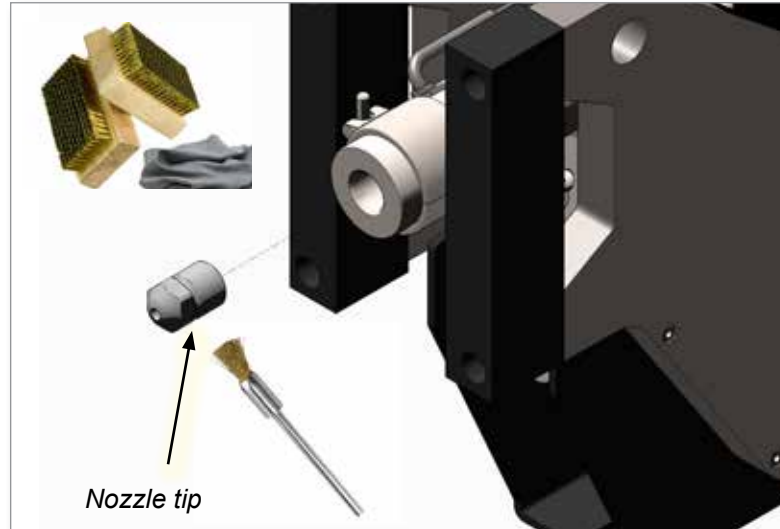

NOTE

Because of variations between nozzles, it is recommended that any time a nozzle is changed, the adapter plate is realigned as described in "10.9 Adapter Plate Removal and Installation".

10.11 Nozzle Protrusion Adjustment - Toggle Link Models

10.11.1 Introduction



WARNING

This procedure must be done with the barrel at operating temperature. Wear appropriate personal protective equipment. Setting the nozzle protrusion when the barrel is cold may cause damage to the carriage linkages. This damage is not covered under warranty.



CAUTION

The nozzle should not touch the mold during installation before the adapter plate bolts are tight. If the nozzle touches the mold during installation damage to the system may occur. This damage is not covered under warranty. Before mounting the E-Multi injection unit, move the carriage back far enough to prevent the nozzle from touching the mold during installation.

**CAUTION**


This procedure only applies to E-Multi units with toggle link carriage adjustment as shown in Figure 10-1.

The nozzle protrusion must be properly adjusted to ensure that the nozzle contacts the mold with the necessary force. An incorrectly adjusted nozzle may leak or cause components in the carriage linkage to fail.

Some installations use spacer blocks to achieve correct nozzle protrusion. On these systems, it will not be possible to set the correct protrusion without these blocks.

It is also necessary to check the manifold inlet (sometimes also called the sprue bushing or backplate) depth to verify that it is within the allowable limits of the E-Multi injection unit. The nozzle protrusion range varies by model and options. The correct protrusion range is specified on the installation drawing and / or General Assembly drawing.

Figure 10-1 Protrusion adjustment parts. EM1 shown, other models are similar.

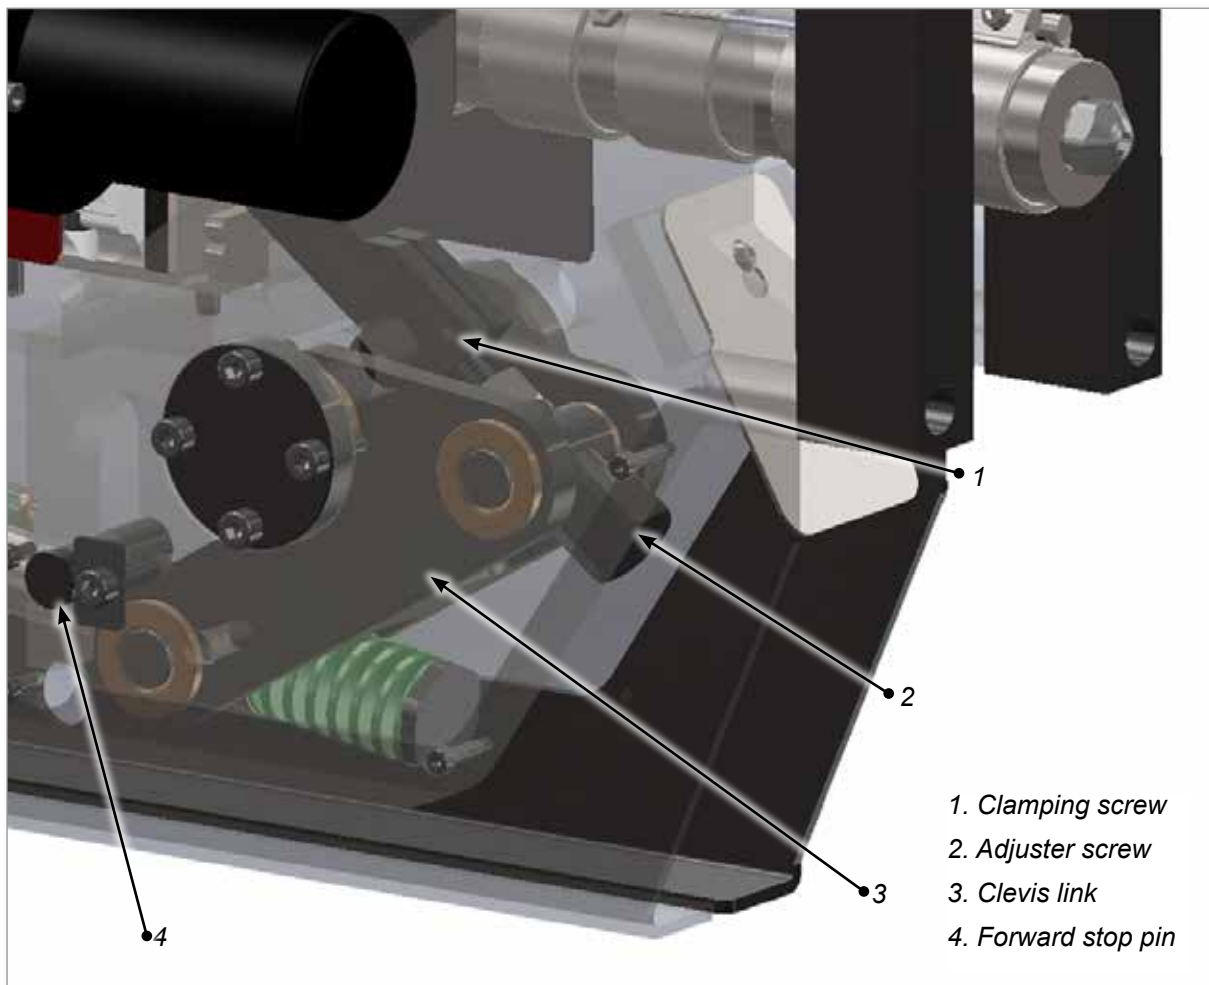
**10.11.2 Adjust the Nozzle Protrusion Manually**

**IMPORTANT**


For an EM3, do not move the nozzle back too far. The adjuster screw may fall out of the linkage. This will not damage the system but it is difficult to reinsert the screw. Visually note the position of the adjuster screw in the linkage.

This procedure is used to correctly adjust the carriage linkage for optimum nozzle contact force.

1. Loosen the carriage adjuster clamping screw.
2. Put the controller in Setup mode.
3. Use the adjuster screw to move the nozzle back as shown below. The nozzle should be screwed far enough back to not touch the mold when moving the carriage forward.

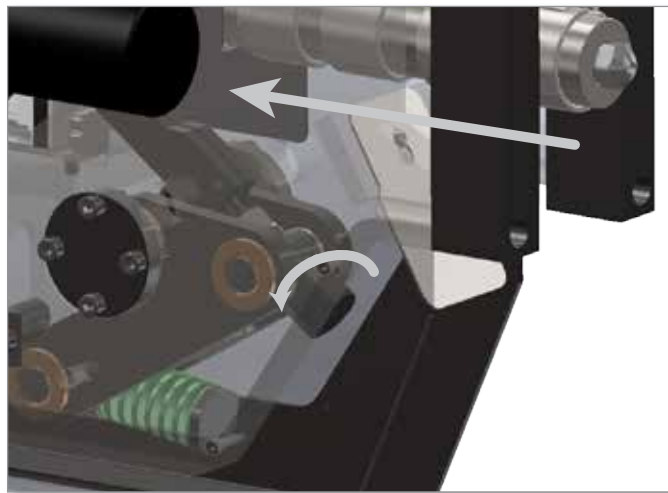


4. Use the **[F4]** button to move the carriage forward until the clevis link touches the stop pin as shown below. On EM1 models with an updated support beam a 10mm window next to the stop pin allows viewing the clevis link. When the window view is filled by the link, it is touching the stop pin. If the nozzle touches the mold before the clevis link touches the stop pin, move the carriage back using the **[F3]** button and return to step 3.

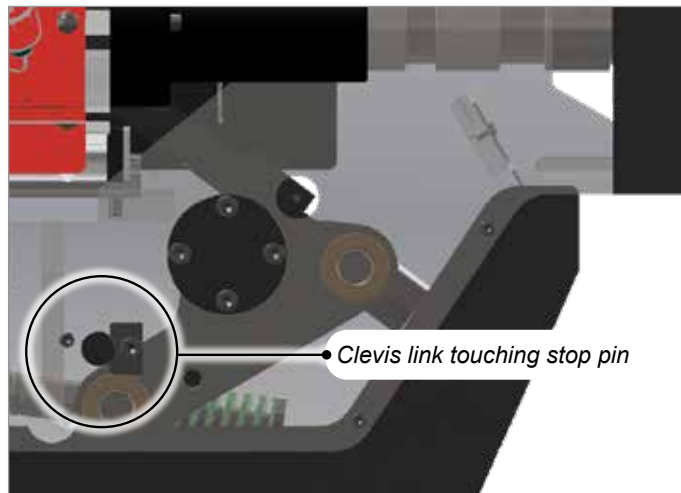

5. With the clevis link touching the stop pin, use the adjuster screw to move

the nozzle forward until it just touches the mold as shown below.

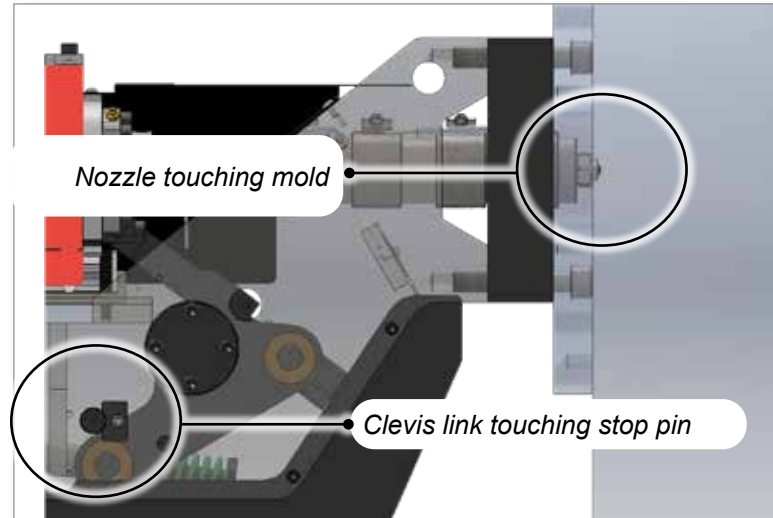

6. Use the [F3] button to move the carriage so there is a 1-3 mm (1/16-1/8 in.) gap between the nozzle and the manifold inlet.
7. Use the adjuster screw to move the nozzle forward until it just touches the manifold inlet as shown in Figure 10-2.



IMPORTANT

Note the gap between the clevis link and the stop pin. The clevis link should be within 0 - 3/16 in. of the stop pin. On EM1 models the clevis link should be visible in the 10mm window but not completely covering it. This is the reference position.

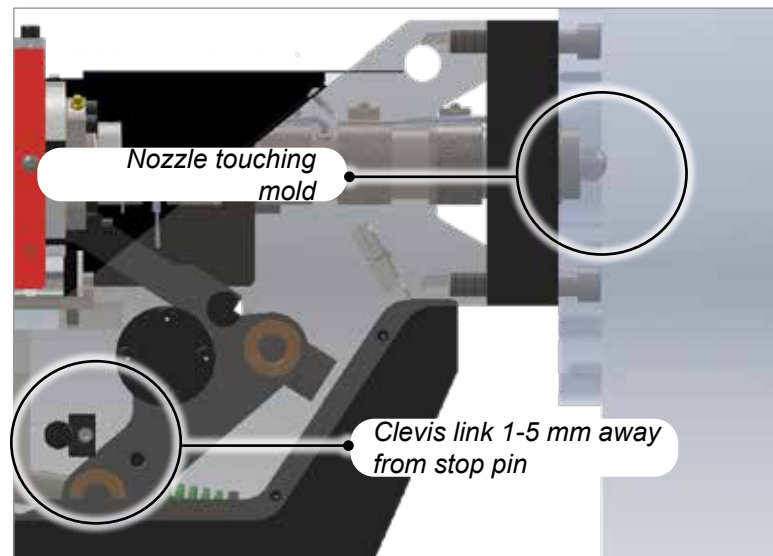


Figure 10-2 Nozzle touching mold

8. Set carriage home position following procedure "10.12 Nozzle Protrusion Adjustment - Automatic Adjustment" on page 10-12.
9. Tighten the clamping screw. Use the controller (i.e. buttons F3 and F4) to move the carriage as required.

10.12 Nozzle Protrusion Adjustment - Automatic Adjustment

10.12.1 Calibrate the Carriage Home Position



WARNING

This procedure requires visual inspection of the machine while it is moving. Wear eye protection.

The first time the E-Multi injection unit is installed, and any time it is transferred to a new machine with a different mold, the carriage home position and contact force must be set.




IMPORTANT

For proper calibration, ensure the nozzle protrusion is set correctly. See "Nozzle Protrusion Adjustment - Toggle Link Models" on page 10-8 before setting the home position.

10.12.2 Calibrate Manually

1. Put the E-Multi injection unit into Setup mode.
2. Navigate to the Reference Settings page. See the E-Multi Controller User Manual for more information.
3. Move the carriage forward until the nozzle is just touching the manifold inlet. This is the reference position as described in 10.11 on page 10-8.
4. Choose Set.

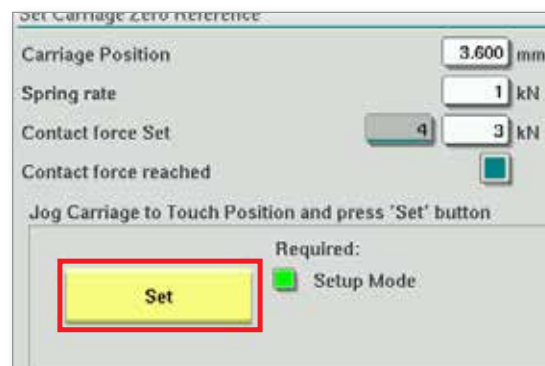

5. Press the [F4] button on the controller to increase nozzle contact force. Continue pressing until the motor stops moving and the "Contact force Set" display field stops increasing. At this point, the value in the display field is the maximum contact force that can be generated with the current setup.
6. Use the "Contact force Set" entry field (the field to the right) to set the desired nozzle contact force. A typical setting is 25-50% of the maximum observed in the previous step.
7. Put the controller in Manual mode.
8. Use the [F3] button to move the nozzle away from the mold until there is a gap.
9. Press and hold the [F4] button to move the nozzle towards the mold until it stops. Verify that the contact force is equal to or slightly greater than the set point chosen in step 6.

10.12.3 Automatic Calibration

1. Put the controller in Setup mode.
2. Make sure barrel heaters are at operating temperature.
3. Touch the **[Start]** button.

If the nozzle is adjusted correctly, the routine will complete and the nozzle tip position graphic will show the nozzle tip in the green region.

If the nozzle is not adjusted correctly, the carriage will move to a preset position and tell the operator to adjust the nozzle using the manual adjuster screw. Once the adjustment is made, press the Start button again to run the calibration routine again.

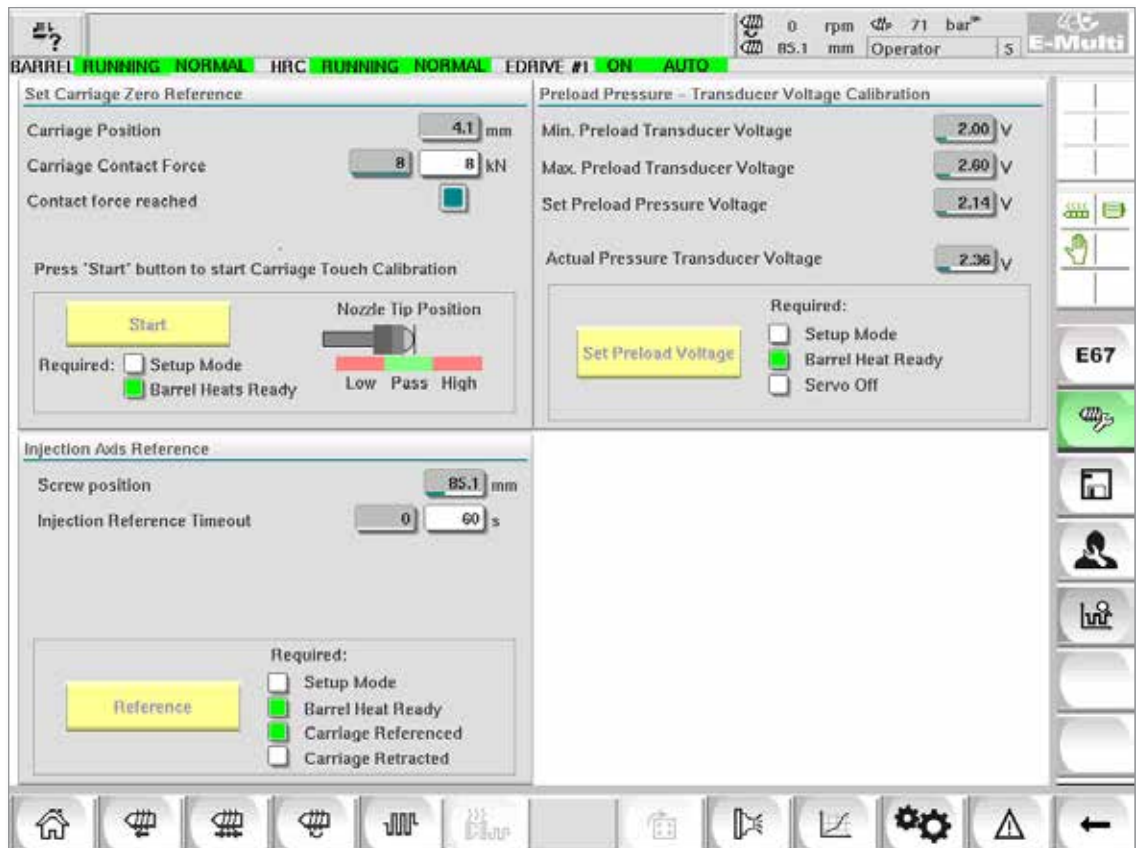


Figure 10-2 Automatic calibration

10.13 Injection Axis Referencing



CAUTION

The injection referencing routine verifies the injection stroke by moving the screw fully back and then fully forward.

Referencing will fail if the screw cannot achieve the full stroke.

1. Controller must be in Setup mode with heats on and up to operating temperature, carriage referenced and carriage retracted from the mold.
2. Navigate to the screw settings page.
3. In the lower left-hand area, tap the [**Reference**] button.
4. Confirm the dialog box that appears.
5. Wait for the screw to move fully back and then fully forward. Referencing is complete when the screw position is just below 0.

10.14 Bolt Type Shutoff Nozzle Maintenance



WARNING

This procedure is done in the hot condition. Wear appropriate personal protective equipment such as heat resistant gloves and goggles or a face shield. Failure to do so can result in serious injury.

Failure to lower the shutoff heater temperature setpoint to ambient temperature before removing the heater band will result in heater damage and may result in injury.

Compressed air will cause the molten plastic to splash. Wear appropriate protective clothing.



CAUTION

If the E-Multi injection unit is installed in the horizontal orientation, the well surrounding the shut off nozzle bolt will accumulate plastic material. The material must be regularly cleaned out or the bolt may not function properly or it may seize. In a vertical orientation, any excess plastic material will drain out and regular cleaning is not needed.


1. Open the shut off valve using the controller software.
 - a) Navigate to the Valve Gate screen by tapping the valve gate button.



- b) Navigate to the Shut Off Nozzle screen by tapping the shut off nozzle button.



- c) Open the shut off nozzle by tapping the Always Open button. For this button to be enabled the three indicator lights must be on.

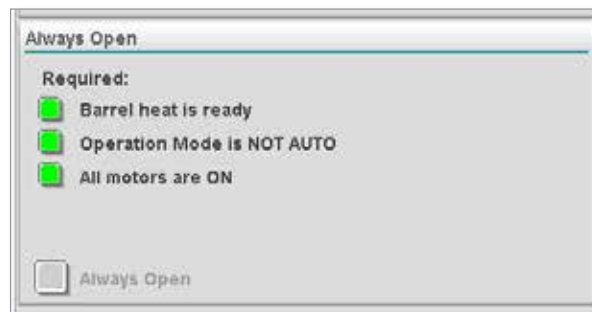

2. If possible, remove the heater band from the nozzle to allow better access to the shut off bolt.

**NOTE**

This procedure can be done without removing the heater band.

3. Use a small pick to remove the residual plastic from the well surrounding the pin. Compressed air can be used to blow the plastic from the bolt.

**NOTE**

If the bolt is seized completely a heat gun may be used to help soften the residual plastic.

4. If necessary, replace the heater band.
5. Close the shut off valve using the controller software.

10.15 Barrel Head Removal and Replacement



WARNING

This procedure is done in the hot condition. Wear appropriate personal protective equipment such as heat resistant gloves and goggles or a face shield. Failure to do so can result in serious injury.



NOTE

The procedure applies to EM3 and EM4 units only.

The barrel head must be removed to change the barrel, the screw or the check-ring. If the entire screw and barrel assembly is being changed, barrel head removal is not necessary.

1. Remove the bolts from the perimeter of the barrel head.
2. Remove the barrel head. The barrel head should be easily removed in the hot condition. It is not necessary to remove the nozzle tip from the barrel head to remove the barrel head.
3. Perform maintenance to the barrel, screw or check-ring as required.
4. Clean the faces of the barrel head and the barrel. Check the barrel head mating surface on the barrel head and barrel for any plastic residue, nicks or scratches. A damaged sealing surface will result in leaks.



5. Apply anti-seize compound to the bolts of the barrel head.
6. Mount the barrel head to the barrel and torque the bolts in a cross-wise pattern.
 - EM3 units - torque the M10 bolts to 58 Nm (42 ft-lbs)
 - EM4 units - torque the M12 bolts to 101 Nm (75 ft-lbs)

10.16 Heater Replacement



WARNING



Contact with the barrel can cause severe burns. Exercise caution and wear appropriate PPE when working on or around a hot barrel.





CAUTION

Do not overtighten thermocouple sockets. It is extremely difficult to remove seized sockets.

1. Move the carriage to the fully back position.
2. Remove the front and rear guards. Remove the outer barrel cover and the inner barrel cover.

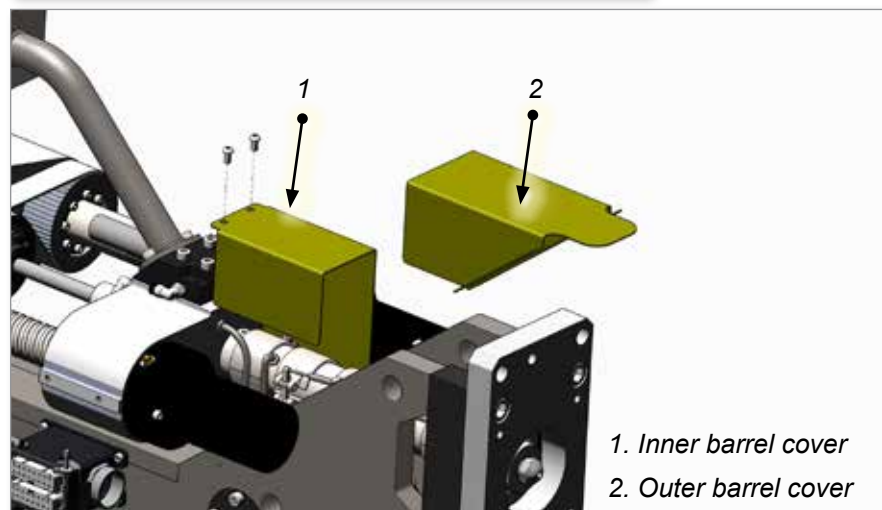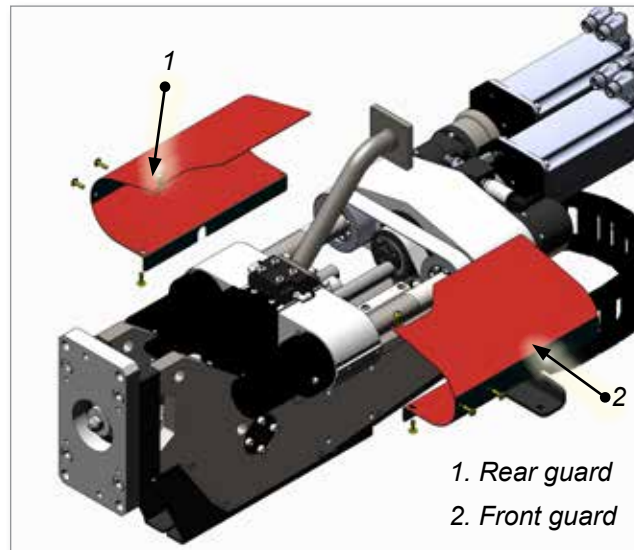


3. Number all heaters and thermocouples and note orientation of connectors and wires. Heaters and thermocouples are numbered starting with #1 at the housing end of the barrel.

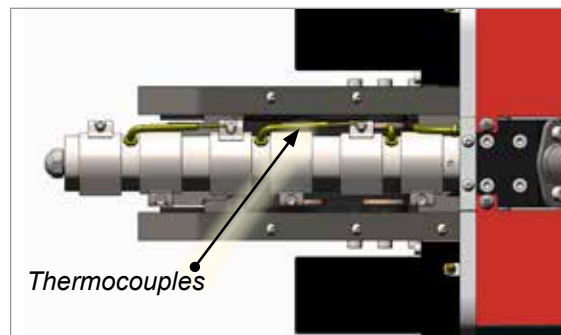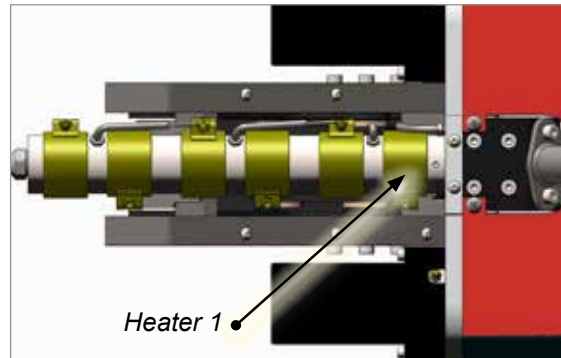

4. Remove any plastic residue and clean the end of the barrel.
5. Remove any wire ties.
6. Remove the heater connector insert from the connector base.
7. Unscrew the heater wires from the insert.
8. Loosen the lock nut on the strain relief.
9. Pull the heater cable out of the connector base.
10. Remove the connector base.
11. Loosen the heater clamping screw(s).
12. For socket type thermocouples:
 - a) Remove the thermocouples from their mountings
 - b) Remove the thermocouple sockets from barrel
13. For nozzle type thermocouples:
 - a) Remove the thermocouple from their mountings

14. Slide the heater(s) off end of barrel. Remove heaters before failed heater as well.

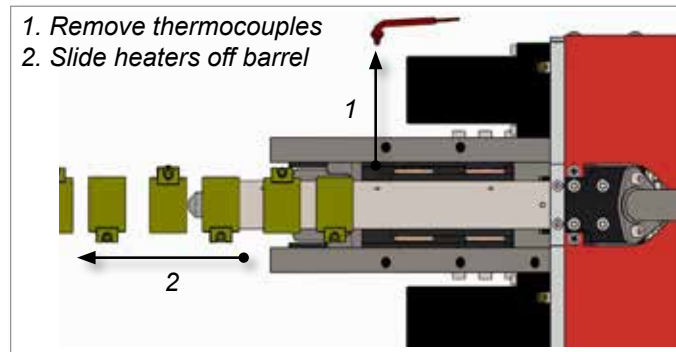

15. Using the old heater as a template, cut new heater wires to the same length. Cut the braided shield back from the wire 50 mm (2 in.). Strip the insulation off the heater wires to 10 mm (0.4 in.). Install ferrules using ferrule crimper.
16. Label new heater cable with same number as replaced heater.
17. Install heaters in reverse order of removal. Barrel will have alignment markings that show correct heater locations. Tighten clamping screws on heaters.



NOTE

Take care that heater cables are not twisted when installing heaters.

18. For socket type thermocouples:
 - a) Apply anti-seize compound to thermocouple sockets and install
 - b) Tighten to finger tight plus 1/8 turn more
 - c) Install thermocouples into sockets




NOTE

Thermocouples should be tight in sockets, if thermocouples are not tight, move nut on thermocouple housing so that thermocouple is tight when attached to socket.

19. For nozzle type thermocouples:
 - a) Apply anti-seize compound to the thread
 - b) Thread the thermocouple onto the base
 - c) Tighten to finger tight plus 1/8 turn more
20. Reconnect ground strap and torque to 16 Nm (12 ft-lbs).
21. Install new wire ties if required.

22. Feed the new heater cables through the strain relief on the connector base.

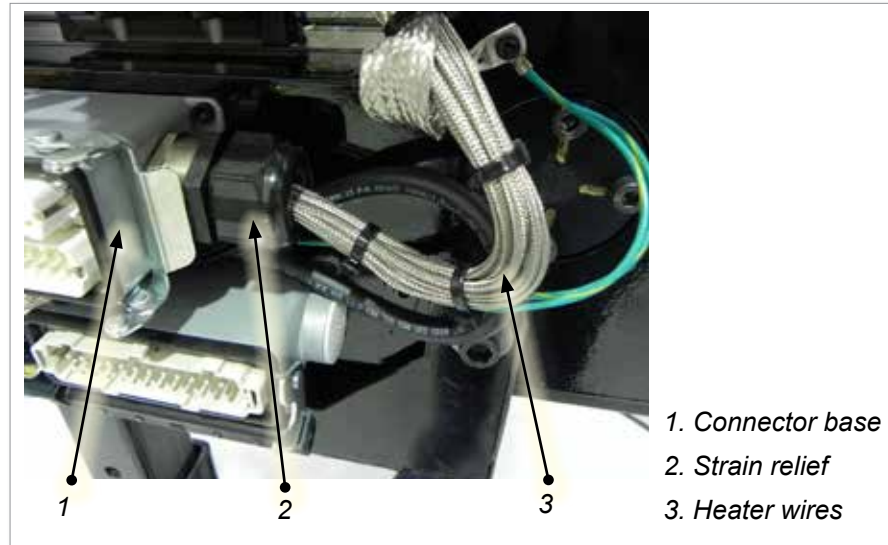

23. Reinstall the connector base onto the support beam.
24. Install new wire ties.
25. Tighten the lock nut on the strain relief.
26. Insert the heater wires into the terminals on the connector insert and tighten.
27. Reinstall the connector insert.
28. Test heater resistance using a multimeter on the connector insert pins.
29. Reinstall the barrel cover(s).


NOTE

Ensure that there is no interference with heater and thermocouple wires.

10.17 Feed Assembly Removal and Replacement


It is recommended that the barrel be purged before the assembly is changed. See "Purge Plastic from System" on page 10-3.

If the barrel cannot be purged and the machine is oriented vertically, it is recommended that a container be placed underneath the feed tube to feed block connection to catch the remaining pellets from the feed tube.

If the machine is oriented horizontally, it is recommended that pellets be removed using a vacuum cleaner to prevent pellets from spilling onto the machine.


10.17.1 Remove Feed Assembly

1. Purge cooling water from E-Multi injection unit, see "Purge Cooling Water from System" on page 10-3.
2. Remove front and rear guards.

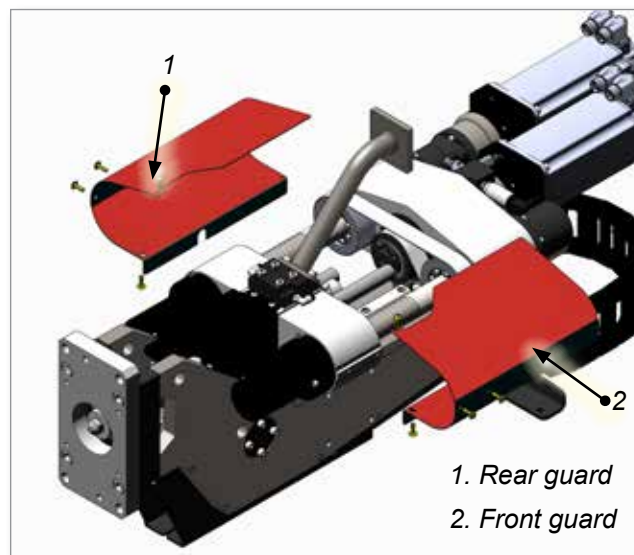


3. Disconnect any connections to the feed system.
4. For horizontal installations, remove the feed hopper from the feed block and then go to step 8.
5. Disconnect and remove the feed hopper from the feed tube.

6. Remove screws attaching feed tube to feed block and lift the feed tube away and remove the feed tube. If a vibrator is used, disconnect air supply from the vibrator.

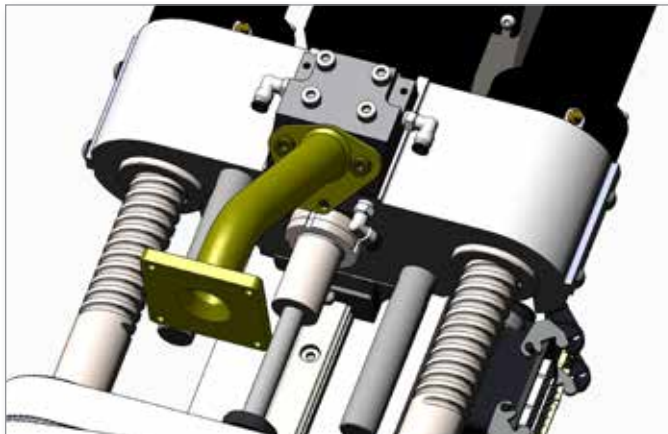

7. If pellets are not purged from the unit, use a vacuum cleaner to remove pellets from feed block and barrel.
8. Disconnect the cooling lines.
9. Remove the feed block from the system.

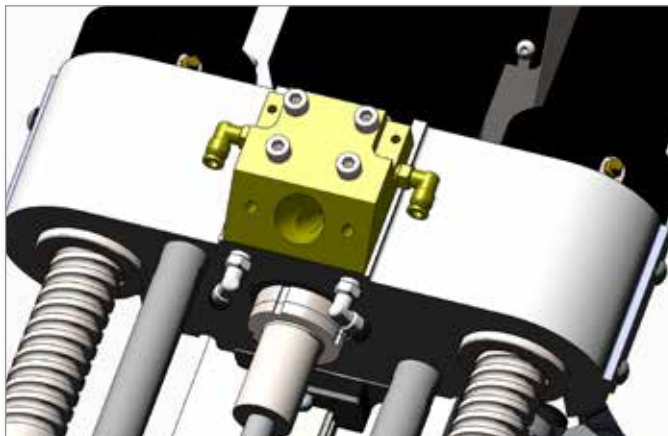

10. Check the feed block and barrel mating surfaces and clean if necessary. Remove any remaining pellets from barrel.




10.17.2 Install the Feed Block

CAUTION


Tightening the screws incorrectly can result in uneven clamping of the barrel and may cause damage to the machine.

Do not reuse purged pellets. Damage to the E-Multi injection unit from contaminated pellets is not covered under warranty.

1. Install the feed block into barrel housing.
2. Apply a light coat of synthetic grease to the screws, install and finger tighten.

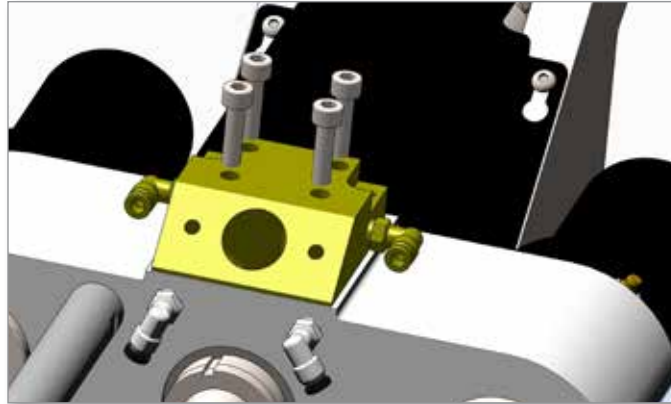

3. In a cross pattern, torque the screws in steps, ensuring that the gap for the entire contact surface remains uniform as the screws are tightened. See Table 10-2 for torque specifications.

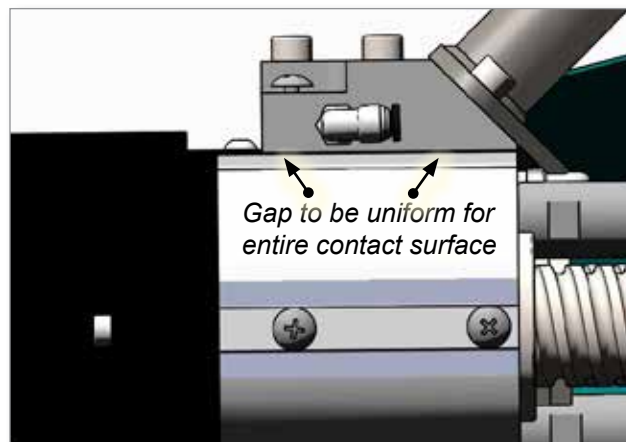

4. Connect the water cooling lines.
5. Reinstall the vibrator and torque. See Table 10-2 for torque specifications.
6. For vertical installations, reinstall feed tube and torque screws.
7. Reinstall the feed hopper.
8. Reconnect the feed connections and water cooling hoses.
9. Replace the guards.

10.18 Feed Screw Cleaning and Replacement


10.18.1 Prepare for Feed Screw Removal




WARNING

This procedure is done in the hot condition. Wear appropriate personal protective equipment such as heat resistant gloves and goggles or a face shield. Failure to do so can result in serious injury.

1. Move the machine to a work surface. See "Move the E-Multi Injection Unit for Maintenance" on page 10-4.
2. Remove front and rear guards.

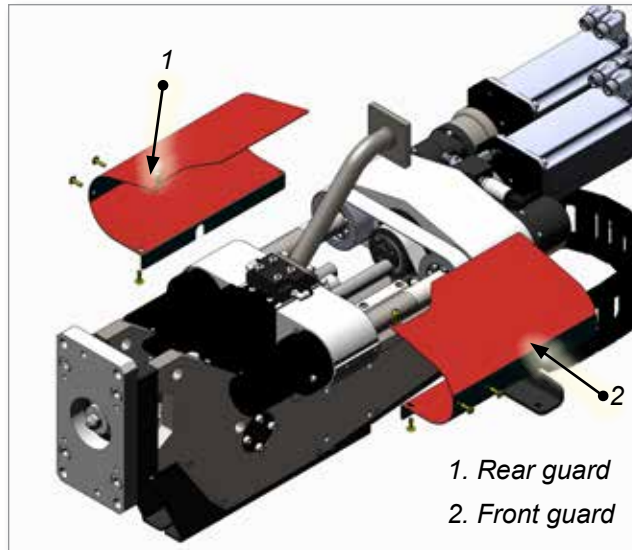

3. Clean the nozzle and barrel area. Remove any plastic residue, using soft brass tools only.
4. Remove the nozzle tip and clean plastic from the nozzle opening and inner cone.

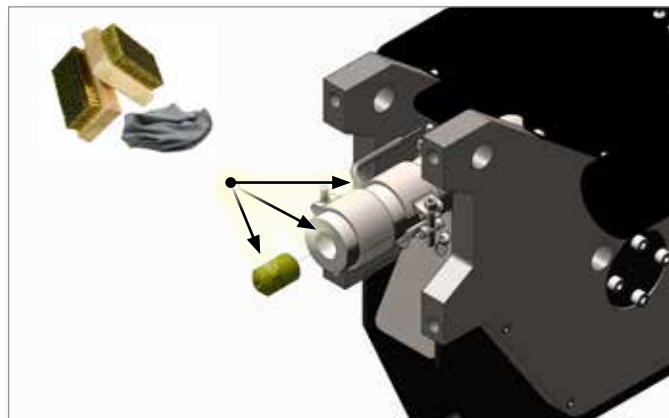

10.18.2 Remove the Feed Screw




NOTE


Step 1 is different for EM1 / EM2 units and for EM3 / EM4 units. Refer to the correct step 1 for your system. The remaining steps are the same for all units.

EM1 / EM2 Units


1. Release the feed screw from the drive shaft.
 - a) With the drive power on, unscrew the collet securing the feed screw to the feed drive shaft.

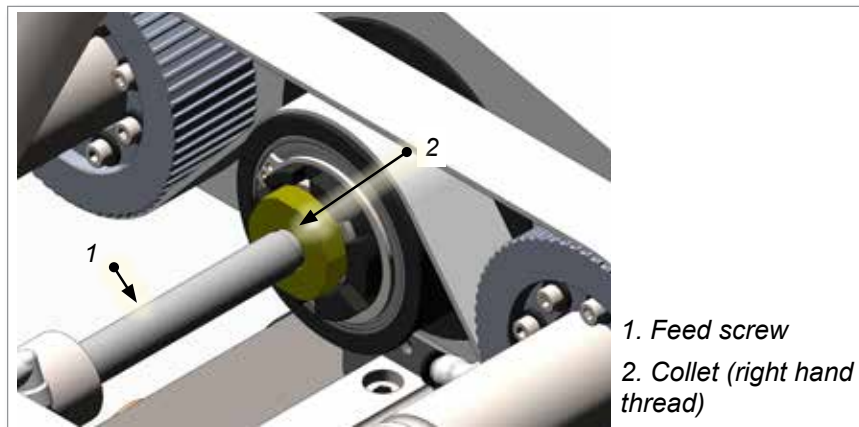

- b) Push the feed screw, the collet and the retaining nut out of the feed drive shaft toward the barrel.

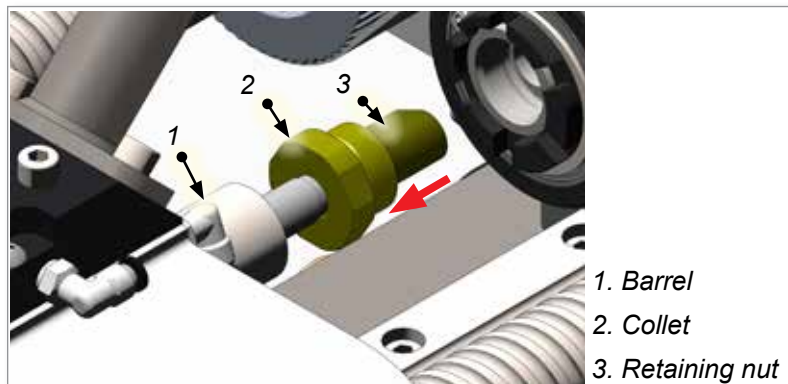

- c) Remove the retaining nut from the screw. The nut is left-hand thread.

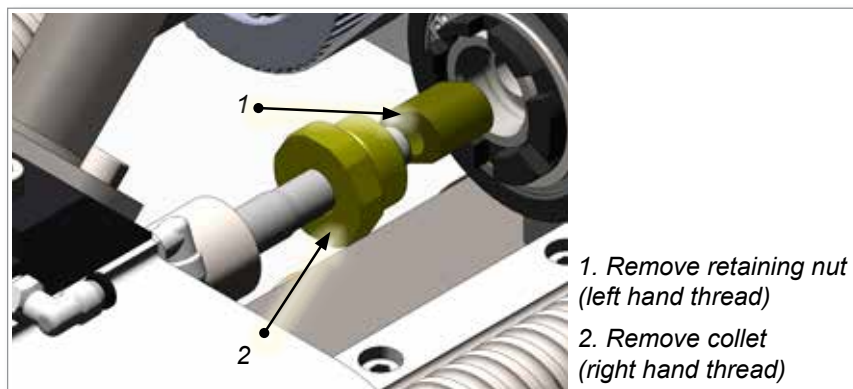


EM3 / EM4 Units

1. Release the feed screw from the drive shaft.
 - a) Remove screws securing screw collar to feed drive shaft.




- b) Push the screw towards the barrel until the bolt securing the screw-retaining bushing is accessible.
 - c) Remove the bolt, the screw-retaining bushing and the screw collar.

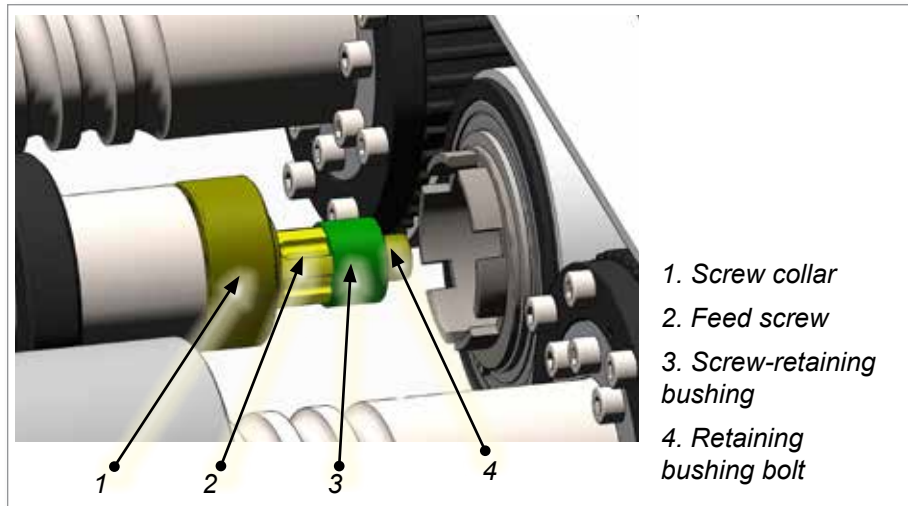

All Units


2. Push the feed screw towards the barrel as far as possible.

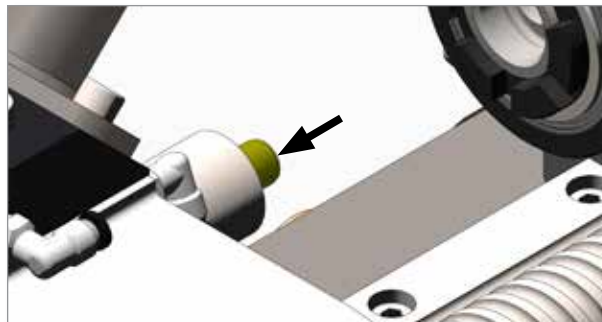

3. Pull the feed screw out through the nozzle end of barrel.


10.18.3 Cleaning

4. Use a brass bristled brush to clean plastic from the feed screw.

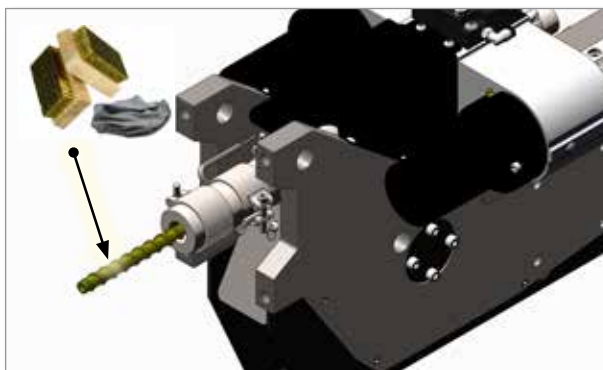

10.18.4 Install the Feed Screw

1. Insert the feed screw into barrel.

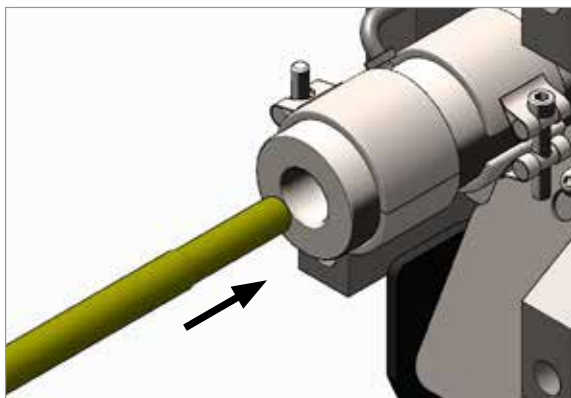


NOTE

Step 2 is different for EM1 / EM2 units and for EM3 / EM4 units. Refer to the correct step 2 for your system. The remaining steps are the same for all units.


EM1 / EM2 Units

2. Secure the feed screw to the drive shaft.
 - a) Apply anti-seize compound to screw threads and screw nut outer surface.
 - b) Install the collet onto the screw end.

- c) Install the retaining nut onto the screw end so that the end of the screw is protruding 1-2 mm (0.04-0.08 in.) from the surface of the nut.

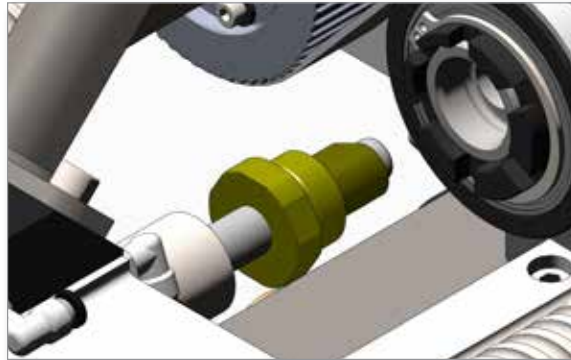


- d) Apply anti-seize compound. Tighten the collet securing the feed screw to drive.

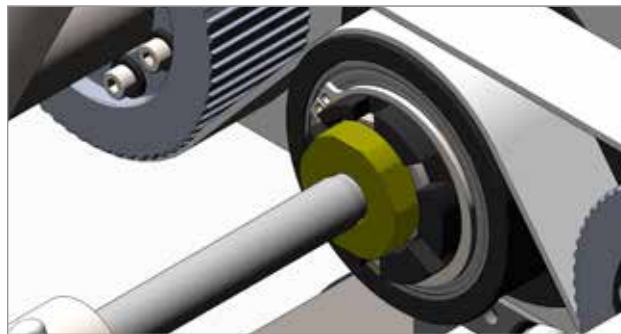

EM3 / EM4 Units

- a) Insert the feed screw into the barrel. Once the end protrudes past the barrel end far enough to install the screw collar, install the splined ring.
- b) Install the screw collar, retaining bushing and bolt. Torque to 58 Nm (43 ft-lbs).
- c) Push the feed screw into the feed drive hub.

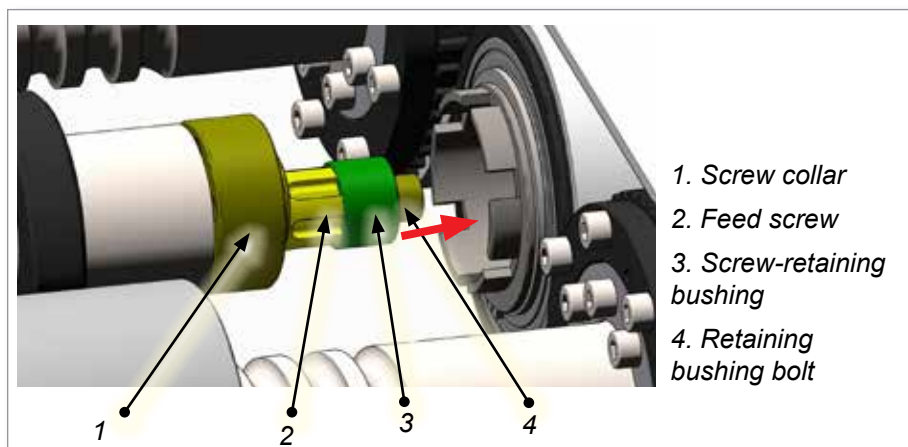

- d) In a cross pattern, torque the collar screws in steps, ensuring that the gap between the contact surfaces remains constant as the screws are tightened. See "Table 10-2 Screw Torque Specifications" on page 10-1 for torque specifications.



All Units

3. Reinstall the front and rear guards. Ensure the gap between the guards and the injection housing is the same all around the housing. Also make sure there is no interference with heater and thermocouple wires.

10.19 Barrel Removal and Installation



WARNING

Contact with the barrel can cause severe burns. Exercise caution and wear appropriate PPE when working on or around a hot barrel.



CAUTION

Thermocouple connections on the barrel are easily damaged. Do not allow the weight of the barrel to rest on the thermocouples.





IMPORTANT

This procedure assumes the replacement barrel is clean and the feed screw can be moved by hand. This is required so that the screw can be reattached to the injection housing without having to move the housings.

If the screw is to be separated from the barrel, follow instructions to remove the screw first. See "Feed Screw Cleaning and Replacement" on page 10-4.


10.19.1 Remove the Barrel Assembly

1. Move the machine to a work surface. See "Move the E-Multi Injection Unit for Maintenance" on page 10-4.
2. Remove front and rear guards. Remove barrel cover and inner barrel cover.

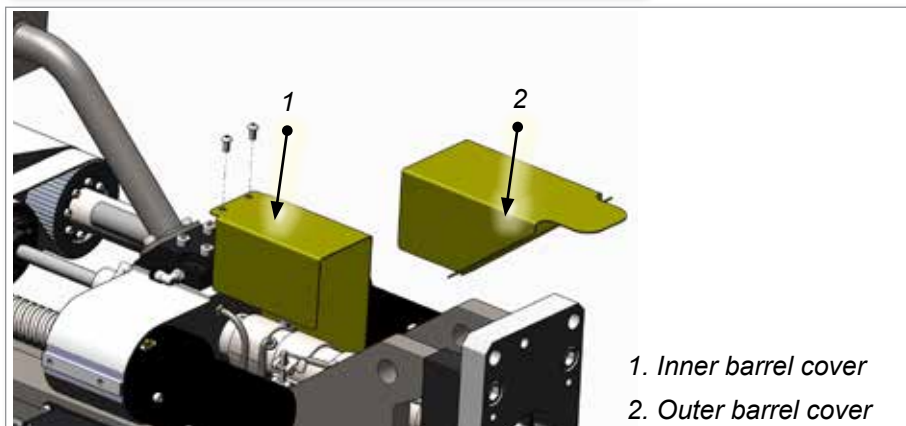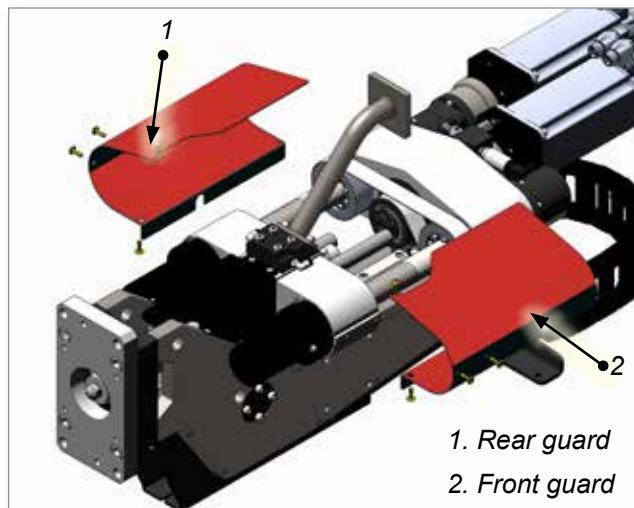


Remove the Barrel Assembly - continued


3. Remove the feed block. See "Feed Assembly Removal and Replacement" on page 10-22.
4. Remove the feed screw. See "Feed Screw Cleaning and Replacement" on page 10-25.
5. Remove the large barrel nuts securing the barrel to the barrel housing.

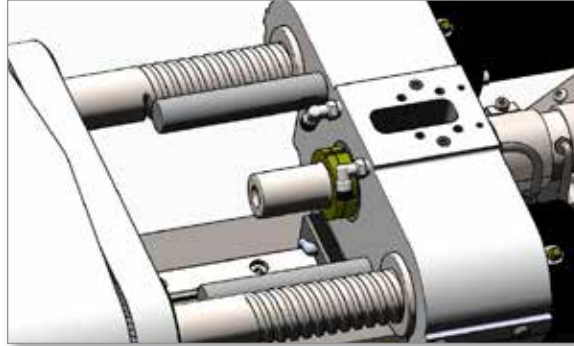


6. Remove the ground wire screw and wire ties required to remove the heater and the thermocouple cables from the support beam.

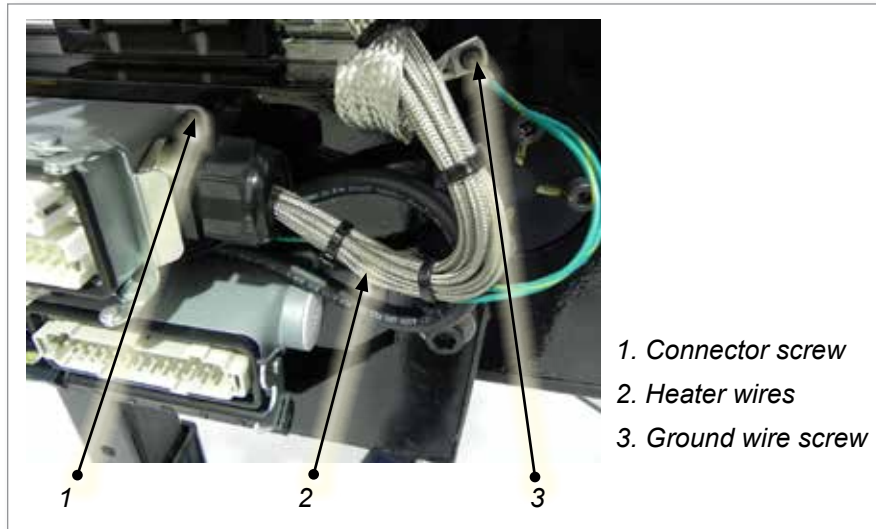


7. Remove the heater connector from the support beam.

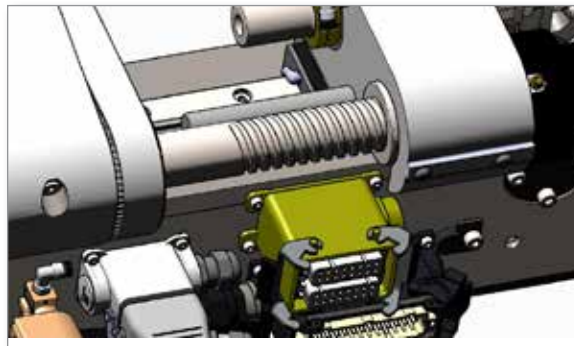

8. Disconnect the barrel housing thermocouple.

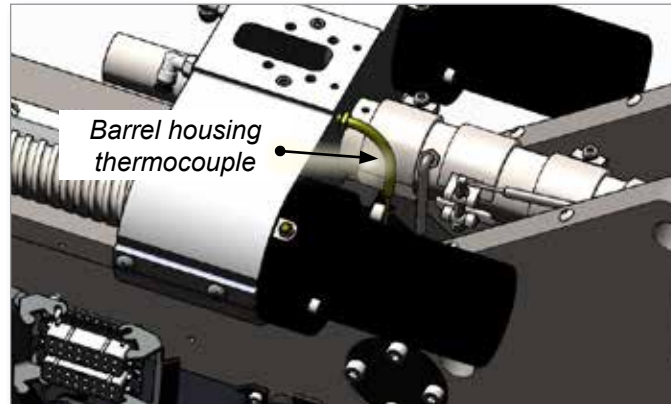

9. Slide the barrel out of the barrel housing.

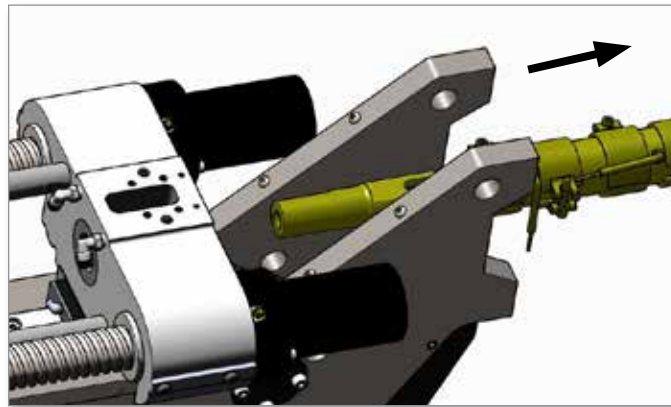


10.19.2 Transfer Heaters and Thermocouples to a New Barrel


See "Heater Replacement" on page 10-18.

10.19.3 Install the Barrel Assembly


1. Apply anti-seize compound to load surfaces and thread. Lift the barrel into position and slide it into the barrel housing with the flat face facing up.

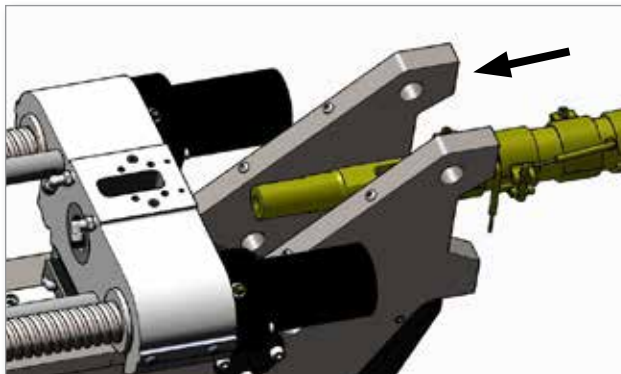

2. Install the large barrel nuts onto the end of the barrel and tighten finger tight.

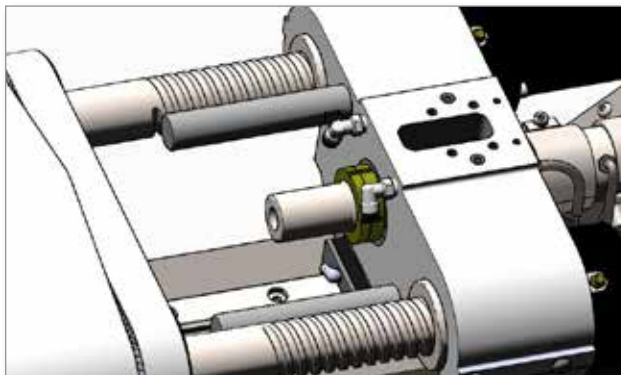


3. Install the feed block onto the barrel housing. See "Install the Feed Block" on page 10-24.

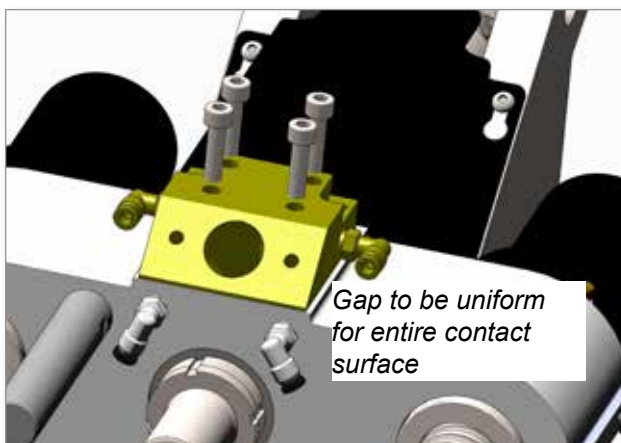


4. Tighten the barrel nut.

Install the Barrel Assembly - continued

5. In a cross pattern, reinstall the heater connector screws. See "Screw Torques" on page 10-1.

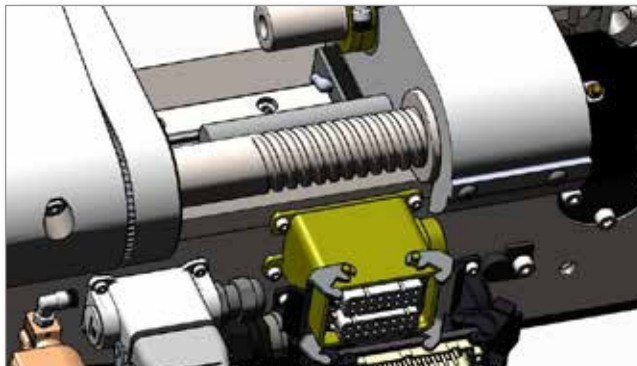

6. Secure the feed screw to the drive shaft. See "Feed Screw Cleaning and Replacement" on page 10-25.

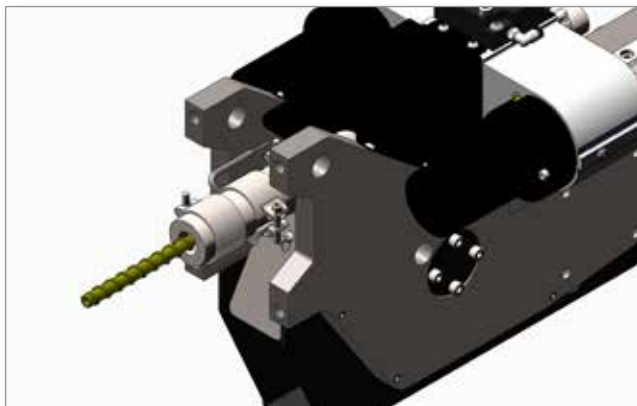

7. Reinstall the front and rear guards. Make sure the gap between the guards and the injection housing is the same all around the housing. Also make sure there is no interference with heater and thermocouple wires.


10.20 Belt Tension Adjustment




WARNING

Lockout / tagout machine before performing a belt tension adjustment.

1. Remove front and rear guards.

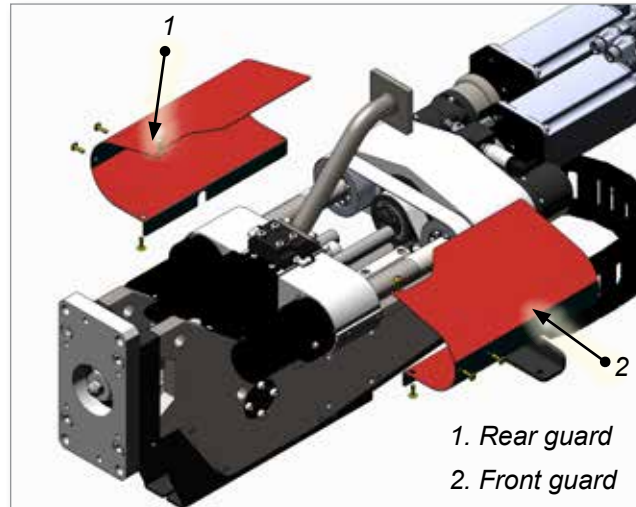

2. Loosen, but do not remove, the screws securing the eccentric shaft locking plate.

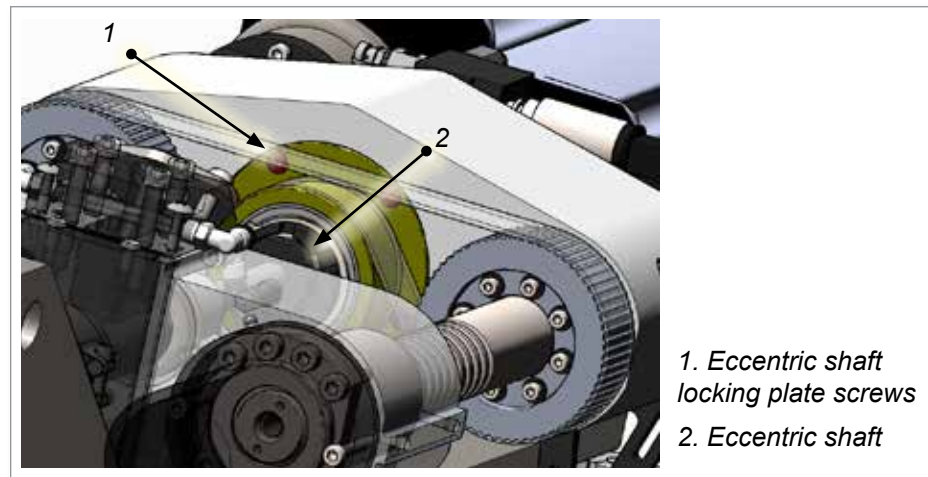

3. Rotate the eccentric shaft until correct belt tension is achieved. See "Belt Tensions" on page 10-2.
4. In a cross-pattern, tighten the eccentric shaft locking plate screws and torque. See "Screw Torques" on page 10-1.
5. Check belt tension again to ensure it is within specification. Repeat steps 2 to 4 if necessary.
6. Reinstall the front and rear guards. Make sure the gap between the guards and the injection housing is the same all around the housing. Also make sure there is no interference with heater and thermocouple wires.

10.21 Belt Removal and Installation



CAUTION

Do not rotate the ball screws with the belt removed, otherwise realignment will be necessary.

EM1 / EM2 Models:


1. Purge plastic from the machine. See "Purge Plastic from System" on page 10-3.
2. Move the injection housing to the fully back position.
3. Remove front and rear guards.
4. With the drive power on, loosen the feed screw from the drive shaft. See "Remove the Feed Screw" on page 10-26.
5. Turn off the drive power, but keep the heaters on.
6. Disconnect the feed screw and push as far as possible into the barrel.
7. Turn the controller off.
8. Purge the water lines. See "Purge Cooling Water from System" on page 10-3.
9. Remove the screws securing the eccentric shaft locking plate.
10. Rotate the eccentric shaft to release the tension on the belt.
11. Slide belt forward on the pulleys but do not remove.
12. Mark pulleys relative to the housing.
13. Remove the belt from the pulleys. Take care that the pulleys do not change orientation relative to one another.



NOTE

For the EM1 model, it is easier to slide the idler pulley off with the belt.


14. Disconnect the motor connectors, transducer cable and water lines.

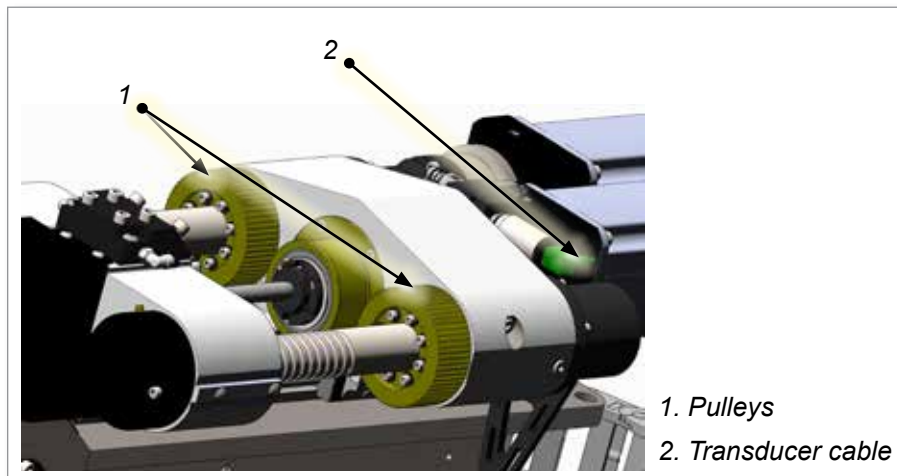

1. Pulleys
2. Transducer cable

Belt Removal and Installation - continued

15. Remove the screws securing the cable track bracket to the shaft cover on the injection housing.

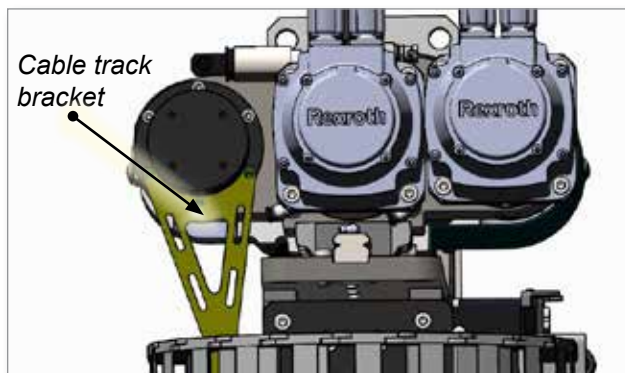

16. Unfold the cable track.
17. Position the new belt as shown below.



18. Mark the position of the linear guide relative to the injection housing. See Figure 10-3.

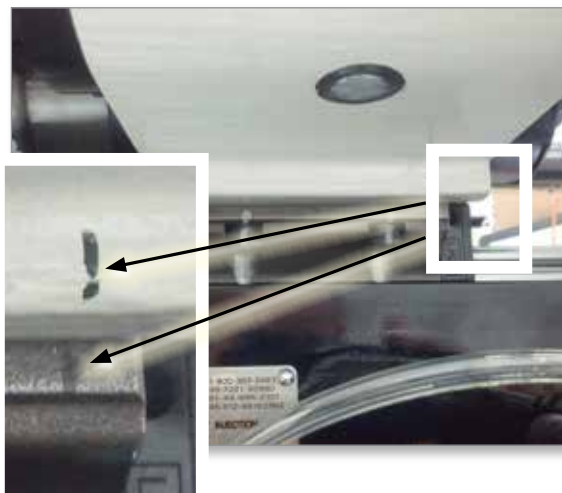


Figure 10-3 Linear guide position

19. Loosen the linear guide screws.


Belt Removal and Installation - continued

20. Slide the linear guide out from under the injection housing (you may need to lift the motor slightly to release tension on the guide).

**NOTE**

For EM1 models, slide the guide towards the motors. For other models, slide the guide towards the barrel.

21. Move the old belt over the injection housing, all the way to the barrel housing and remove it.
22. Clean the pulleys and the idler surface with solvent and a clean cloth.
23. Move the new belt over the injection housing and pulleys.
24. Move the linear guide back into place using marks. Torque the linear guide screws. See "Screw Torques" on page 10-1.

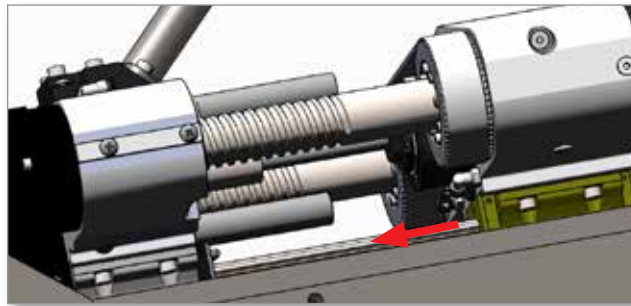

25. Reinstall the cable track bracket. Torque the screws in a cross pattern, see "Table 10-2 Screw Torque Specifications" on page 10-1.
26. Reconnect the transducer cable and the water lines.
27. Reconnect the motor connectors. See "Route and Connect Servo Cables" on page 7-1.
28. Install the belt over the idler and the toothed pulleys. Take care that the pulleys do not change orientation relative to one another.
29. Slide the belt onto the pulleys.

**NOTE**

For EM1 models it is easier to slide the belt on with the idler pulley.

30. Verify that the belt is centred on the idler pulley.
31. Adjust the belt to the correct tension. See "Belt Tension Adjustment" on page 10-36.
32. Move the pulleys back and forth to check for proper movement of the belt.
33. Reconnect the feed screw. See "Feed Screw Cleaning and Replacement" on page 10-25.
34. Reinstall the front and rear guards. Ensure the gap between the guards and the injection housing is the same all around the housing. Also make sure there is no interference with heater and thermocouple wires.

10.22 Servicing and Repairing your Controller

Refer E-Multi Controller User Manual for servicing, repair and software updates.

Section 11 - Component Tests and System Alarms



WARNING

Ensure that you have fully read "Section 3 - Safety" before performing any of the tests in this section.

The user is responsible to ensure protection against shock by indirect contact, by protective earth conductors and automatic disconnection of supply. Mold-Masters components and systems are either equipped with a protective earth conductor or there is a connector for this purpose.

11.1 Thermocouple Electrical Test

The controller system has functionality to monitor thermocouple performance. A working thermocouple will show a realistic temperature based on the environment it is in. Defective thermocouples will read -100°C (-148°F) on the controller.

- If a thermocouple shows as defective, test the thermocouple at the support beam or hot runner connector.
- Thermocouples should show output similar to those in the same area. If the output is significantly different, replace the thermocouple.
- If the new thermocouple shows -100°C (-148°F) there is probably a wiring problem. Check the wiring and connections.

11.2 Heater Continuity Test



WARNING

This procedure requires access to the heater connector. Power down the machine before disconnecting heater cable.

Testing of the heaters is done with a multimeter set to measure resistance. The heaters are wired to the connector in pairs according to the wiring schematic.

- Check the resistance across the pins. The multimeter should show around 48 ohms for a 1000 W heater and 96 ohms for a 500 W heater.
- A reading of 0 ohms indicates a shorted heater and a reading of infinity indicates an open heater.

11.3 Transducer Output Alarm

Transducer function is checked automatically every cycle. If the transducer is defective, an alarm will be shown on the controller.

11.4 Vibrator Valve Test

The vibrator runs on every cycle when the feed screw is turning. If the vibrator is not moving, first check the air pressure to the vibrator.

1. Close the air needle valve and disconnect the air line from the supply side of the valve.
2. Open the needle valve slowly and check for air pressure on the supply line.
 - If there is no pressure, check the pneumatic connection to the machine.
 - If there is pressure, close the valve, reconnect the air line to the valve and open the valve.

Then check the mechanical function.

1. Disconnect the air supply tube from the solenoid valve on the support beam and apply compressed air to the tube.
 - If the vibrator is working properly, it should start to vibrate when compressed air is applied.
2. If the vibrator is working, reconnect the air line to the valve and disconnect the valve cable. Apply 24 VDC to pin 1 and 0 VDC to pin 2.
 - The valve should open and the vibrator should start to vibrate.
 - If the valve does not move, replace the valve with a known good one.

11.5 Control System Alarms

The control system has several features, which provide an early diagnosis of faults in the control system.

- If the system detects any malfunctions, it displays an **error** message on the Alarm screen.
- If the system detects any abnormal condition it displays a **warning** message on the Alarm screen.

See E-Multi Controller User Manual for details.

11.6 Servo Motor Temperature Alarms

The motor warning and alarm temperatures are factory settings that can only be changed by a Mold-Masters technician. The default values are:

- warning temperature: 75°C (167°F)
- alarm temperature: 80°C (176°F)

The E-Multi controller automatically disables the motors when the alarm temperature is reached. The motor temperature can be monitored in real time on the E-Multi controller.

For more information about motor temperature alarms, please refer to the E-Multi Controller User Manual.

















| State | Time | Class | Description |
|--|--------------------|---|--|
|  | 5/29/14 7:56:02 PM |  | Inject B Motor Temperature is within alarm limits. Servos will be shut off. Check motor. |
|  | 5/29/14 7:47:34 PM |  | Drive Injection not referenced |
|  | 5/29/14 7:47:24 PM |  | Carriage not referenced. Carriage must be referenced before turning Servo On. |
|  | 5/29/14 7:47:24 PM |  | Emergency stop 1 pressed |
|  | 5/29/14 7:47:23 PM |  | Servo motor off |
|  | 5/29/14 7:47:23 PM |  | Hot Runner is not up to Temperature. Check Hot Runner Settings. |
|  | 5/29/14 7:47:23 PM |  | Gate is Opened! Close Gate to operate EMulti. |
|  | 5/29/14 7:47:23 PM |  | EMulti Emergency Stop is Pressed! |
| Inject B Motor Temperature is within alarm limits. Servos will be shut off. Check motor. | | | |
| Confirm | Confirm all | Alarm history | Help |

Figure 11-1 Motor temperature alarm - Alarms screen on E-Multi controller

Section 12 - Radial Option



WARNING

Ensure you have fully read "Section 3 - Safety" before unpacking, assembling or installing the E-Multi Radial Option.

12.1 Introduction

This section provides information that is special to the E-Multi Radial machine-mounted solution for E-Multi injection units.

The E-Multi Radial is designed to be mounted to the top of the stationary platen of an injection molding machine, where it can conveniently swing out of the way of the mold mounting face. This speeds up mold changes, as there is no need to remove the E-Multi injection unit when changing a mold. An additional benefit is that the full weight of the E-Multi injection unit is supported by the injection molding machine, rather than the mold.

The E-Multi Radial has a servo controlled carriage axis which allows the system to be operated in sprue-break mode or in continuous nozzle contact mode.

In sprue break mode, the nozzle retracts and extends with each injection cycle, as required for parting line injection application.

12.2 Specifications

| Table 12-1 E-Multi Radial Specifications | | | | | | | |
|--|-------------------------------------|-------------------------------------|--------------------------|---|----------------------|-------------------------------|--------------------------------|
| E-Multi Model | Typical Clamp Size | Vertical (Carriage) Stroke (z-axis) | Mold Face Reach (x-axis) | Rotation (Injection Molding Machine Center) | Nozzle Contact Force | Sprue Break (Carriage Stroke) | Sprue Break (Average Velocity) |
| ER1-15 ER1-30 | 100 - 450 ton | 0 - 415 mm | 50 - 350 mm | -120° CCW +120° CW | 10 kN | ≤ 50 mm | 50 mm/sec |
| ER2-50 ER2-80 | 90 - 400 tonne | | | | 17 kN | | |
| ER3-100 ER3-200 | 300-2000 ton 275 - 1800 tonnes | 0 - 825 mm | 60 - 500 mm | | 40 kN | | |
| ER4-350 ER4-550 | 400 - 4000 ton 365 - 3600 tonnes | | 70 - 500 mm | | | | |

12.3 Components

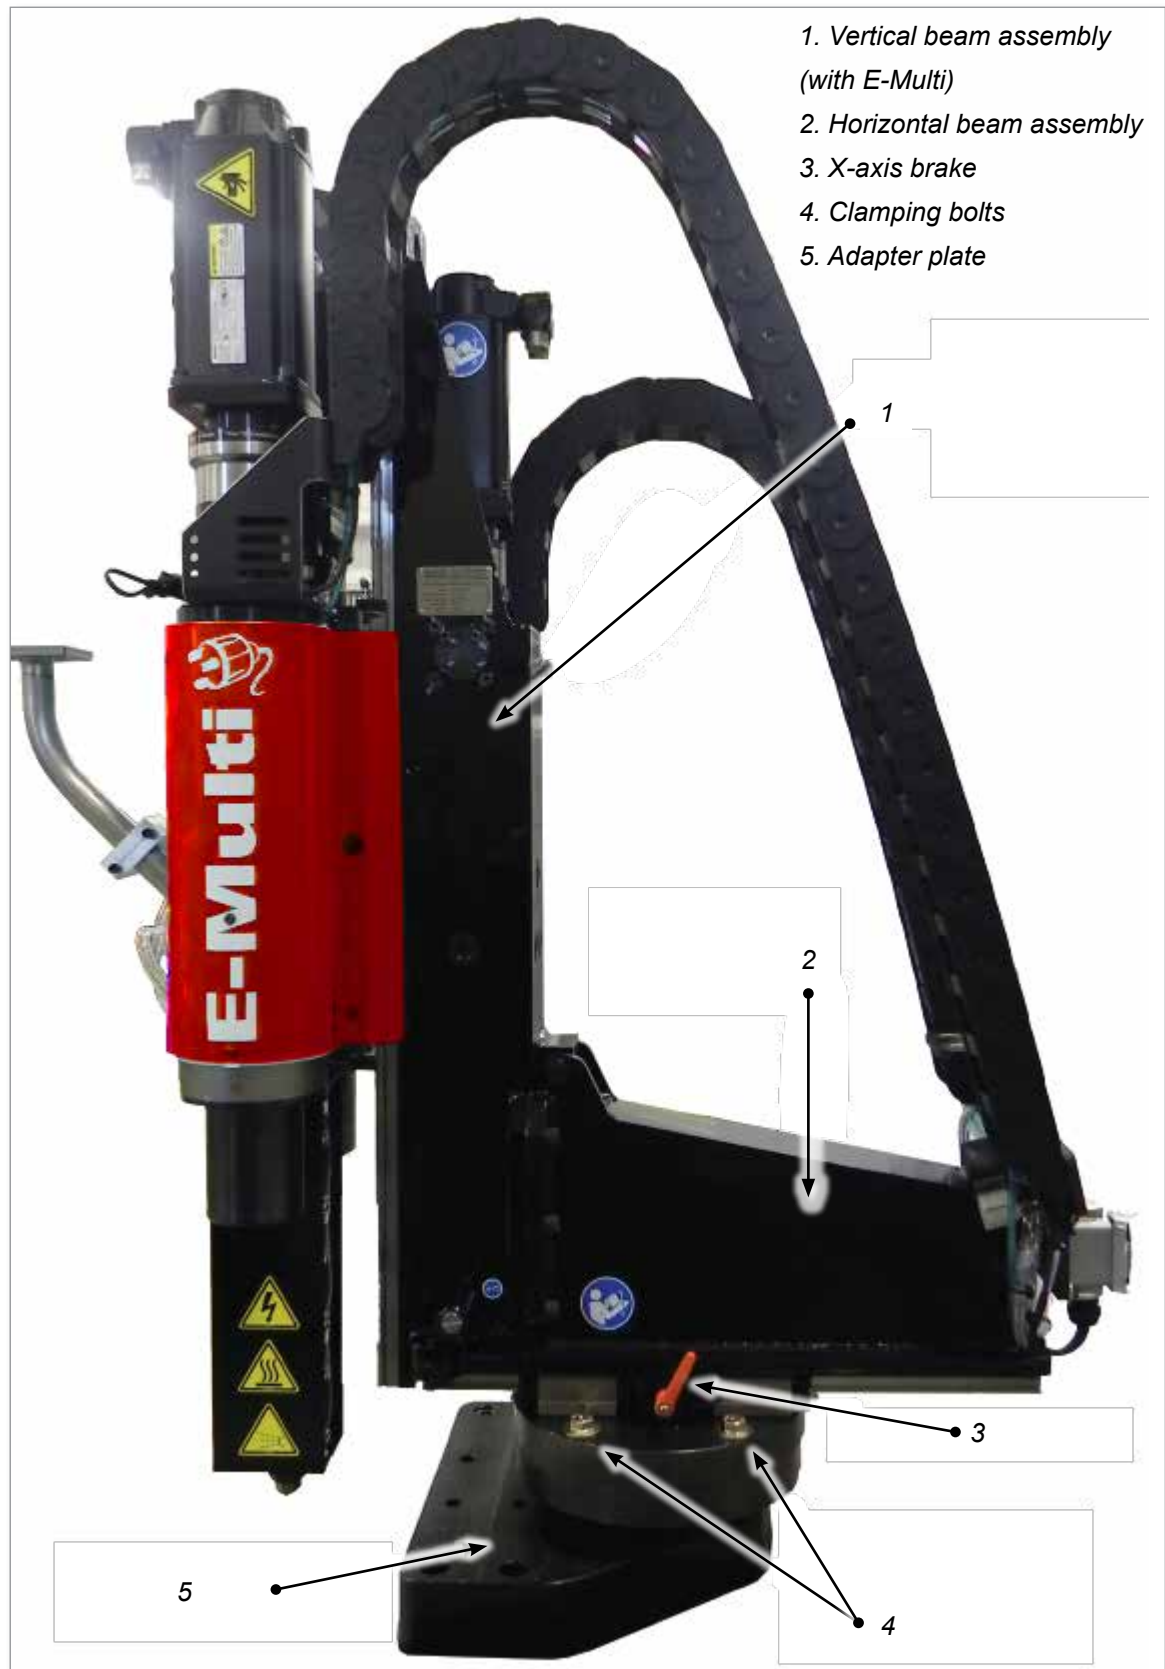


Figure 12-1 Main components of the E-Multi Radial

12.4 Unpacking



WARNING

When doing any work that requires lifting the machine, connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death. See "E-Multi Weight Specifications" on page 3-20 for weight, dimensions and safe lifting instructions.

The crate should be moved using a forklift or pallet truck. If using a crane, the crate must be slung from underneath. Never lift from the top of the crate.

1. Remove the lid and the plastic wrap as necessary.
2. Inspect the unit prior to removing any of the crate walls or bracing. See "12.5 Inspection" on page 12-4.
3. Attach the slings to the unit as shown in Figure 12-2, Figure 12-3 and Figure 12-4. Use the slings provided in the crate. Note the approximate point of the center of gravity.
4. Raise the lifting machine just enough to reduce the slack in the slings. Ensure that the lifting point is positioned above the center of gravity and the unit will not swing when lifted.
5. Remove the remaining crate sides and bracing, leaving the crate floor and all floor bracing around the adapter plate.
6. Remove the accessory boxes and anything other than the E-Multi Radial.

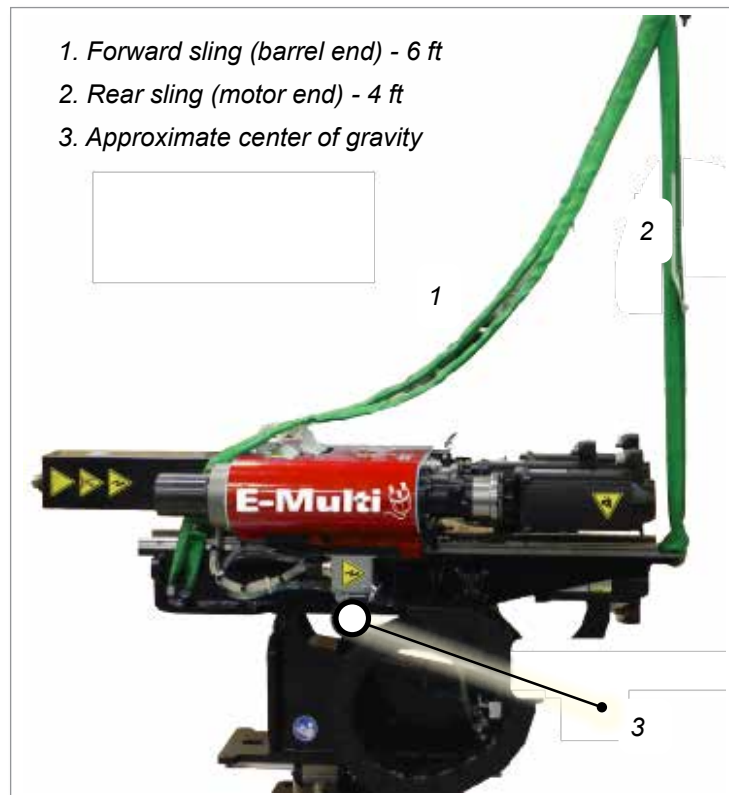


Figure 12-2 Sling positions of the E-Multi Radial vertical beam (in horizontal orientation) and the approximate location of the center of gravity.

7. Remove any rust inhibiting material that may be on the four machined surfaces of the horizontal and vertical beam interface. Apply a light coating of oil on these four surfaces.

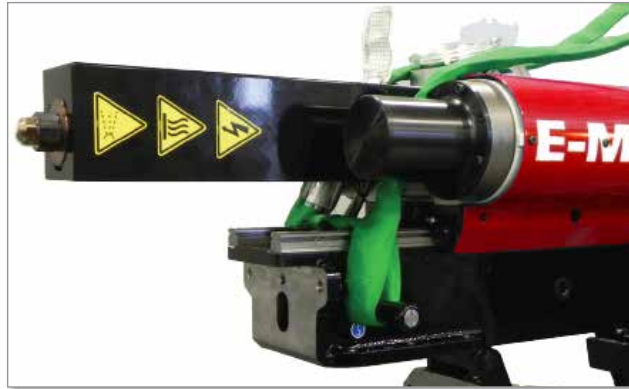


Figure 12-3 Forward sling attachment



Figure 12-4 Rear sling attachment

12.5 Inspection

1. Check that the E-Multi injection unit and the E-Multi Radial have not been damaged in transit.
2. Check all wires and cables. Ensure they are not kinked or damaged and are still connected properly.
3. Check for oil leaks on the machine. If visible, find the source of the leak and correct. Check oil level. See "Oil Bath" on page 9-7.



Figure 12-5 Oil fill kit (optional)

12.6 Installation

12.6.1 ER1 and ER2 Models



WARNING

See "Safety" on page 3-1.

It is the responsibility of the integrator to understand and follow international and local standards for safety of machinery when integrating the E-Multi Radial system into the molding system. This includes providing necessary e-stop connections, safety interlocks and guarding modifications to protect operators.

Ensure E-Multi Radial placement will not interfere with electrical cables on top of the mold or injection molding machine movement. Check that all coolant, hydraulic and air lines as well as electrical cables will not interfere with the moving parts of the mold, machine or robot. The lines must be of sufficient length so that they will not strain or pinch when the mold halves separate.

When installing, check the E-Multi highest position does not interfere with other moving equipment in the molding area (robots, cranes, etc.).

The E-Multi Radial has a high center of gravity which can shift during installation. Read all instructions prior to starting the installation procedure.

The center of gravity will move forward as the vertical beam is rotated, and the lifting point must be moved forward to remain above the center of gravity. However if the lifting point is moved too much the crate and E-Multi Radial can slide or lift off the floor.



WARNING - LOCKOUT

Ensure that all energies are properly locked out in the controller and injection molding machine before installation of the E-Multi injection unit into the system.



WARNING - LIFT POINTS

When doing any work on the machine that requires moving and lifting the machine, connect all lifting devices and support the machine using a crane of adequate capacity before commencing work. Failure to support the machine can result in severe injury or death. See "E-Multi Weight Specifications" on page 3-20.



NOTE

Please reference the installation drawing supplied with the unit for complete information on services and connections.





1. In preparation for mounting the E-Multi Radial to the injection molding machine, clean the stationary platen surface where the E-Multi Radial will be mounted.

NOTE

The E-Multi Radial is shipped with the injection unit in the horizontal position.

2. To move the unit to the vertical orientation, remove the screws mounting the cable tracks to the lower cable track bracket, and remove the two M10 shipping screws.

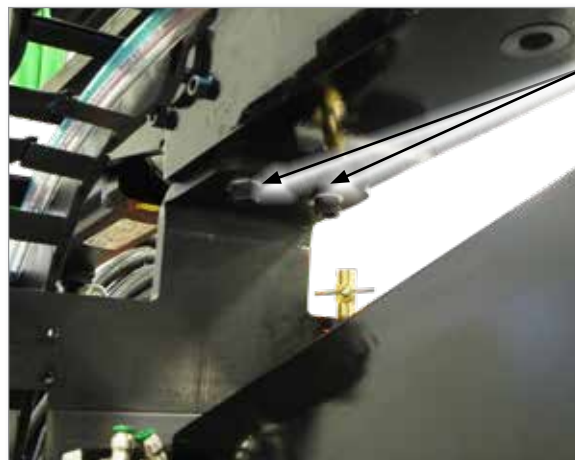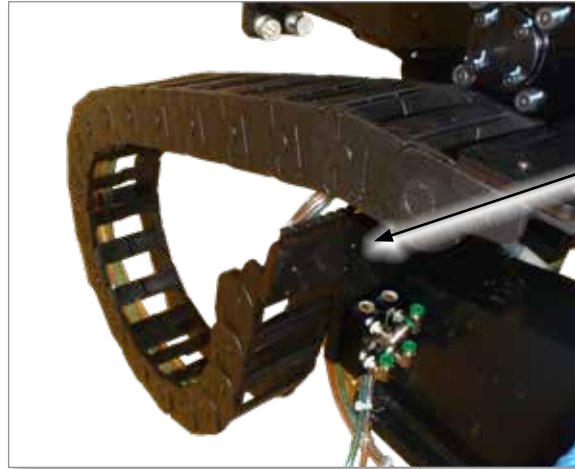

3. Slowly start raising the lifting machine, causing the upper “vertical beam” to rotate around the pivot pin, without lifting the entire E-Multi Radial off of the crate floor. Continue this process until the vertical beam is vertical, and the 2 machined faces are in contact.
4. Install two previously removed M10 shipping screws back into the vertical


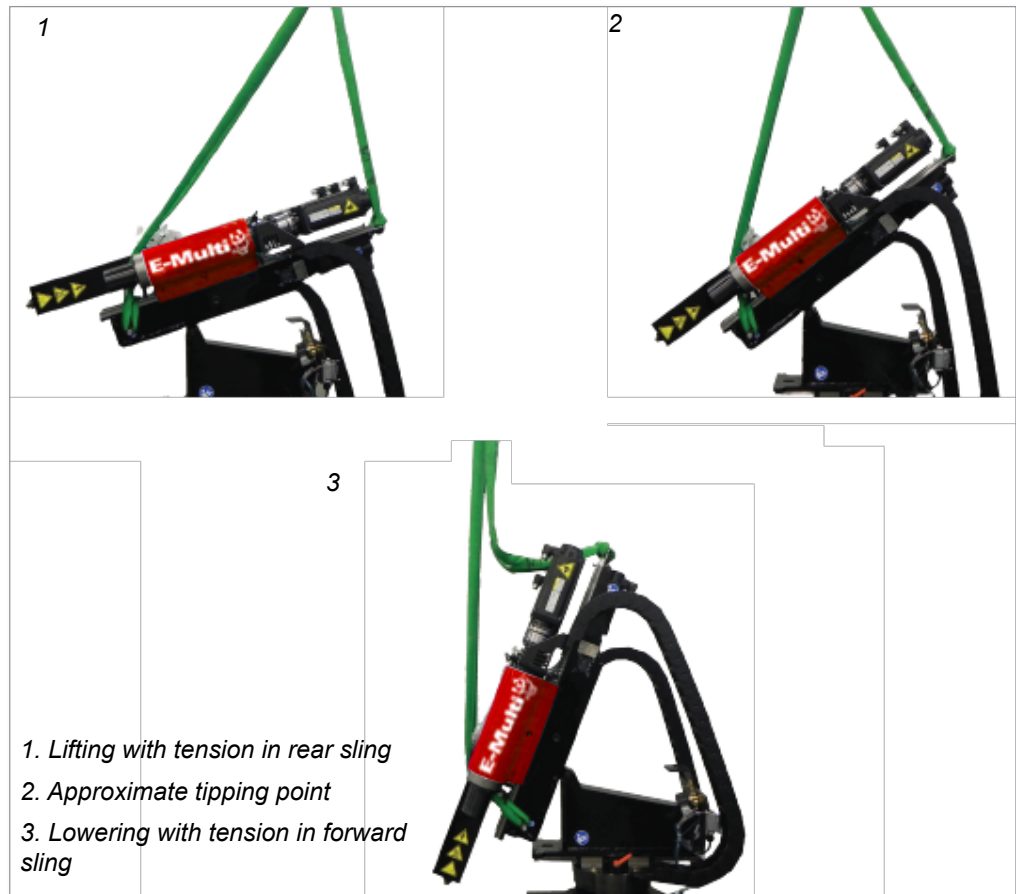


Figure 12-6 Tilting the E-Multi Radial from the horizontal to vertical position
beam and tighten.

5. Carefully insert, and thread, all nine M12x35 socket head caps screws (SHCS) bolting the upper and lower beam together.
 - a) Loosely tighten the SHCS in the order shown. This order is important to draw the vertical beam squarely into position.

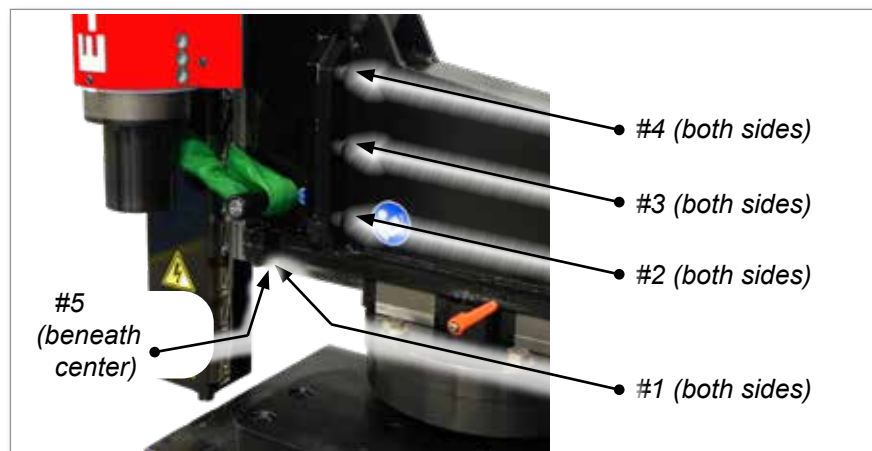

- b) Torque to half the recommended torque setting, following the same order as shown. See "Screw Torques" on page 10-1.
- c) Torque to the full recommended torque setting, following the same

order as shown. See "10.2 Screw Torques" on page 10-1.

6. Install the lower end of both cable tracks and connect the water and air lines.



7. Release the orange X-Axis brake and slide the unit back until it is balanced and stable.



8. Remove the lifting slings. Attach the appropriate lifting devices to the hole at the top of the E-Multi Radial vertical beam.



12.6.2 ER3 and ER4 Models



WARNING

Do not place any body parts between the two mating parts. Serious injury may result from having fingers or hands crushed between moving parts.




CAUTION

Do not tighten the clamping screw so much that the unit locks as this will prevent proper alignment of the nozzle to the inlet.

1. Remove adapter plate from shipping crate.




2. Place the adapter plate on the stationary platen. Install the bolts (M20X90) in a cross pattern and torque it to 339 Nm (250 ft-lbs).

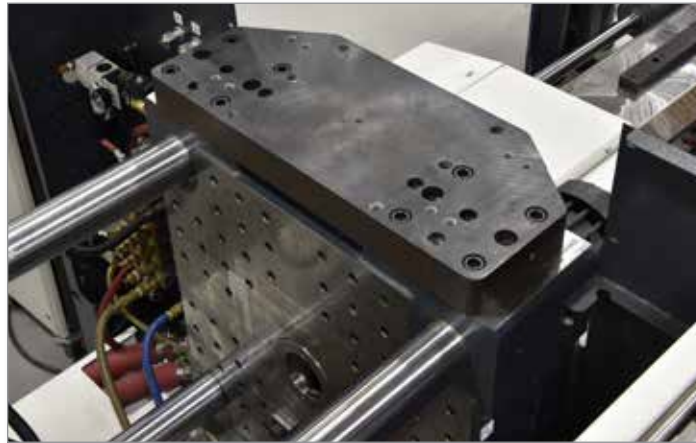


3. Remove the horizontal beam from the shipping crate. Rotate the horizontal beam so that the turret faces the ground.




4. Install the horizontal beam on the adapter plate. Insert and hand tighten the 4 bolts (M20X90) in the accessible holes.

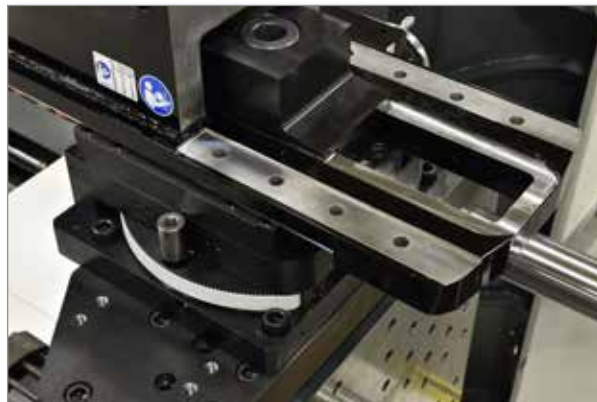


5. Unclamp the horizontal beam assembly with the clamping screw. Rotate the screw counterclockwise until the end of the head is flush with the support plate.

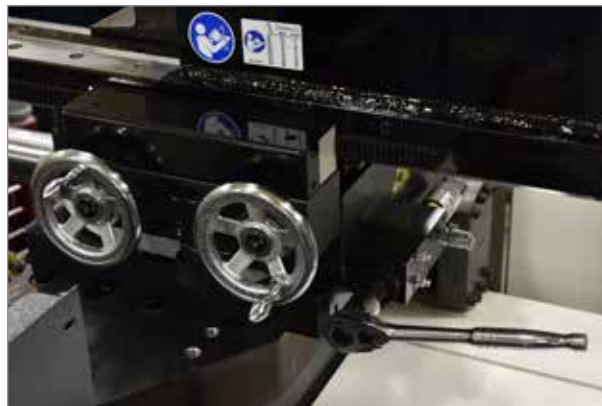

6. Use the rear hand crank and rotate the horizontal beam assembly 90° counter clockwise so that the other 2 bolt (M20X90) holes are accessible. Torque all accessible bolts in a cross pattern to 339 Nm (250 ft-lbs).

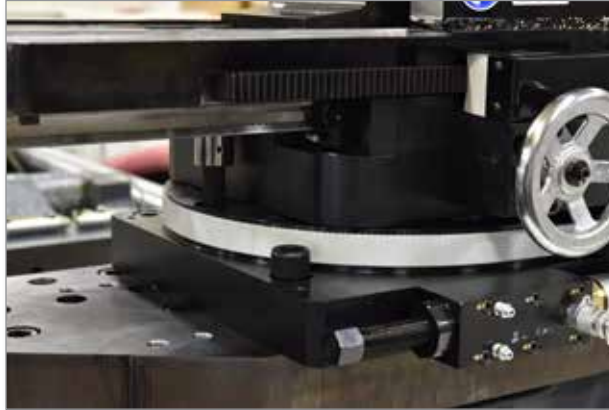

7. Use the rear hand crank and rotate the horizontal beam assembly so that it is in the home position (x-axis is parallel to tiebars). Torque the other two bolts to 339 Nm (250 ft-lbs).

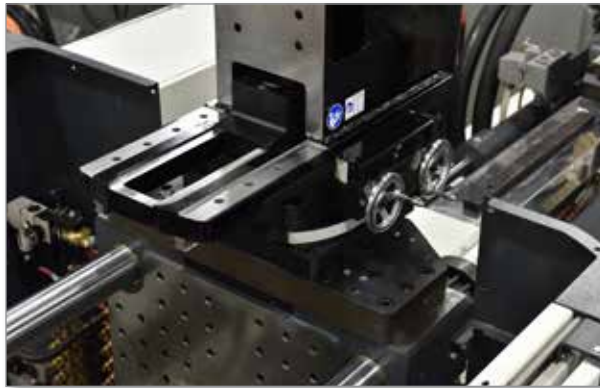


8. Use front hand crank and move the x-axis so that the vertical beam mounting flange is above the turret.



9. Lock horizontal beam assembly by turning clamping screw clockwise until there is about 10 mm (0.4 in.) between the head of the clamping screw and the screw collar on the manifold.
10. Install two M12 swivel hoist rings into the screw gearbox adapter ring.

11. Remove the vertical beam from the crate. Remove the swivel hoist rings.

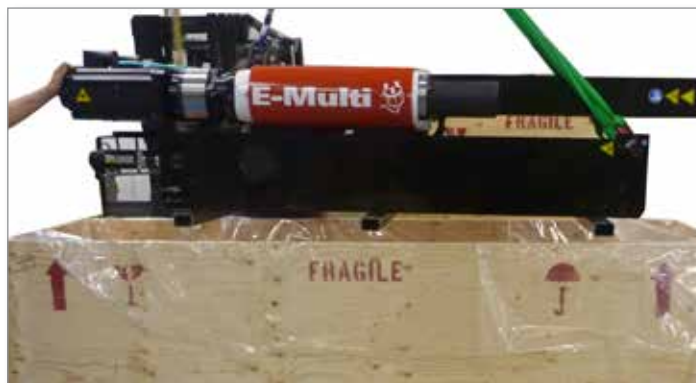

12. Attach lifting bar to vertical beam. Attach a 4 in. web sling (supplied) to each end of the lifting bar with a choker configuration.



13. Lift the vertical beam with two lifting devices. If a crane and forklift are used, the crane should lift the lifting bar end.



14. Change the beam orientation so that the beam is vertical with the lifting bar at the top.




IMPORTANT

Take care that the nozzle does not touch the ground.

15. Coat the mating faces of horizontal and vertical beam with grease, oil or rust preventive material to prevent corrosion. Move vertical beam to horizontal beam and mate together.



16. Install the 8 screws (M16X50) and secure the vertical beam to the horizontal beam and hand tighten.

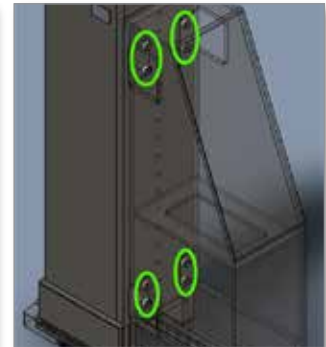

17. Install the 8 screws (M16X55) into the bottom of the horizontal beam and hand tighten.



18. Torque the lower four bolts (M16X50) into the vertical beam to 122 Nm (90 ft-lbs) in a cross pattern and repeat for the upper four bolts into the vertical beam.
19. Torque the 8 bolts from the horizontal beam to 240 Nm (180 ft-lbs) in a cross pattern.
20. Torque the four lower bolts into the vertical beam to 240 Nm (180 ft-lbs) in a cross pattern and repeat for the upper four bolts.
21. Remove the lifting bar.

22. Use a crane and lift the cable track assembly into position with a sling.
23. Install the large cable track bracket to the lower section of the horizontal beam with 3 screws (M10 X 35 SHCS).
24. Install large cable track to the bracket on the injection housing with 2 flat head screws (M6X16). Torque the screws to 10 Nm (7.4 ft-lbs).



25. Cut the cable ties which secures the small cable track to large cable track.
26. Install the small cable track to the barrel housing bracket with 2 flat head screws (M6x16). Torque the screws to 10 Nm (7.4 ft-lbs).



27. Connect the barrel heat cable.
28. Connect the cooling lines to quick connects.


29. Connect the motor cables to screw and injection motors. Motors and cables are clearly marked. Make sure that you connect the correct cables to the correct motors.



30. Secure the motor cables to the upper cable track bracket with cable ties. Make sure that the cables do not contact the injection housing when the injection housing moves.
31. Connect the pressure transducer cable to the pressure transducer on the injection housing.
32. Connect cooling lines to the manifold on the injection housing.
33. Connect carriage motor cables to carriage motor. Make sure that the cables do not interfere with the cable track and do not bind against the support beam. Verify once again when the system operates.
34. Remove the maintenance pin from the shipping position in support beam and install in storage position. Make sure that the pin does not interfere with cable track.



35. Connect the lower base pressure transducer cable.

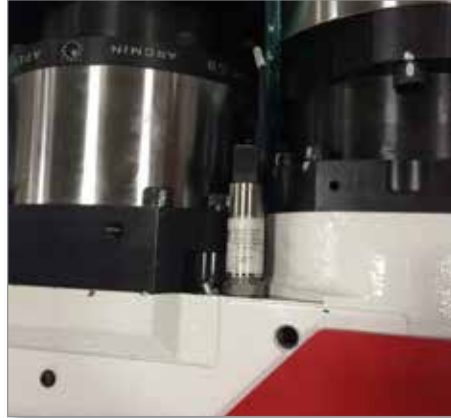

36. Connect the 24 pin I/O cable to connector on lower cable track bracket.



37. Install cooling line fittings into the manifold on the support beam cable track bracket. Test cooling system for leaks.
38. Turn on the controller and the barrel heats.
39. Rotate the clamping screw counterclockwise until the unit can be moved using the hand wheels. Check the color of the LED on the transducer connector. It should be red.
40. After the system reaches its temperature, use the hand wheels on the lower base to position the E-Multi nozzle as close as possible to the manifold inlet.
41. Press the **[F1]** button. It puts the controller in setup mode. The **[F1]** LED should flash.
42. Press and hold **[F4]** until the carriage moves down to 10 mm (0.4 in.).
43. Tap the gears icon to navigate to the service overview screen on the bottom button bar.
44. Tap the drive information button to navigate to the drive information screen.
45. Navigate to the carriage drive tab.
46. Press and hold **[F3]** until the carriage moves up to its end. Reference the carriage.
47. Tap the reference button. Wait until the status message says referenced.
48. Press and hold **[F4]** to move the carriage down until the nozzle is approximately 25 mm (1 in.) above the manifold inlet.

49. Use the hand wheels to align the barrel as close as possible to the manifold inlet.
50. Turn the clamping screw clockwise until slight resistance is felt in the hand wheels.
51. Press the [F4] button to move the nozzle towards the inlet. Use the hand wheels to keep the nozzle centered on the inlet.
52. Move the nozzle up and down, adjusting the position as necessary, until there is no visible deflection when it makes contact with the inlet.
53. Tighten the clamping screw until the lamp on the transducer connector turns green.
54. Move the carriage up and down again to verify there is still no deflection in the nozzle with the system clamped.
55. Calibrate the carriage from the screw settings page. Verify that the barrel does not deflect when the nozzle makes contact.
56. Navigate to the carriage setup page and set the nozzle movement mode.

Maintain forward: Nozzle moves to the mold and builds contact force on first cycle and stays in contact at the specified force until the cycle is stopped and the nozzle is moved back manually.

After injection: Nozzle moves to the mold and build contact force on the first cycle. After E-Multi injection completes, the nozzle moves back to the specified position and waits for the next cycle.

After hold: Same as after injection, except that the nozzle moves back after E-Multi hold completes.

12.6.3 Install onto an Injection Molding Machine

1. Lift the assembly into place above the injection molding machine's stationary platen. Install all adapter plate mounting screws and torque in a crosswise pattern. See "Screw Torque Specifications" on page 10-1.
2. Install the controller and complete all system connections.



NOTE

The E-Multi Radial controller and systems connection procedure is very similar the standard E-Multi controller connection procedure. See "Controller Installation" on page 6-3 and "System Setup" on page 7-1. Note that the E-Multi Radial has an additional set of cables for the carriage axis servo motor, and the cables are routed though two cable tracks.

3. Install the barrel heats connector. Route the cables through the cable track as shown in Figure 12-1.



Figure 12-1 Install the barrel heats connector

4. Attach the servo motor cables. Route the cables through the cable track as shown in Figure 12-2.



Figure 12-2 Attach the servo motor cables

Install onto an Injection Molding Machine - continued

5. Install the I/O connector as shown in



Figure 12-3 Install the I/O connector

12.7 Manual Position Adjustment



WARNING

Keep a firm hold on the assembly and use a slow, controlled motion when manually positioning the E-Multi Radial.

Manually use the E-Multi Radial range of movement to roughly align the E-Multi nozzle with the hot runner inlet. The controller will be used to fine tune the alignment and calibrate the carriage position in preparation for molding.




NOTE

The E-Multi Radial is designed to work with a spherical nozzle tip and a spherical hot runner inlet. A flat nozzle / inlet design is not recommended as leakage of molten plastic is likely. Contact an E-Multi representative for recommended design guidelines for the spherical nozzle tip / inlet geometry.

The clamping bolts are special hex flange bolts (yellow zinc in color) and differ from standard screws, as described in the "Table 10-2 Screw Torque Specifications" on page 10-1." However, the clamping bolts are still to be torqued to the same torque values.

1. Loosen the two M12 clamping bolts (front and back).

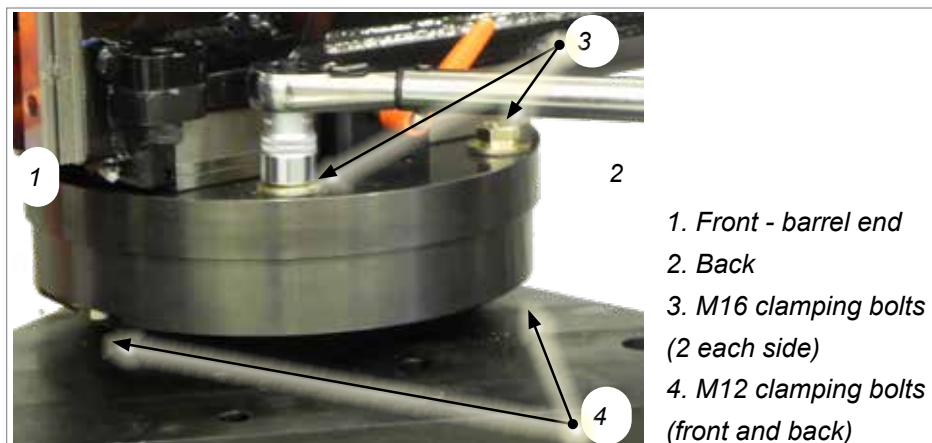

Manual Position Adjustment - continued

2. Loosen the four M16 clamping bolts until a small gap is visible between the locking and the rotating plate at approximately 0.1 to 0.3 mm (0.004 to 0.01 in.).

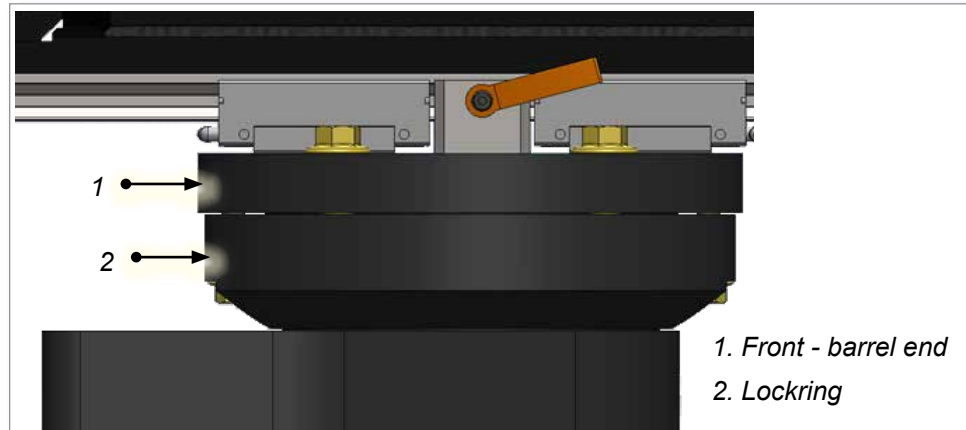



Figure 12-7 Gap between the rotating plate and locking

3. Release the rotary stopper - a white band will show on the plunger when released. Rotate the E-Multi Radial to the approximate angle required.



NOTE

The rotary stopper can be depressed to prevent further rotation. It can be depressed in rotational increments of 15°. It may not depress at the exact rotation position required for final nozzle concentricity.

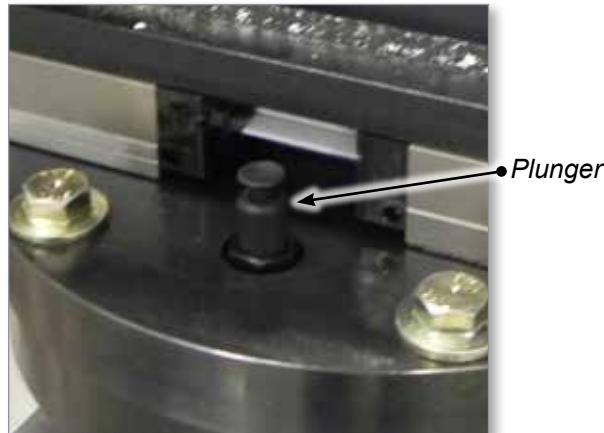

4. Loosen the X-Axis brake. Use the handles to position the E-Multi Radial to the correct X-Axis position. Tighten the X-Axis brake.
5. Clean all plastic and debris from the nozzle tip and hot runner inlet contact surfaces. Use a wire brush or similar tool.
6. With the controller in Setup mode, move the E-Multi downwards (forwards) until the nozzle is approximately 10 mm (0.4 in.) away from the hot runner inlet. If necessary, manually adjust the E-Multi Radial to improve the rough nozzle alignment.



NOTE

The rotary stopper may need to be released.

Manual Position Adjustment - continued

7. Lightly tighten the four M16 clamping bolts, until there is no visible gap between the locking and the rotating plate as viewed from the side. See Figure 12-7 on page 12-20.



NOTE

Do not overtighten the bolts. The unit should be able to rotate slightly by hand.

8. Loosen the X-Axis brake.
9. With the controller in Setup mode, move the E-Multi downwards (forwards) until it contacts the hot runner inlet. Continue to hold the Forward button for 2 more seconds after contact. The E-Multi Radial will self-align with the spherical inlet as it makes contact and will stay in contact for the following step.
10. Follow these steps to start to lock the Radial into position:
 - a) Torque the two, rear-most M16 clamping bolts to 160 Nm (118 ft-lbs)
 - b) Torque the two, forward-most M16 clamping bolts to 160 Nm (118 ft-lbs)
 - c) Finger tighten the two M12 clamping bolts
 - d) Tighten the X-Axis brake
11. Move the unit upwards (backwards) approximately 50 mm (2 in.) away from the inlet, or further if the nozzle and inlet need to be cleaned again.
12. Perform a carriage calibration following the procedure "Calibrate the Carriage Home Position" on page 10-12.
13. Loosen the X-Axis brake.
14. With the controller in Manual mode, move the unit downwards (forwards) until the nozzle contacts the inlet. Continue to hold the Forward button until the carriage Servo Brake Status indicator comes on. See the E-Multi Controller User Manual for more information.



NOTE

The nozzle will stay in contact with the inlet.

15. Follow these steps to lock the Radial into position:
 - a) Torque the two, rear-most M16 clamping bolts to the recommended torque of 248 Nm (183 ft-lbs)
 - b) Torque the two, forward-most M16 clamping bolts to the recommended torque of 248 Nm (183 ft-lbs)
 - c) Using a box wrench, tighten the two M12 clamping bolts (tight, plus a quarter turn)
 - d) Tighten the X-Axis brake to approximately 30 Nm (22 ft-lbf)
16. Move the unit upwards (backwards) 50 mm (2 in.).
17. Perform a carriage calibration following the procedure "Calibrate Home Position" on page 13-2.

The nozzle is now aligned and ready to be run in Automatic mode.

12.8 Home Position Calibration



NOTE

Calibrate the carriage home position when you install the E-Multi for the first time and when you use the E-Multi with a newly installed mold. Mold must be closed and clamped and barrel must be at operating temperature before calibrating the home position.

Set up the controller before you use the E-Multi Radial.

1. Make sure that the E-Multi is in Setup mode and the servo motors are turned on [F10].
2. Open the Carriage screen. See E-Multi Controller User Manual for more detailed instructions.
3. Push the calibrate button. See the “Carriage calibration settings” in E-Multi Controller User Manual.

The carriage touches the mold with a known force and sets the mold touch position to the 0.0 mm in the setup profile screen. The carriage then moves to 10 mm (0.4 in.) position. At this position the E-Multi is ready to be switched to Auto mode.



NOTE

You may see a deflection of the E-Multi Radial system when the nozzle contact force is applied. This deflection is normal and expected.

12.9 Auto Purge



WARNING

Use protective clothing, goggles and gloves.

Ensure that the protective guards are placed around the nozzle to prevent the molten plastic from splashing or drooling.

Material purged from the machine will be extremely hot.

The Auto Purge screen is used to adjust the settings and perform the Auto Purge. Push the [Start] and [Stop] buttons. Refer E-Multi Controller User Manual for the operation.

For details, see E-Multi Controller User Manual.

12.10 Maintenance

Follow the recommended maintenance in "Section 10 - Maintenance" on page 10-1. Additional E-Multi Radial maintenance instructions are listed here.

12.11 Service of the Carriage Assembly and Servo Motor



WARNING

The carriage assembly and specifically the servo motor should never be removed for maintenance. If the carriage assembly or the servo motor must be removed, please contact your Mold-Masters representative for instructions.

Removal of any of the carriage assembly, including the servo motor, any of the servo motor components, the gear box, or any of the mounting screws associated with this assembly, may cause the E-Multi unit to move down (forward) unexpectedly and may create a crushing or shearing hazard.

12.12 Spare Parts

Contact your Mold-Masters representative if you need any spare parts for the E-Multi Radial system.

Section 13 - Servo Carriage Option



WARNING

Ensure that you have fully read "Section 3 - Safety" before installing, calibrating, maintaining or operating the E-Multi Servo Carriage Option.

13.1 Introduction

This section provides information that is special to the E-Multi Servo Carriage Option "EMSC" for E-Multi injection units.

The E-Multi Servo Carriage has a servo controlled carriage axis which allows the system to be operated in sprue-break mode or in continuous nozzle contact mode.

When injection occurs in sprue-break mode, the nozzle retracts automatically from the sprue bushing. The nozzle retracts and extends with each injection cycle as required for parting line injection applications.

13.2 E-Multi Servo Carriage Specifications

| Table 13-1 E-Multi Servo Carriage Specifications | | | | | |
|--|----------------------------------|--------------------------|--------------------------------|-------------------------------|-----------------------------|
| E-Multi Model | Typical Clamp Size | Carriage Stroke mm (in.) | Nozzle Protrusion Max mm (in.) | Nozzle Contact Force kN (lbf) | Sprue Break Stroke mm (in.) |
| EM1 - 15SC | 100 - 450 ton, 90 - 400 tonne | 181 (7.1) | 6 (0.24) | 10 (2248) | ≤ 50 (2) |
| EM1 - 30SC | | 231 (9.1) | 56 (2.2) | | |
| EM2 - 50SC | | 281 (11.1) | 163 (6.42) | 17 (3822) | |
| EM2 - 80SC | | 331 (13) | 208 (8.19) | | |
| EM3 - SC | Not available at this time | | | | |
| EM4 - SC | Not available at this time | | | | |

13.3 Material Handling

13.3.1 Preparation

Refer to "Section 5 - Preparation" on page 5-1 for the preparation procedure.

13.3.2 Unpacking

Refer to "5.2 Unpacking" on page 5-2 for the unpacking procedure.

13.3.3 Inspection

Refer to "5.3 Inspection" on page 5-2 for the inspection procedure.

13.3.4 Installation

Refer to "Section 6 - Installation" on page 6-1 for the installation procedure.

13.4 Calibrate Home Position



NOTE

Calibrate the carriage home position when you install the E-Multi for the first time and when you use the E-Multi with a newly installed mold.

Set up the controller before you use the E-Multi Servo Carriage.

Set up the controller before you use the E-Multi Radial.

1. Make sure that the E-Multi is in Setup mode and the servo motors are turned on [F10].
2. Open the Carriage screen. See E-Multi Controller User Manual for more detailed instructions.
3. Push the calibrate button. See the "Carriage calibration settings" in E-Multi Controller User Manual.

The carriage touches the mold with a known force and sets the mold touch position to the 0.0 mm (0 in.) in the setup profile screen. The carriage then moves to 10.0 mm (0.4 in.) position. At this position the E-Multi is ready to be switched to Auto mode.





13.5 Auto Purge

WARNING

Use protective clothing, goggles and gloves.

Ensure that the protective guards are placed around the nozzle to prevent the molten plastic from splashing or drooling.

Material purged from the machine will be extremely hot.

The Auto Purge screen is used to adjust the settings and perform the Auto Purge. Push the Start and Stop buttons for the operation. See the E-Multi Controller User Manual for more information.

13.6 Maintenance

Follow the recommended maintenance in "Section 10 - Maintenance" on page 10-1.

13.7 Spare Parts

Contact your Mold-Masters representative if you need any spare parts for the E-Multi Servo Carriage system.

Section 14 - Servo Cooling Option



WARNING

Ensure you have fully read "Section 3 - Safety" before doing maintenance procedures or troubleshooting any issues with the E-Multi Servo Cooling Option.

14.1 Operation and Specifications

The cooling unit's pump powers up with the controller and continuously circulates fluid through the motors.

The E-Multi controller automatically switches the flow rate of coolant between high and low settings to maintain the motor temperatures in a safe range.

If there is insufficient cooling due to a failure of the system or external coolant flow, the controller will automatically shutdown the motor drives when the motor temperature reaches 85°C (185°F).

14.1.1 Closed Loop Specification

Pump high flow rate: 3.6 LPM (1 gal/min)

Pump low flow rate: 1.6 LPM (0.42 gal/min)

Pump pressure bypass: opens at 4.1 bar (60 psi)

Heat dissipation: 2.5 kW max

14.1.2 External Loop Specification

Max temp: 30°C (86°F)

Flow rate: 8-10 LPM (2.1 to 2.6 gal/min)

Pressure drop: 0.6 bar at 10 LPM (8.7 PSI at 2.6 gal/min)

Max pressure: 28 bar (406 PSI)

14.1.3 Materials in Contact with Coolant

| Table 14-1 Materials in Contact with Coolant | |
|--|-----------------------------------|
| Unit | Materials |
| Servo Motors | Al Mg 5 F32, Al Mg Si 0.5 F22 |
| Seals | EPDM, Viton, Cork |
| Fittings | Brass, Polypropylene, Steel, Zinc |
| Reservoir | Polycarbonate |
| Lines | Polyurethane, Rubber |
| Heat exchanger | Copper, Tin |
| Pump | Stainless Steel, Graphite |

14.2 Maintenance



WARNING

Disconnect the 4 pin pump connector from the cabinet when servicing or whenever the cooling circuit is opened to prevent accidental power-up of the pump with the controller.

Make sure that the controller cabinet is powered off and unplugged from the power source. Follow lockout / tagout procedures.

14.2.1 Drain the Coolant



CAUTION

Make sure that the E-Multi injection unit is flushed and completely purged of water.

Disconnect the pump before you empty the reservoir. Failure to do so will damage the pump if it runs dry.

1. Blow the compressed air into the supply hose of the E-Multi and drain the coolant into the reservoir.
2. Unscrew the drain plug as shown in the figure below and drain the coolant from the reservoir.

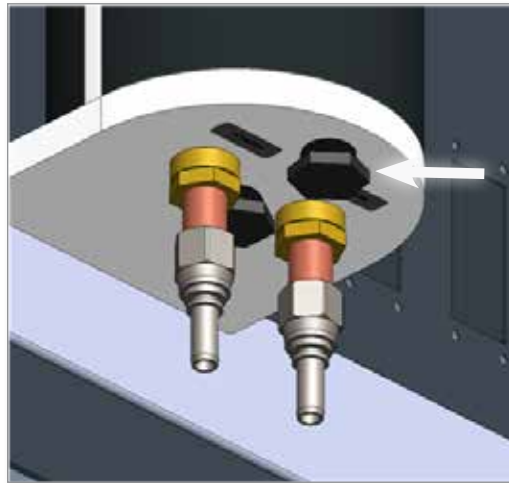


Figure 14-1 Bottom side of the cooling unit showing the drain plug

14.2.2 Clean / Replace the Heat Exchanger



WARNING

Drain the reservoir before the disassembly of the cooling unit. See 14.2.3.

Clean the Heat Exchanger:

Use a diluted solution of 5% acetic acid or any copper-safe aqueous acidic cleaning solution and flush the heat exchanger periodically depending on the mineral concentration in the cooling water. There is no need to remove the unit for cleaning.

Replace the Heat Exchanger:

1. Switch off the power of the controller and follow lockout / tagout procedures.
2. Unplug all coolant and electrical connections from the cooling unit.
3. With assistance, unscrew the four M10 mounting screws from inside the cabinet and place the cooler on a work bench.
4. Unscrew the plastic pipe plug which is between the inlet and outlet ports on the bottom of the unit.
5. Unscrew the M10 nut which is seen below the plug.
6. Remove the lower reservoir plug.
 - a) Tap the plug with a rubber mallet to overcome seal friction.
7. Unscrew the hose fittings from the ports of the heat exchangers.
8. Unscrew and remove the heat exchanger coil from the reservoir plug.



NOTE

Installation is the reverse of disassembly.

14.2.3 Troubleshooting

| Table 14-2 Troubleshooting | |
|---|---|
| Symptom | Resolution |
| Water leak emerging from between pump enclosure and upper plug. | Remove the pump enclosure by undoing the four acorn nuts on top. Inspect threaded fitting connections. Inspect pump inlet tubing for damage. Repair or replace as required. |
| Water leaking at connections on closed or open circuit sides. | Tighten threaded connections or replace. Inspect tubing and hoses for damage. Repair or replace as required. |
| Low flow through heat exchanger (open loop side connections). | Follow instructions in section "14.2.2 Clean / Replace the Heat Exchanger" |
| Pump does not turn on when cabinet is powered up. | Check that the cabinet exhaust fans are running, if they are not, reset the 5A breaker that they share with the pump. The breaker is located in the high voltage side of the controller. Turn controller off before opening door. |

Section 15 - Stands



WARNING

Ensure you have fully read "Section 3 - Safety" before using or maintaining the E-Multi stand.



WARNING - TIP OVER HAZARD

The stands are intended for supporting E-Multi injection units at the machine when used in the horizontal position. They are not for transporting the E-Multi injection unit and would be top heavy and present a tip hazard. The E-Multi injection unit and stand assembly should be moved together by crane using the proper E-Multi injection unit lift points. See "E-Multi Weight Specifications" on page 3-20 for lift points.

Do not modify stands to reduce or add height, for example, adding additional holes or not bolting the upper and lower columns together. Such changes would impact the stand stability and could result in serious injury as well as damage to the machine.

15.1 Introduction

E-Multi stands are designed to support the E-Multi injection machines when used in a horizontal feed orientation.

15.2 Stand Options

E-Multi stands come in two main designs: compact and heavy duty. See the "Table 15-1 E-Multi Stand Options" on page 15-1 to determine which stand design can be used for each E-Multi model.

Each design is manufactured in a number of top column, base column and frame base options to provide a range of minimum and maximum heights. Your order documentation will indicate your stand type. If you require spare parts, or to find out more about other stand options, please contact your Mold-Masters representative.

| Table 15-1 E-Multi Stand Options | | | | |
|----------------------------------|-----|-----|-----|-----|
| E-Multi Model | EM1 | EM2 | EM3 | EM4 |
| Compact Stand | Yes | Yes | Yes | No |
| Heavy Duty Stand | No | No | Yes | Yes |



Figure 15-1 Compact stand



Figure 15-2 Heavy duty stand

15.3 Compact Stand

15.3.1 Main Components

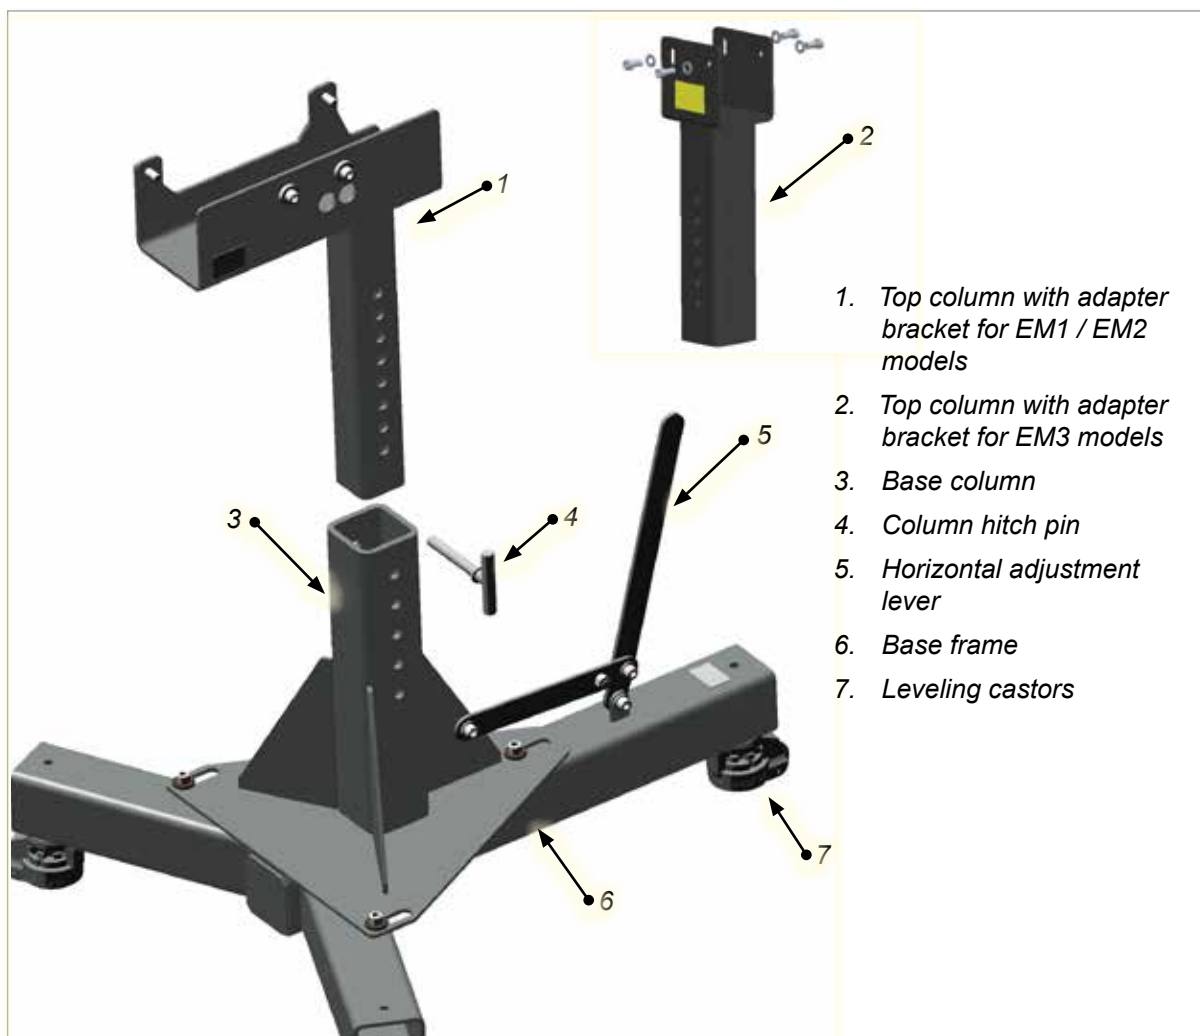


Figure 15-3 Compact stand main components

15.3.2 Horizontal Position Adjustment

The compact stand lever is used to move the E-Multi adapter plate position toward or away from the mold to aid installation and removal from the mold. The compact stand range of horizontal position adjustment is 50-75 mm (2 to 3 in.).

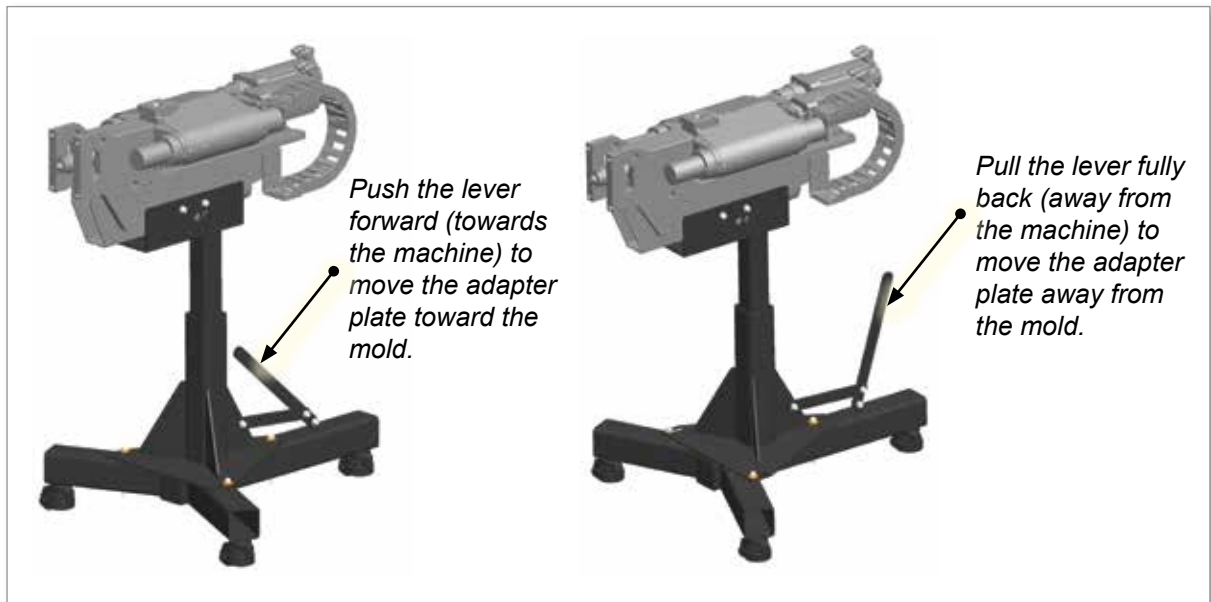


Figure 15-4 Compact stand horizontal position adjustment

15.3.3 Assembly

The compact stand is shipped with the base column assembled to the base frame.

1. Install the top column into the base column and secure with the column hitch pin.

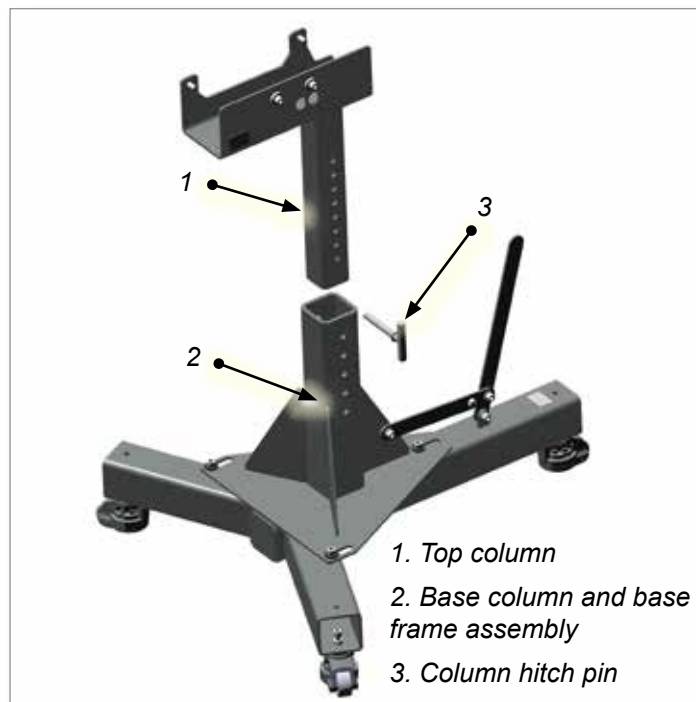


Figure 15-5 Compact stand assembly

15.4 Heavy Duty Stand

15.4.1 Main Components

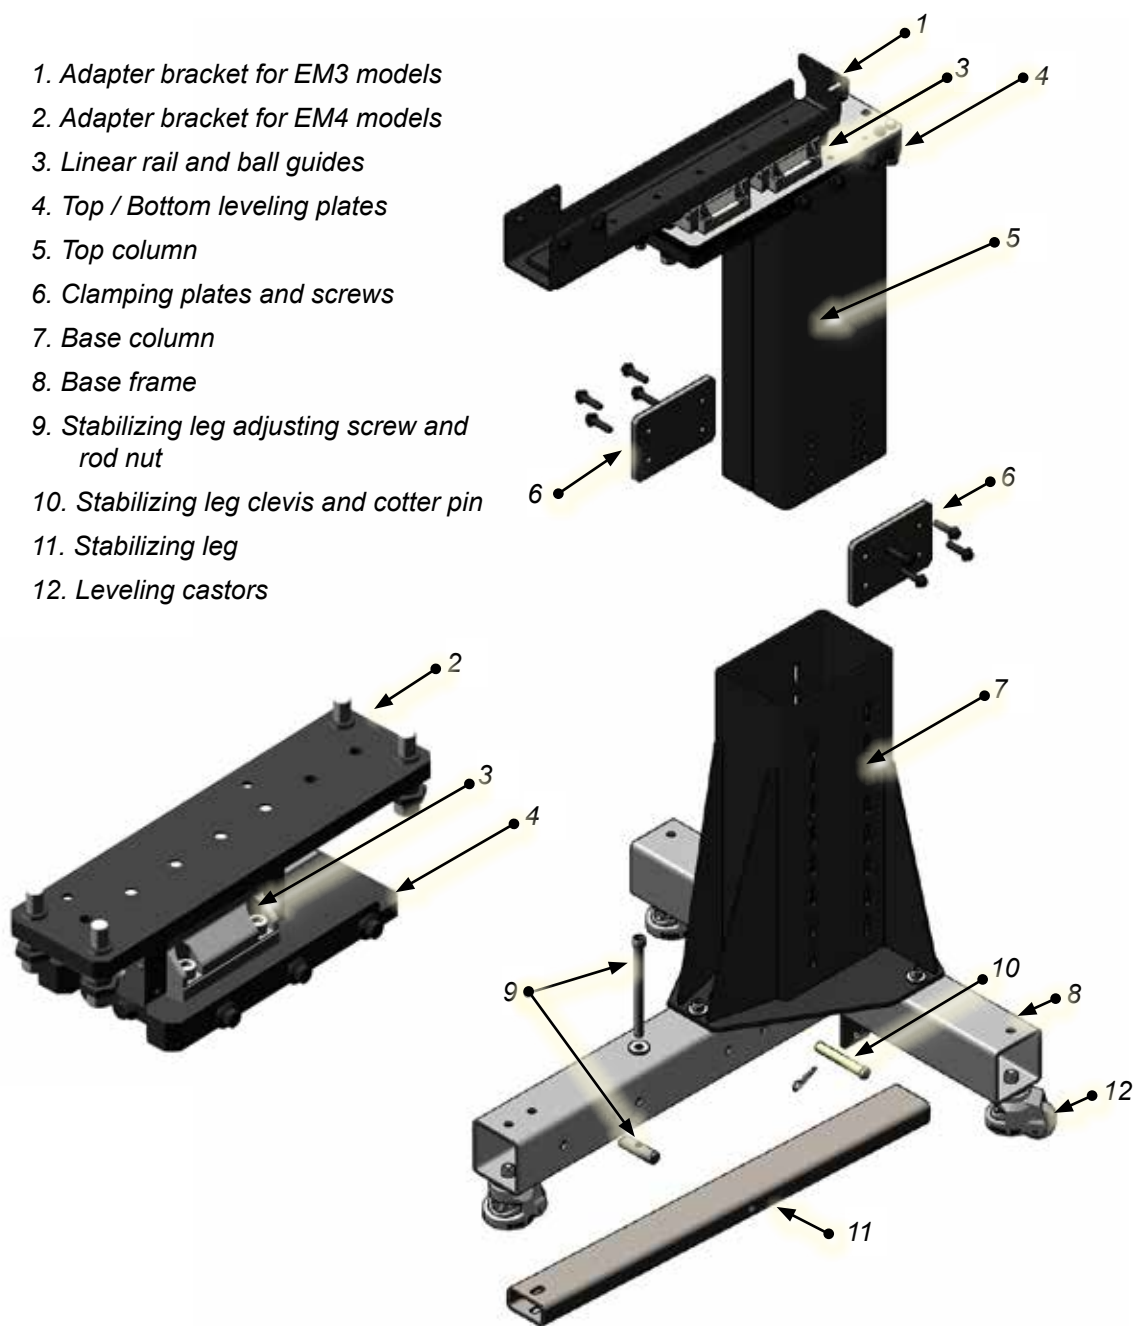


Figure 15-6 Heavy duty stand main components

15.4.2 Horizontal Position Adjustment

The heavy duty stand linear rail / ball guide assembly is used to move the E-Multi adapter plate position toward or away from the mold, to aid installation and removal from the mold.

- EM3 stand range of horizontal position adjustment is 0-125 mm (0-4.92 in.)
- EM4 stand range of horizontal position adjustment is 0-30 mm (0-1.18 in.)

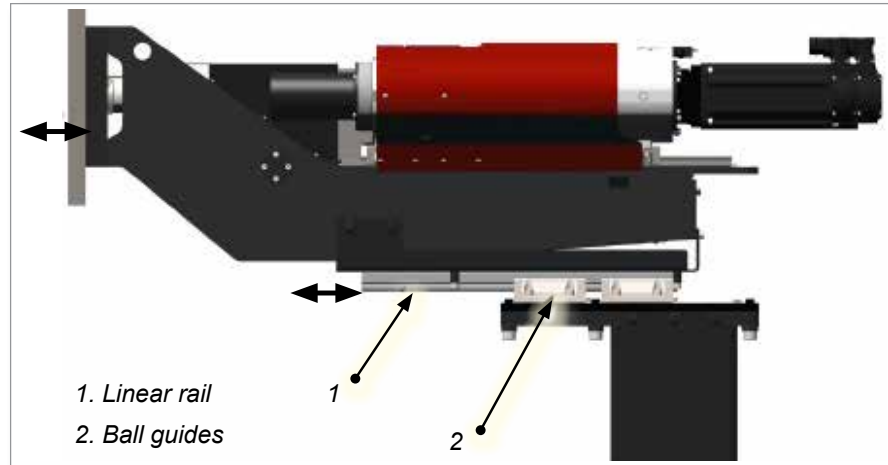


Figure 15-1 Heavy duty stand horizontal position adjustment

15.4.3 Front or Back Leg Position



WARNING

In either orientation, the stabilizing leg must be in contact with the floor to prevent the assembly tipping.

The stand can be placed with the lead leg of the base frame under the front or the rear of the E-Multi injection unit. The most stable configuration is with the lead leg under the front of the E-Multi injection unit, but it can be reversed if the injection molding machine set up does not have enough space for the lead leg to be forward.

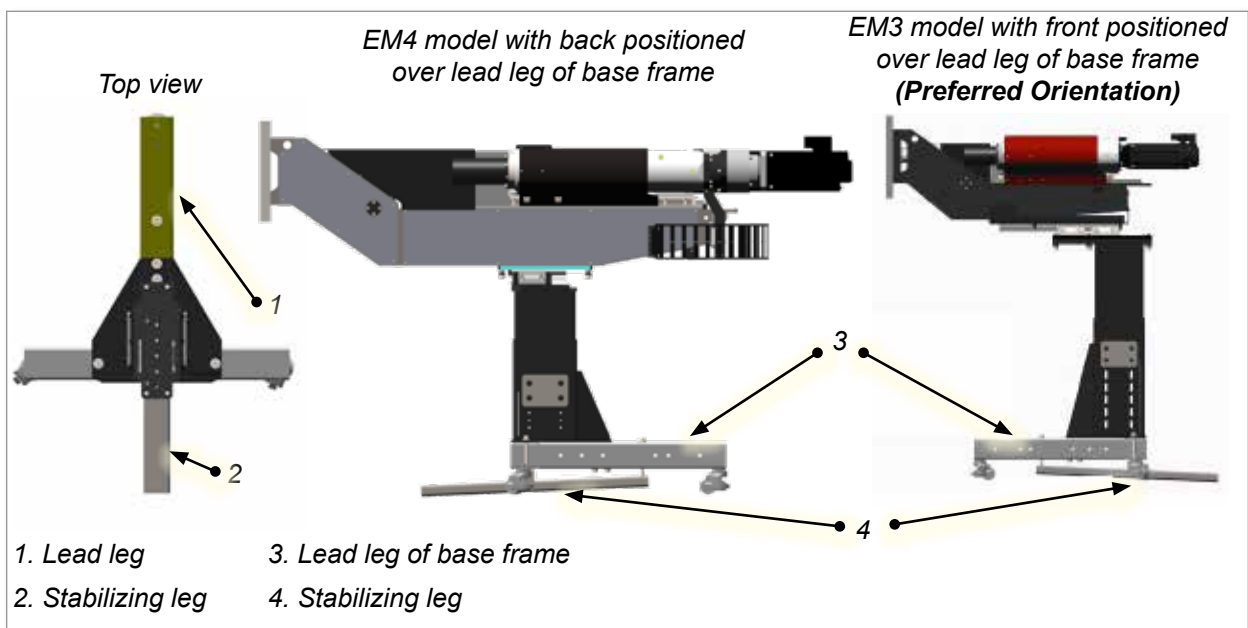


Figure 15-7 Heavy duty stand - front or back leg position

15.4.4 Counter Weight Kit (Optional)

**WARNING - TIP OVER HAZARD**

Do not remove the counter weights while the injection unit is supported by the stand. This will create a tip hazard.

Counter weight kits for heavy duty stands can be purchased to add further stability to the E-Multi injection unit / stand assembly or in cases where the stabilizing leg will not fit under the injection molding machine. The counter weight brackets are installed onto the lead leg of the base frame and the weights assembled onto the bracket posts.


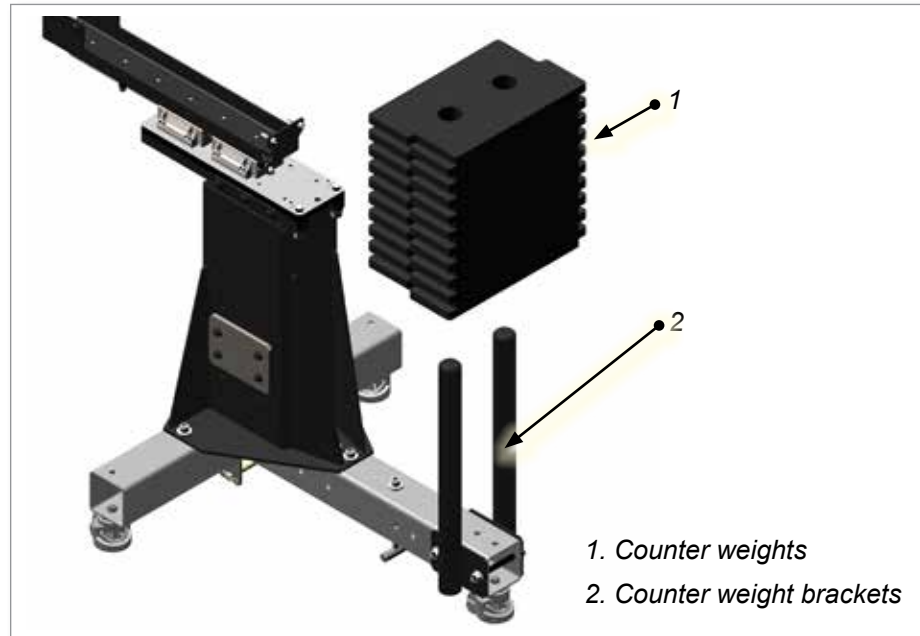



Figure 15-8 Heavy duty stand counter weight kit

15.4.5 Assembly


1. Assemble stand in the lowest position (the clamp plates can be loose).

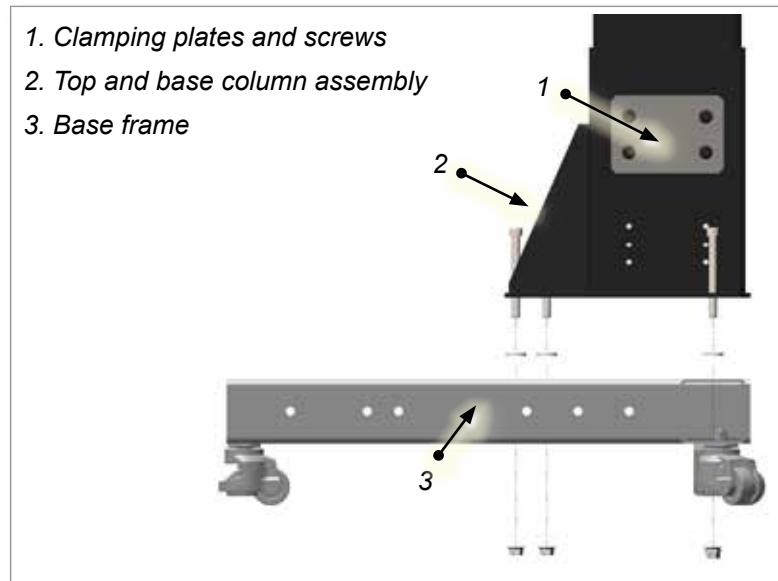

2. Place the stabilizing leg under the base frame and install onto the clevis bracket with the clevis pin. Secure the clevis pin with the cotter pin.

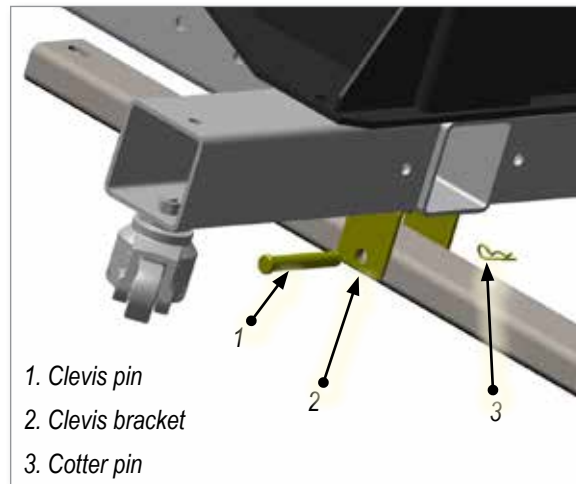

3. Install the stabilizing leg adjusting screw into the screw nut in the end of the stabilizing leg. Adjust the stabilizing leg is not touching the floor when moving the stand into position.

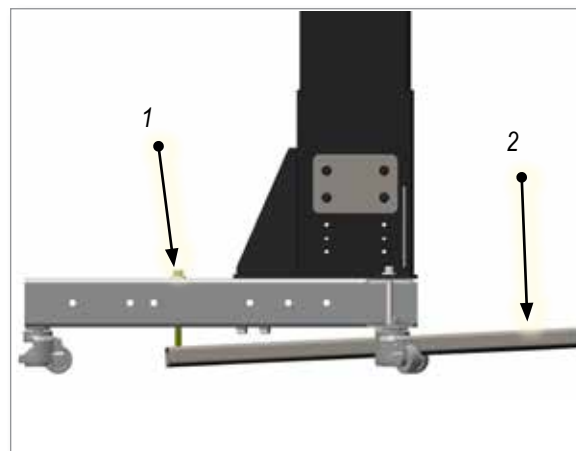

1. Stabilizing leg adjusting screw
2. Stabilizing leg position up and not touching the floor

15.5 Leveling Castors



WARNING

The E-Multi injection unit must be operated with the leveling castor pads bearing the weight of the unit. Failure to use the leveling pads may cause the castor wheels to fail and lead to unexpected and dangerous unbalancing of the E-Multi injection unit.

Once the E-Multi injection unit is in position at the machine, the leveling castor pads are extended equally until the stand is resting on the pads and the wheels are not touching the ground. With the wheels off the ground, the leveling pads can be used to provide additional height adjustment to align the adapter plate with the mold. The leveling castors also provide a height fine adjustment of 12-15 mm (0.47-0.59 in.) depending on the stand.

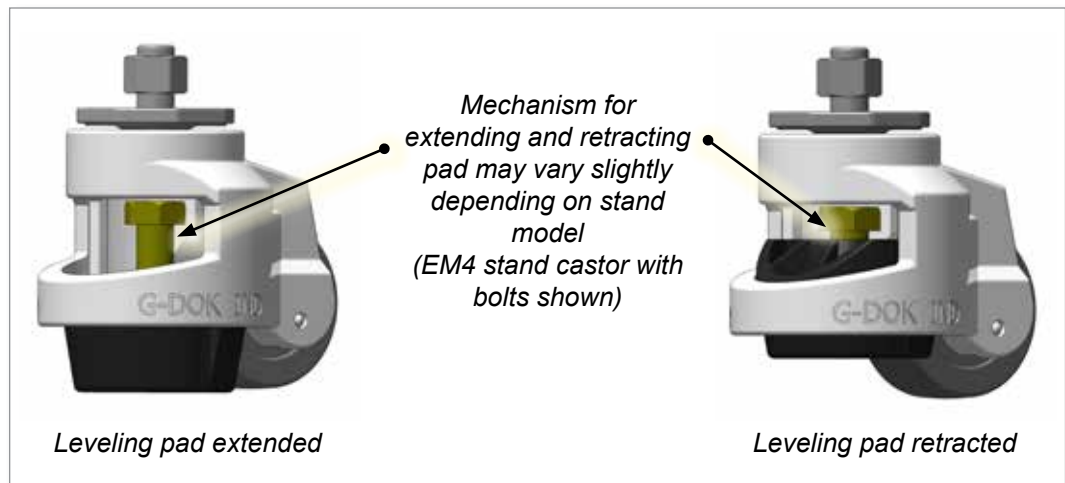


Figure 15-9 E-Multi stand leveling castors

15.6 Mold Installation



CAUTION

Do not move the stand with the unit installed without crane support.

1. Roll the assembled (empty) stand close to the injection molding machine, i.e. within 3 m (9.84 ft).
2. Install adapter plate onto E-Multi machine. See "Adapter Plate Removal and Installation" on page 10-5.
3. Attach lifting devices and crane to the E-Multi injection unit as outlined in "E-Multi Weight Specifications" on page 3-20. Using the crane, install the E-Multi injection unit into the stand adapter bracket. Secure using correct screws. Torque according to "Screw Torques" on page 10-1.
4. With the crane still supporting the E-Multi injection unit and stand assembly, move the assembly into position near the mold.
5. Remove the column hitch pin (compact stand) or clamping plates (heavy duty stand). Using the crane, slowly lift the E-Multi injection unit until the center line height is approximately 3-6 mm (0.12 to 0.24 in.) below the center height of the mold inlet for the E-Multi injection unit. This will allow the fine height adjustment to be completed using the leveling castors.

Mold Installation - continued

6. Install the column hitch pin (compact stand) or clamping plates (heavy duty stand). Torque the clamping plate screws as specified in Table 10-2 on page 10-1.
7. Slowly lower the crane until the E-Multi injection unit is supported by the stand, but do not remove the attachment to the crane.
8. Adjust the 3 leveling castors to raise the stand until the E-Multi injection unit center line is aligned to the mold center line.
9. Use the stand horizontal adjustment to slowly move the E-Multi adapter plate forward to contact the mold.
10. Fasten the adapter plate to the mold. Torque adapter plate screws to specified torque. See "Screw Torques" on page 10-1. The tightening of these screws will move the E-Multi injection unit and stand slightly so that the nozzle and mold inlet are properly aligned.
11. Move the stand as far towards the injection molding machine possible. This will ensure the largest possible clearance when moving the injection unit away from the mold using the horizontal adjustment.
12. Verify that the 3 leveling castor pads are in full contact with the floor. Raise one leveling castor pad until it is not in contact with the floor. Then slowly lower the same castor pad until it makes contact with the floor (i.e. finger tight). Using a wrench, tighten a further 1/4 turn, but do not over-tighten. Repeat for the other leveling castors.


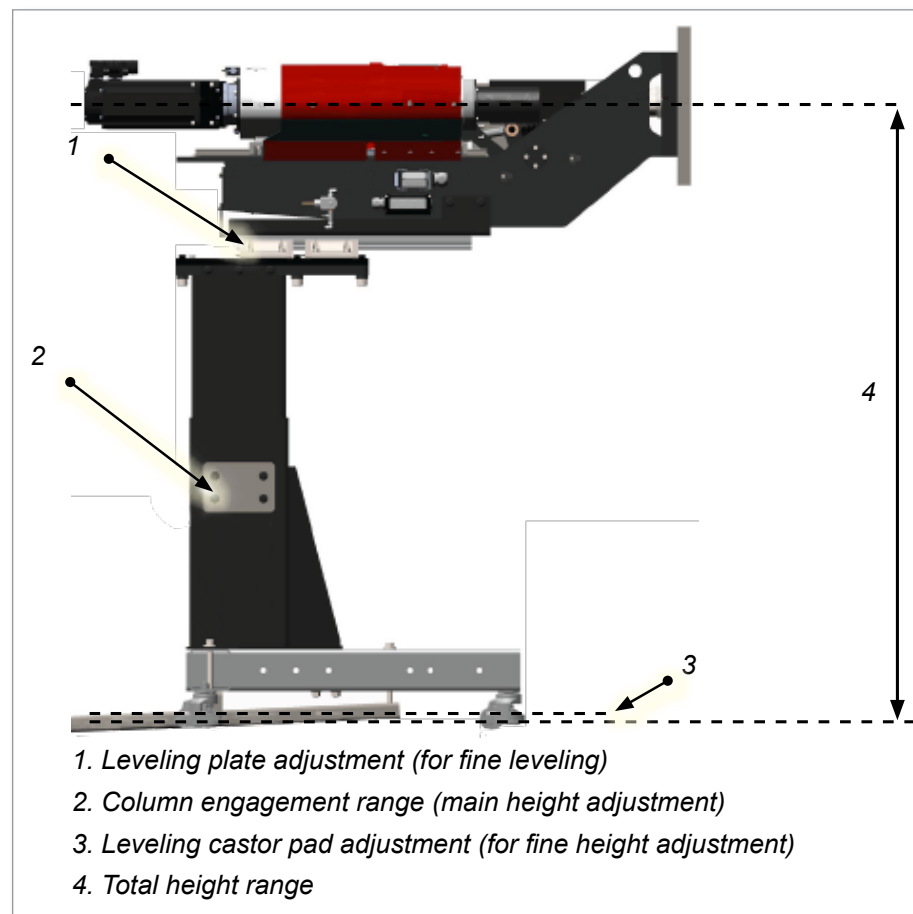



Figure 15-2 E-Multi injection unit stand-to-mold installation

Mold Installation - continued

- 13. Heavy Duty Stand** - If necessary, the top leveling plate may be adjusted in order to obtain fine leveling alignment. The SHCS should be loosened only enough to allow the plate to be raised and leveled by the set screws. After final leveling, the locking screws must be torqued to the levels found in Table 10-2 on page 10-1.

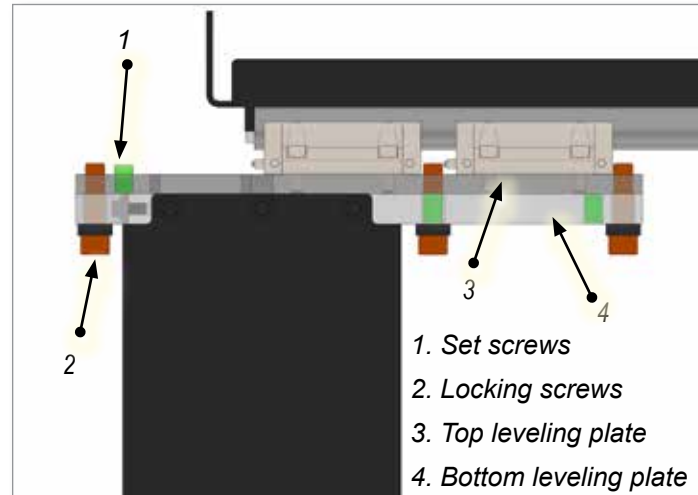

- 14. Heavy Duty Stand** - Slowly lower the stabilizing leg until it makes light contact with the floor, then tighten the adjusting screw by a 1/2 turn more. Do not overtighten this screw or it will raise the leveling castors off the floor. Verify that each castor is in full contact with the floor.

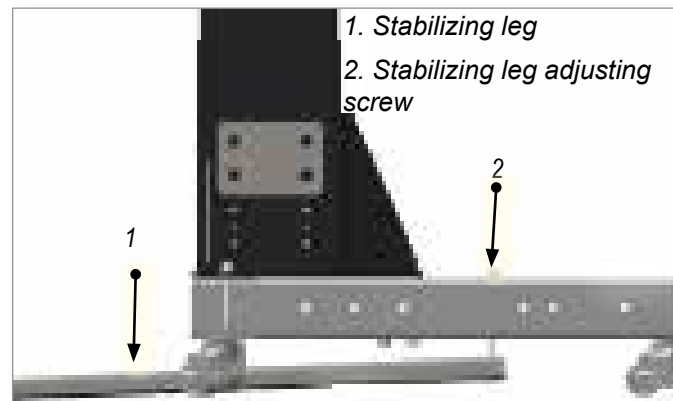

- 15.** Verify that the load is stable, and fully supported by the stand and the mold. Once this is verified, the attachment to the crane may be removed.

15.7 Mold Removal

1. Remove the bolts fastening the adapter plate to the mold.
2. Move stand horizontal adjustment fully back:
 - **Compact stand** - pull lever away from the injection molding machine
 - **Heavy duty stand** - move the linear rail fully back on the ball guides and lock
3. Remove mold.

15.8 Disassembly



CAUTION

Do not move the stand with the unit installed without crane support.

1. Remove the screws fastening the adapter plate to the mold.
2. Move the stand horizontal adjustment fully back:
 - **Compact stand** - push lever away from the injection molding machine
 - **Heavy duty stand** - move the linear rail fully back on the ball guides and lock
3. Attach the lifting devices and crane to the E-Multi injection unit and stand assembly and with the crane move the assembly away from the machine.
4. Remove screws fastening the stand to the E-Multi injection unit.

Figure 15-10 With the crane, lift the E-Multi injection unit up and away from the stand.
5. For the heavy duty stand - adjust the stabilizing leg adjusting screw so the stabilizing leg is not touching the floor.
6. Retract the level castor pads so the stand, on its own, can be rolled to desired location on the castors.

Section 16 - Euromap 67

16.1 Scope and Application

This EUROMAP 67 recommendation defines the connection between the injection molding machine and the handling device / robot. This is intended to provide interchangeability. In addition recommendations are given for signal voltage and current levels.

Please note that the risk assessment for the movements of the handling device / robot mostly require redundancy which is achieved by two channels on ZA3, ZC3 and ZA4, ZC4 on the injection molding machine. EUROMAP 12 shall therefore only be applied for replacement purposes on existing equipment.

16.2 Description

The signals in both the injection molding machine and the handling device / robot are given by contacts, e.g. contacts of relays or switches, semiconductors, etc. The contact making is either potential-free or related to a reference potential supplied to a contact of the plug mounted on the injection molding machine or the handling device / robot. All signals which are not optional shall be supported by all injection molding machines and handling devices / robots.

16.3 Plug and Socket Outlet

The connection between the injection molding machine and the handling device / robot is achieved by the plugs specified below. For the injection molding machine and the handling device / robot the plug contacts should be capable of taking a minimum of 250 V and 10 A.

| Table 16-1 Plug on the Injection Molding Machine | | |
|---|-------------------------------------|--|
| Signals from the Injection Molding Machine to the Handling Device / Robot | | |
| Contact No. (Male) | Signal Designation | Description |
| ZA1 ZC1 | Emergency stop of machine channel 1 | The switch contact must be open when the injection molding machine emergency stop device is being actuated. Opening the switch contact causes emergency stop of the handling device / robot. |
| ZA2 ZC2 | Emergency stop of machine channel 2 | The switch contact must be open when the injection molding machine emergency stop device is being actuated. Opening the switch contact causes emergency stop of the handling device / robot. |
| ZA3 ZC3 | Safety devices of machine channel 1 | The switch contact is closed when safety devices (e.g. safety guards, footboard safety, etc.) on the injection molding machine are operative so that dangerous movements of the device / robot are possible. The signal is active in operation mode. The signal must be the result of limit switch contact series of mold area safety devices according to EN 201. |

Plug and Socket Outlets - continued

| Table 16-1 Plug on the Injection Molding Machine | | |
|---|---|--|
| Signals from the Injection Molding Machine to the Handling Device / Robot | | |
| Contact No. (Male) | Signal Designation | Description |
| ZA4 ZC4 | Safety devices of machine channel 2 | The switch contact is closed when safety devices (e.g. safety guards, footboard safety, etc.) on the injection molding machine are operative so that dangerous movements of the handling device / robot are possible. The signal is active in any operation mode. The signal must be the result of limit switch contact series of mold area safety devices according to EN 201. |
| ZA5 | Reject | HIGH signal when the molding is a reject. HIGH signal when the mold is open and must remain HIGH at least until "Enable mold closure". Optional. See contact No A6. It is recommended to have HIGH signal already when the mold opening starts. |
| ZA6 | Mold closed | HIGH signal when the mold closing is completed. Note: The signal "Enable mold closure" is then no longer required. See contact No A6. |
| ZA7 | Mold open position | HIGH signal when mold opening position is equal or more than required position. Inadvertent alteration to mold opening stroke smaller than that required for the handling device / robot to approach must be impossible. The signal must remain HIGH as long as the mold is open and must not be interrupted by a change of operation mode or safety guard opening. |
| ZA8 Optional | Intermediate mold opening position | HIGH signal when mold opening reaches a set position smaller than mold opening position. See table 1: injection molding machine signals contact No ZA7. The signal remains HIGH to the end of mold opening position. Two sequences are possible with this signal: a) Mold opening stops on intermediate position and gives start signal to handling device / robot. Mold opening restarts with the signal "Enable full mold opening". See contact No A7. b) Mold opening does not stop on intermediate position, however gives the signal to handling device / robot. At this sequence the signals "Enable full mold opening". See connection A7 and "Mold area free" (See A3/C3) are not in use. LOW signal when intermediate mold opening position is not in use. |
| ZA9 | Supply from handling device / robot | 24 V DC (Reference potential) |
| ZB2 | Enable operation with handling device / robot (Automatic) | HIGH signal when the injection molding machine is able to be operated with handling device / robot. This signal shall not be used to start the handling device / robot. If the signal turns LOW during the operation mode of the handling device / robot "operation with injection molding machine", it is recommended that the handling device / robot continues its automatic cycle until the end position. |
| ZB3 | Ejector back position | HIGH signal when the ejector has been finally (e.g. after the number of its set cycles) retracted regardless of the moving platen position. The signal is the acknowledgement for the "Enable ejector retraction" signal (See contact No B3), when the ejector sequence is selected. It is recommended to have HIGH signal when the ejector sequence is not in use. |

Plug and Socket Outlets - continued

| Table 16-1 Plug on the Injection Molding Machine | | |
|---|--|--|
| Signals from the Injection Molding Machine to the Handling Device / Robot | | |
| Contact No. (Male) | Signal Designation | Description |
| ZB4 | Ejector forward position | HIGH signal when the ejector has been advanced. The signal is the acknowledgement signal for the "Enable ejector advance." See contact No B4. It is recommended to have HIGH signal when the ejector sequence is not in use. |
| ZB5 Optional | Core pullers 1 in position 1 (Core pullers 1 free for handling device / robot to approach) | HIGH signal when the core pullers 1 are in position 1. See contact No B5. It is recommended to have LOW signal when the core puller sequence is not in use. |
| ZB6 Optional | Core pullers 1 in position 2 (Core pullers 1 in position to remove molding) | HIGH signal when the core pullers 1 are in position 2. See contact No B6. It is recommended to have LOW signal when the core puller sequence is not in use. |
| ZB7 Optional | Core pullers 2 in position 1 (Core pullers 2 free for handling device / robot to approach) | HIGH signal when the core pullers 2 are in position 1. See contact No B7). It is recommended to have LOW signal when the core puller sequence is not in use. |
| ZB8 Optional | (Core pullers 2 in position to remove molding) | HIGH signal when the core pullers 2 are in position 2. See contact No B8. It is recommended to have LOW signal when the core puller sequence is not in use. |
| ZC5 | | Reserved for future use of EUROMAP. |
| ZC6 | | Reserved for future use of EUROMAP. |
| ZC7 | | Reserved for future use of EUROMAP. |
| ZC8 | | Not fixed by EUROMAP, manufacturer dependent. |
| ZC9 | Supply from handling device / robot | 0 V (Reference potential) |

Plug and Socket Outlets - continued

| Table 16-2 Plug on the Injection Molding Machine | | |
|---|---|---|
| Signals from the Handling Device / Robot to the Injection Molding Machine | | |
| Contact No (Female) | Signal Designation | Description |
| A1 C1 | Emergency stop of handling device / robot Channel 1 | The switch contact must be open when the handling device / robot emergency stop is being actuated. The switch contact opening causes emergency stop of the injection molding machine. The switch contact must be operative if the handling device / robot is switched off. It is recommended that the switch contact is operative when the handling device / robot is unselected. |
| A2 C2 | Emergency stop of handling device / robot Channel 2 | The switch contact must be open when the handling device / robot emergency stop is being actuated. The switch contact opening causes emergency stop of the injection molding machine. The switch contact must be operative if the handling device / robot is switched off. It is recommended that the switch contact is operative when the handling device / robot is unselected. |
| A3 C3 | Mold area free | The switch contact is closed when the handling device / robot is outside the mold area and does not interfere with mold opening and closing movements. The switch contact must be opened when the handling device / robot leaves its start position. If the switch contact is open neither opening nor closing of the mold may occur. However the injection molding machine may ignore this signal when mold opening is carried out after e.g. an intermediate stop (See contact No ZA8), if the optional sequence is selected on the injection molding machine. The signal must have the described effect even when the handling device / robot is switched off. It is recommended to close the switch contact when the handling device / robot is unselected. |
| A4 C4 | | Reserved for future use by EUROMAP. |
| A5 | | Not fixed by EUROMAP, manufacturer dependent. |
| A6 | Enable mold closure | HIGH signal when the handling device / robot is retracted enough for start of mold closure. The signal must remain HIGH at least until "Mold closed" (See contact No ZA6) is available. If the signal is LOW as a result of a fault, mold closing must be interrupted. The signal "Enable mold closure" must not be a logical "or" with either other signals, e.g. "Close safety guard" or a push button in any operation mode. The signal must be HIGH if the handling device / robot is switched off. It is recommended to have HIGH signal when the handling device / robot is unselected. |
| A7 Optional | Enable full mold opening | HIGH signal when the handling device / robot has taken the part and allows to continue mold opening. The signal must remain HIGH until "Mold open" signal is given by the injection molding machine. See contact No ZA7. |
| A8 | | Reserved for future use by EUROMAP |

Plug and Socket Outlets - continued


| Table 16-2 Plug on the Injection Molding Machine | | |
|---|--|---|
| Signals from the Handling Device / Robot to the Injection Molding Machine | | |
| Contact No (Female) | Signal Designation | Description |
| A9 | Supply from injection molding machine | 24V DC / 2A (Reference potential) |
| B2 | Handling device / robot operation mode (operation with handling device / robot) | LOW signal when the handling device / robot mode switch is "Operation with injection molding machine". HIGH signal when the handling device / robot mode switch is "No operation with injection molding machine". HIGH signal when the handling device / robot is switched off. |
| B3 | Enable ejector back | HIGH signal when the handling device / robot enables the movement for ejector back. The signal must remain HIGH at least until "Ejector back" signal is given by injection molding machine See contact No ZB3. |
| B4 | Enable ejector forward | HIGH signal when the handling device / robot enables the movement for ejector forward. The signal must remain HIGH at least until "Ejector forward" signal is given by the injection molding machine. See contact No ZB4. |
| B5 Optional | Enable movement of core pullers 1 to position 1 (Enable movement for handling device / robot to approach freely) | HIGH signal when the handling device / robot is in position to enable the movement of the core pullers 1 to position 1. It is recommended that the signal remains HIGH at least until "Core pullers 1 in position 1" signal is given by injection molding machine (see contact No ZB5). The signal shall remain at least until position 2 has been left. See contact No ZB6. |
| B6 Optional | Enable movement of core pullers 1 to position 2 (Enable core pullers 1 to remove the molding) | HIGH signal when the handling device / robot is in position to enable the movement of the core pullers 1 to position 2. It is recommended that the signal remains HIGH at least until "Core pullers 1 in position 2" signal is given by injection molding machine. See contact No ZB6. The signal shall remain at least until position 1 has been left. (See contact No ZB5). |
| B7 Optional | Enable movement of core pullers 2 to position 1 (Enable movement for handling device / robot to approach freely) | HIGH signal when the handling device / robot is in position to enable the movement of the core pullers 2 to position 1. It is recommended that the signal remains HIGH at least until "Core pullers 2 in position 1" signal is given by injection molding machine. See contact No ZB7. The signal shall remain at least until position 2 has been left. See contact No ZB8. |
| B8 Optional | Enable movement of core pullers 2 to position 2 (Enable core pullers 2 to remove the molding) | HIGH signal when the handling device / robot is in position to enable the movement of the core pullers 2 to position 2. It is recommended that the signal remains HIGH at least until "Core pullers 2 in position 2" signal is given by injection molding machine. See contact No ZB8. The signal shall remain at least until position 1 has been left. See contact No ZB7. |
| C5 | | Not fixed by EUROMAP, manufacturer dependent. |
| C6 | | Reserved for future use by EUROMAP. |
| C7 | | Reserved for future use by EUROMAP. |
| C8 | | Not fixed by EUROMAP, manufacturer dependent. |
| C9 | Supply from injection molding machine | 0V (Reference potential) |

Section 17 - Water Quality

| Table 17-1 Detailed Water Quality Specification | | | |
|--|---------------|-------------|-------------|
| Constituents | Units | Closed Loop | Tower Water |
| pH | pH Units | 7.2 - 8.5 | 7.2 - 8.5 |
| "M" Alkalinity | ppm | N/A | < 500 |
| "P" Alkalinity | ppm | 0 | 0 |
| Total Hardness (as CaCO ₃) | ppm | < 10 | 60 - 800 |
| Calcium Hardness (as CaCO ₃) | ppm | < 10 | 60 - 800 |
| Conductivity | µmhos/cm | < 3000 | 1000 - 2000 |
| Ryznar Stability Index | RSI | 5.0 - 6.0 | 5.0 - 6.0 |
| Cations | | | |
| Aluminum (as Al) | ppm | < 0.1 | < 0.1 |
| Copper (as Cu) | ppm | < 0.05 | < 0.1 |
| Manganese (as Mn) | ppm | < 0.05 | < 0.05 |
| Total Iron (as Fe) | ppm | <0.5 | < 0.1 |
| Anions | | | |
| Free Chlorine (as Cl ₂) | ppm | 0 | < 1.0 |
| Chloride (as Cl) | ppm | < 400 | < 400 |
| Sulfate (as SO ₂) | ppm | < 300 | < 300 |
| Silica (as SiO ₂) | ppm | < 150 | < 150 |
| Microbiological Activity | | | |
| Sulfate Reducing Bacteria | Col./ml | < 1 | < 1 |
| Total Aerobic Bacteria | Col./ml | < 10 000 | <10 000 |
| Solids | | | |
| Suspended Solids | ppm | < 10 | < 10 |
| Solid Size | µm | < 5 | < 5 |
| Maximum Corrosion Rate (of 90 Day Test Specimens, If Used) | | | |
| Aluminum | mils Per Year | < 0.25 | < 0.5 |
| Copper | mils Per Year | < 0.25 | < 0.2 |
| Mild Steel | mils Per Year | < 1.0 | < 2.0 |
| Zinc | mils Per Year | < 2.0 | < 2.0 |

Appendix A


Purge Guard (optional)

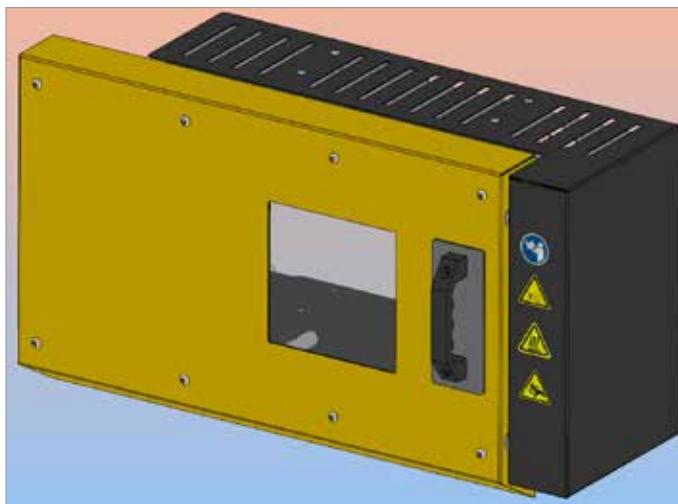

The E-Multi controller has an input for monitoring the state of the purge guard. A switch on the purge guard sends a signal to the input when the purge guard is closed. The E-Multi controller has a dry contact that mimics the state of the purge guard switch. The contact is wired in series with the IMM purge guard so that the E-Multi purge guard functions in the same way as the IMM purge guard.


Open the purge guard

1. Pull up the handle to unlock the guard, and slide the purge guard to the left.

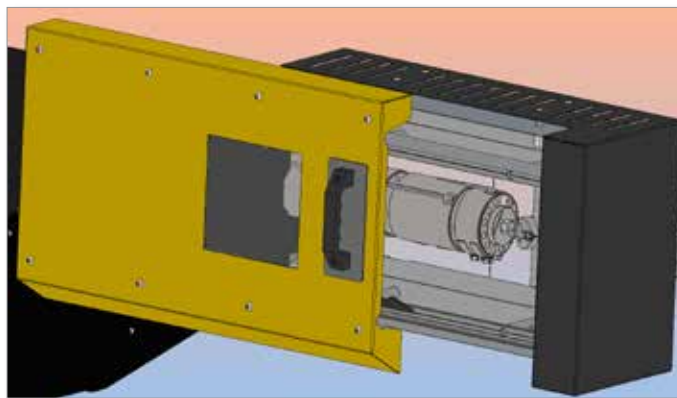

Close the purge guard (Remove a purge alarm)

1. Use the handle of the purge guard to slide the purge guard fully to the right.

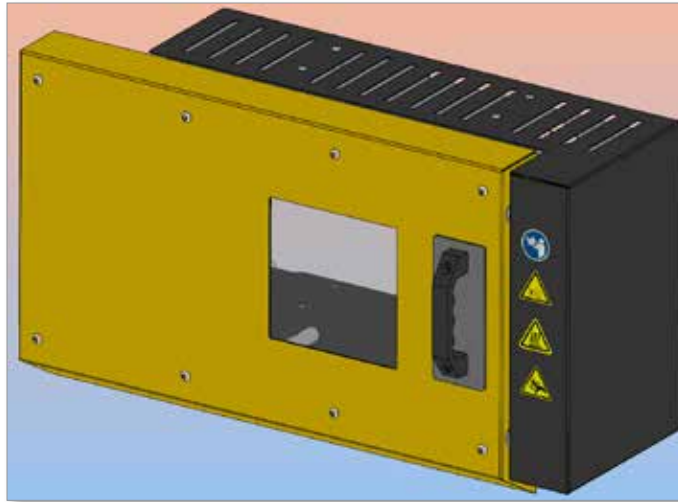

The purge guard alarm is removed from the top bar of the controller screen.

Index

A

- adaptor plate
 - installing...10-5
 - removing...10-5
- air connections...7-5
- alarms
 - control system...11-2
 - servo motor temperature...11-3
 - system...11-1
 - transducer output...11-1

B

- barrel
 - installing...10-31
 - removing...10-31
- barrel head
 - removing...10-17
 - replacing...10-17
- belt
 - adjusting the tension...10-36
 - installing...10-37
 - removing...10-37
 - tensions...10-2

C

- component tests...11-1
- controller
 - connecting handheld HMI...7-4
 - connecting to diagnostic computer...7-9
 - connecting to E-Multi...7-1
 - connecting to IMM...7-4
 - connecting to robot...7-4
 - installing...6-3
 - repairing...10-39
 - servicing. See controller, repairing
 - shutdown...8-1
 - startup...8-1
- cooling lines
 - contamination...10-4
 - servo motor
 - cleaning...10-4
- cooling water
 - purging from system...10-3
 - quality...7-7
 - schematic...7-7
- corrosion...7-7
- crate contents...5-1

D

- disposal...3-12
- document release details...1-1

E

- E-Multi
 - attaching to mold...6-2
 - components...4-2
 - lifting...3-21
 - models...4-1
 - moving for maintenance...10-4
 - moving to work surface...10-4
 - operation...8-1
 - radial option...12-1
- ER1 and ER2 models
 - installation...12-5
- ER3 and ER4 models
 - installation...12-9
- E-Radial
 - specifications...12-1, 13-1
- Euromap 67
 - plug and socket outlets...16-1–16-5

F

- feed assembly
 - removing...10-22
 - replacing...10-24
- feed screw
 - cleaning...10-27
 - installing...10-28
 - preparing for removal...10-25
 - removing...10-26

H

- hazard areas...3-2
- heater continuity check...11-1
- heater replacement...10-18

I

- injection axis
 - referencing...10-14
- injection ball screws
 - lubricating...9-9
- injection nozzle
 - replacing...10-8
- installation...6-1

L

- lift connections
 - horizontal EM1, EM2, EM3...3-23
 - horizontal EM4...3-31
 - vertical EM1, EM2, EM3...3-22
- lift procedures
 - EM4...3-24–3-31

linear guides
 lubricating...9-23
 linear guides and ball screws
 checking lubrication of...9-9
 lubrication...9-1
 linear guides...9-9

M

maintenance...10-1
 preventive
 schedule...9-1

N

nozzle protrusion
 adjusting the...10-8–10-13

O

oil
 bath
 filling...9-8
 circuit
 charging...9-6
 fill kit...9-5
 pressures
 preload...9-4
 oil bath level
 checking...9-7
 operation...8-1
 option
 radial...12-1
 servo carriage...13-1
 servo cooling...14-1

P

plastic
 purging from system...10-3
 pneumatic connections...7-5
 preload oil pressures
 checking...9-1
 preventive maintenance schedule...9-1
 purge guard...A-1

R

radial option...12-1
 Auto-Purge...12-22
 calibrating home position...12-22
 components...12-2
 installation...12-5–12-18
 manual position adjustment...12-19
 spare parts...12-23
 specifications...12-1
 unpacking...12-3–12-4
 release details
 document...1-1
 returned goods policy...1-1

S

safety
 guards...3-19
 hazard areas...3-2
 hazards
 E-Multi...3-13
 E-Multi Radial...3-16
 lockout...3-10
 symbols...3-7
 on E-Multi...3-18
 screw torques...10-1
 service. See support
 servo carriage option...13-1
 Auto-Purge...13-3
 home position
 calibrating...13-2
 maintenance. See maintenance
 spare parts...13-3
 specifications...13-1
 servo cooling option...14-1
 draining coolant...14-2
 heat exchanger
 cleaning, replacing, troubleshooting...14-3
 maintenance...14-2
 setup...7-1
 shipping contents...5-1
 shutdown...8-1–8-2
 shutoff nozzle
 maintenance...10-15
 stands...15-1
 compact
 adjusting the horizontal position, assembly...15-3
 main components...15-2
 disassembly...15-11
 heavy duty
 adjusting the horizontal position, front or back leg
 position...15-5
 assembly...15-7
 counter weight kit...15-6
 main components...15-4
 installing E-Multi on mold...15-8
 levelling castors...15-8
 options...15-1
 removing from mold...15-11
 startup...8-1
 support...2-1

T

test
 heater continuity...11-1
 thermocouple electrical...11-1
 vibrator valve...11-2
 tests
 component...11-1

- thermocouple
 - electrical check...11-1
- thermocouples
 - transferring to new barrel. See heater replacement
- torques
 - other...10-2
 - screw...10-1
- transducer output check...11-1

V

- vibrator valve
 - checking...11-2

W

- warranty...1-1
- water
 - connections
 - coolant and additives...7-6
 - quality...17-1
- wiring check...3-8

NORTH AMERICA

CANADA (Global HQ)
tel: +1 905 877 0185
e: canada@moldmasters.com

U.S.A.
tel: +1 248 544 5710
e: usa@moldmasters.com

SOUTH AMERICA

BRAZIL (Regional HQ)
tel: +55 19 3518 4040
e: brazil@moldmasters.com

MEXICO
tel: +52 442 713 5661 (sales)
e: mexico@moldmasters.com

EUROPE

GERMANY (Regional HQ)
tel: +49 7221 50990
e: germany@moldmasters.com

UNITED KINGDOM
tel: +44 1432 265768
e: uk@moldmasters.com

AUSTRIA
tel: +43 7582 51877
e: austria@moldmasters.com

SPAIN
tel: +34 93 575 41 29
e: spain@moldmasters.com

POLAND
tel: +48 669 180 888 (sales)
e: poland@moldmasters.com

CZECH REPUBLIC
tel: +420 571 619 017
e: czech@moldmasters.com

FRANCE
tel: +33 (0)1 78 05 40 20
e: france@moldmasters.com

TURKEY
tel: +90 216 577 32 44
e: turkey@moldmasters.com

ITALY
tel: +39 049 501 99 55
e: italy@moldmasters.com

ASIA

CHINA (Regional HQ)
tel: +86 512 86162882
e: china@moldmasters.com

KOREA
tel: +82 31 431 4756
e: korea@moldmasters.com

JAPAN
tel: +81 44 986 2101
e: japan@moldmasters.com

SINGAPORE*
tel: +65 6261 7793
e: singapore@moldmasters.com

*Coverage includes Southeast Asia

INDIA (Regional HQ)
tel: +91 422 423 4888
e: india@moldmasters.com

OCEANIA

AUSTRALIA
tel: +61 407 638 314
e: australia@moldmasters.com

NEW ZEALAND
tel: +61 407 638 314
e: newzealand@moldmasters.com